
1					TION			
DEPARTMENT OF THE INTERIOR			OIL CONSERVATIO ARTESIA DISTRICT JUN 1 6 2014		UW	FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010 5. Lease Serial No. NMNM124659		
BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS				10 2014	5. Lease Serial N			
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposation EIVED						6. If Indian, Allottee or Tribe Name		
SUBMIT IN TRIPLICATE - Other instructions on reverse side.					7. If Unit or CA/	7. If Unit or CA/Agreement, Name and/or No.		
1. Type of Well Gas Well Other						8. Well Name and No. BURTON 6 FEDERAL 001		
2. Name of Operator Contact: DAVID A EYLER CIMAREX ENERGY CO OF COLORADMail: DEYLER@MILAGRO-RES.COM				, <u>, , , , , , , , , , , , , , , , , , </u>	9. API Well No. 30-015-3822	9. API Well No. 30-015-38226		
3a. Address 600 N. MARIENFELD, SUITE MIDLAND, TX 79701		3b. Phone No. (include area code) Ph: 432-687-3033			10. Field and Pool, or Exploratory PARKWAY; BONE SPRING			
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)				11. County or Parish, and State				
Sec 6 T20S R30E Mer NMP NWNW 150FNL 660FWL				EDDY COUNTY, NM				
12. CHECK APP	ROPRIATE BOX(ES) T	O INDICATE	ENATUR	E OF NOTIO	CE, REPORT, OR OT	HER DATA		
TYPE OF SUBMISSION	TYPE OF ACTION				ION			
X Notice of Intent	🗖 Acidize 🗖 Dee		pen 🗖 Produ		roduction (Start/Resume	e) 🔲 Water Shu	t-Off	
□ Subsequent Report			—		eclamation			
☐ Final Abandonment Notice	Casing Repair	÷ ·		—	ecomplete emporarily Abandon	. –		
Change Plans			Plug and Abandon Tempo Plug Back D Water				· .	
<ul> <li>following completion of the involved testing has been completed. Final A determined that the site is ready for f</li> <li>1) SET 5-1/2" CIBP @ 7,950';</li> <li>2) PUMP 25 SXS.CMT. @ 6,</li> <li>3) CUT X PULL 5-1/2" CSG.</li> <li>4) PUMP 80 SXS.CMT. @ 3,6</li> <li>5) PUMP 60 SXS.CMT. @ 4,6</li> <li>6) PUMP 50 SXS.CMT. @ 40</li> <li>7) MIX X CIRC. TO SURF. 25</li> </ul>	bandonment Notices shall be f inal inspection.) PUMP 25 SXS.CMT.@ 150'-5,990'(T/B.S.); WOC @ +/-3,502'. <b>Recends</b> 60'-3,452'(T/DLWR.,5-1/ <del>55'</del> -1,500'(11-3/4"CSG. 0'-280'(T/SALT,T/ANHY) SXS.CMT. @ 63'-3'.	iled only after all 7,950'-7,780'; C X TAG CMT. indicente Te 2"CUT,8-5/8"( SHOE,T/YATE .,16"CSG.SHC	requirement CIRC. WI PLUG. SG.SHO SG.SHO S,B/SALT DE); WOC	s, including recl ELL W/ MUD E( <b>?) <i>Es</i>+.</b> E); WOC X T, X TAG.	amation, have been comple free Point on F AG. IF cut/P AG. 1800 (7/Copi	un CBL. Prior un CBL. Prior ull cut @ 3 then Reef)	as	
8) DIG OUT X CUT OFF WEL DURING THIS PROCEDURE								
THE REQUIRED DISPOSAL,		17.		ROCEDURE		CHED FOR		
14. I hereby certify that the foregoing is	true and correct. Electronic Submission For CIMAREX ENE Committed to AFMSS fo						ROVAL	
Name(Printed/Typed) DAVID A EYLER						6/24/14		
Signature (Electronic Submission)			Date 0	Date 05/12/2014				
	THIS SPACE F	OR FEDERA	L OR ST	ATE OFFI	CEUSE			
Approved By fames Q. Como			Title	Title SEAS		<b>6</b> -1 Date	- 14	
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would exite the applicant to conduct operations thereon.			Office d		<u></u>			
Tite 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent	U.S.C. Section 1212, make it statements or representations a	a crime for any pe is to any matter w	rson knowir ithin its juris	gly and willfull diction.	y to make to any departmen	nt or agency of the Uni	ted	

•

¢ ب

\*\* OPERATOR-SUBMITTED \*\* OPERATOR-SUBMITTED \*\* OPERATOR-SUBMITTED \*\*

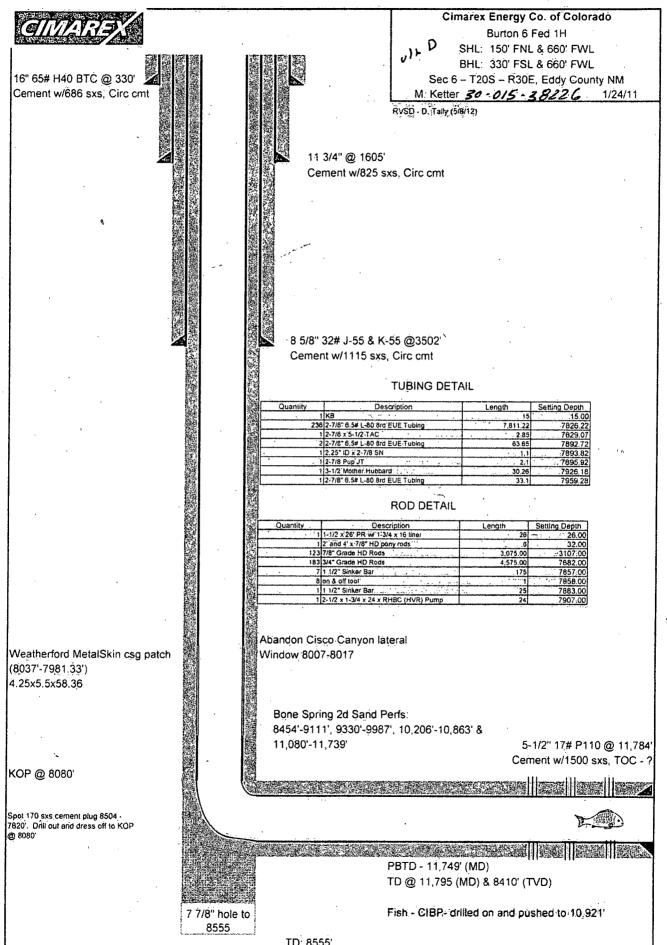

Cimarex Energy Co. of Colorado GIMAREX Burton 6 Fed 1H SHL: 150' FNL & 660' FWL 183/4" hole Ø BHL: 330' FSL & 660' FWL 16" 65# H40'BTC @ 330 Sec 6 - T20S - R30E, Eddy County NM Cement w/686 sxs, Circ cmt M. Ketter 30-015-38226 1/24/11 Rustler CDC. 25 55 MMT. @ 63'-3! 1"Fin 250 350 MUD Pump 50 SKS. CMT. @ 400'-280'- TAC 400 5-15 Xotas 1550 Capiton 176 11 3/4" @ 1605' -Cement w/825 sxs, Circ cmt ~ 14% "hole 105%" hole Pump 60 5×5. CMT. @ 1655-1500 - TAG PXA Del. MUD à stage DUT @ ? 36 10 B/s Pump 80 5×5. CMT. C. 3660'- 3452'- MG 6070 8 5/8" 32# J-55 & K-55 @3502' Cement w/1115 sxs, Circ cmt CUT & PULL S'12" CSG. CP 2502 77/2" hole. DUMP 25 583. CMT. @ 6150'-5990'- MC Pump 25 5×5 cm 7 @ 7950'- 7780' SET 5 1/2" CD3PC 7950! Abandon Cisco Canyon lateral Weatherford MetalSkin csg patch Window 8007-8017 (8037'-7981.33') 4.25x5.5x58.36 Bone Spring 2d Sand Perfs: 8454'-9111', 9330'-9987', 10,206'-10,863' & 11,080'-11,739' 5-1/2" 17# P110 @ 11,784' Cement w/1500 sxs. TOC - 7 Su, F(?) KOP @ 8080' Per SN Spot 170 sxs cement plug 8504 -7820'. Drill out and dress off to KOP @ 8080' PBTD - 11,749' (MD) TD @ 11,795 (MD) & 8410' (TVD) Fish - CIBP- drilled on and pushed to 10,921' 7 7/8" hole to DAZ 05/10/14 8555 TD: 8555

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in a cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.** 

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration conditions of approval will be developed and furnished to you.



# **United States Department of the Interior**

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292

www.blm.gov/nm



In Reply Refer To: 1310

### **Reclamation Objectives and Procedures**

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

#### Jim Amos

Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Solomon Hughes Natural Resource Specialist 575-234-5951

Jeffery Robertson Natural Resource Specialist 575-234-2230

Duncan Whitlock Environmental Protection Specialist 575-234-5926

Jennifer Van Curen Environmental Protection Specialist 575-234-5905

Linda Denniston Environmental Protection Specialist 575-234-5974 Cody Layton Natural Resource Specialist 575-234-5959

Trishia Bad Bear Natural Resource Specialist 575-393-3612

Amanda Lynch · Natural Resource Specialist 575-234-5922

Jessie Rice Natural Resource Specialist 575-234-5913

Indra Dahal Natural Resource Specialist 575-234-5996