
Form 3160-5			000	D Artesia	1	FORM APPROVED	
(April 2004)	UNITED STATES DEPARTMENT OF THE INTERIOR				OM B No. 1004-0137 Expires: March 31, 2007		
	BUREAU OF LAND MAN				5. Lease Seria		
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an					6. If Indian	, Allottee or Tribe Name	
abandoned we	ell. Use Form 3160-3 (4	NPD) for su	ich pro	posals.			
SUBMIT IN TRIPLICATE- Other instructions on reverse side.						7. If Unit or CA/Agreement, Name and/or No.	
1. Type of Well □ □ Gas Well □ □ Other						NM0560353 NM126412X 8. Well Name and No.	
2. Name of Operator CHI OPERATING, INC.					BENSC	ON DELAWARE UNIT #15	
3a Address 3b. Phone No. (include area code)					9. API Well No. 3001538298		
P.O. BOX 1799, MIDLAND TX 79702 432-6						10. Field and Pool, or Exploratory Area	
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					BENSON DELAWARE 11. County or Parish, State		
SEC.1-T19S-R30E 150' FSL 1550' FWL , UNIT N					EDDY		
12. CHECK AI	PPROPRIATE BOX(ES) TO	INDICATE	NATUR	E' OF NOTICE,	REPORT, OR	R OTHER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION						
✓ Notice of Intent	Acidize	Deepen		Production (S	tart/Resume)	Water Shut-Off	
Subsequent Report	Casing Repair	Fracture Ti		Reclamation		Well Integrity Other	
Change Plans Plug and Abandon Temporarily Aba							
	Convert to Injection	Plug Back		Water Disposa	ll		
following completion of the inv testing has been completed. Fi determined that the site is ready	volved operations. If the operation nal Abandonment Notices shall be y for final inspection.)	results in a mult filed only after a	tiple compl all requirer	letion or recompletion ments, including recla	n in a new interva mation, have bee		
• • •		Jnit #15, form	erly the i	Munchkin #15 be o	completed and	converted to an injection well.	
Procedure attached.	,					200	
Procedure attached. PD 8-19-19 ACCEPTED for RECORD NMOCD	STRECTION CD ARTESIA DISTRICT				ACCEF	TED FOR RECORD	
	A	JG 1 9 2	014			AUG 6 2014	
			EIVED		BUREAU OF LAND MANAGEMENT CARLSBAD FIELD OFFICE		
	Work A	Iready	Don	e		UNIL	
 I hereby certify that the fore Name (Printed/Typed) 	going is true and correct	0	1				
PAM CORBETT			Title REGULATORY CLERK				
Signature Pan	almat		Date		12/11/2011		
·	THIS SPACE FOR	FEDERAL	OR S	TATE OFFIC	EUSE		
Approved by			т	itle		Date	
Conditions of approval, if any, are attached. Approval of this notice does not w certify that the applicant holds legal or equitable title to those rights in the subje which would entitle the applicant to conduct operations thereon.			nt or	Office	· · · · · · · · · · · · · · · · · · ·		
	e 43 USC Section 1212 make it a	crime for any as to any matte	person kn r within it:	nowingly and willfull s jurisdiction.	y to make to an	y department or agency of the United	

(Instructions on page 2)

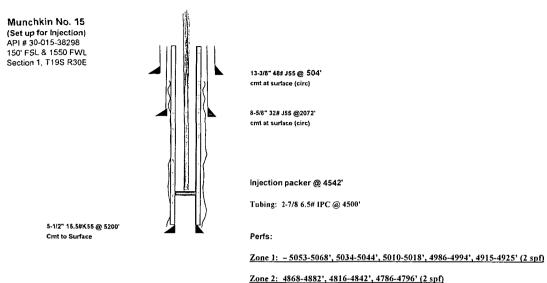

Zone 3: 4634-4664' (2 spf)

Completion Procedure: Zone 1: - 5053-5068', 5034-5044', 5010-5018', 4986-4994', 4915-4925' (2 spf)

MIRU unit, pipe racks & tally tubing. Clean pins & boxes. NUBOP (screw on -2000#.)

TIH w/ 4% " bit on 2 7/8" tbg. Drill/Clean out w/F.W to FC. (if tag within ±100' of FC-OK). Close BOP & pressure test to 1500 psi. Circulate hole with 2% KCL water. TOH, LD bit.

RUWL (bring copy of open hole or get copy of logs from rig) TIH w/GR/CCL/CBL. Pull GR/CCL/CBL from PBTD to 4248'. (Pull repeat w/no psi) apply 1500# & pull to TOC or surface.

TIH w/4" gun w/packoff. Tic in & perforate selected intervals @ 2SPF-60 deg. PU J Lok Pkr. (2 3/8 x 51/2"). SN, XO, & TIH. Set Pkr @ +4850 RU & swb test while monitoring annulus.

RU acidizers. Pump 4000 bbls 7-1/2% NEFE HCL at 4-6 BPM dropping ballsealers for diversion.

Flush to top perf. w/2% KCL. Recover load & tst. Evaluate for further stimulation.

Flowback and swab until fluid level is stable.

Rig up pump truck and perform injectivity test.

If frac is WARRANTED have frac design run using 30,000 gals of Medallion 3000, 48000 ibs 16/30 white, 20000 ibs 16/30 CRS @ 10 bpm via ibg @ ±1800 STP as follows: 10000 gals pad, 2000 gals w/1 ppg, 2000 gals w/2 ppg, 6000 gals w/3 ppg, 6000 w/4 ppg, & 4000 gals w/5 ppg 16/30 CRS sand.

Completion Procedure: Zone 2: 4868-4882', 4816-4842', 4786-4796' (2 spf)

Repeat above procedure

Completion Procedure: Zone 3: 4634-4664' (2 spf)

Repeat above procedure

•