
NM OIL CONS COMMISSION Drawer DD Artesia, NM 88210

une 1990) DEPARTME BUREAU OF  SUNDRY NOTICE Do not use this form for proposals to	STATES ENT OF THE INTERIOR F LAND MANAGEMENT  S AND REPORTS ON WELLS		Budget Bureau No. 1004-0135 Expires: March 31, 1993  5- Lease Designation and Serial No.  MN 28790  6. If Indian, Allottee or Tribe Name
SUBMIT IN TRIPLICATE			7. If Unit or CA, Agreement Designation
I. Type of Well  [X] Oil  [X] Well  [Your Part of Operator]  Ray Westall  3. Address and Telephone No.  Box 4. Loco Hills, NM  4. Location of Well (Footage, Sec., T., R., M., or Survey 1650' FNL & 1650 FEL Sec., T18S-R31E			8. Well Name and No. Phillips Fed #1  9. API Well No. 30-015-2659  10. Field and Pool, or Exploratory Area Shugart  11. County or Parish, State Eddy
2. CHECK APPROPRIATE BO	X(s) TO INDICATE NATURE C	F NOTICE, REPO	RT, OR OTHER DATA
TYPE OF SUBMISSION	TYPE OF ACTION		
Notice of Intent  Subsequent Report  Final Abandonment Notice	Abandonment Recompletion Plugging Back Casing Repair Altering Casing Other		Change of Plans  New Construction  Non-Routine Fracturing  Water Shut-Off  Conversion to Injection  Dispose Water  (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)
i3. Describe Proposed or Completed Operations (Clearly stargive subsurface locations and measured and true were subsurface locations and measured and true were subsurface.  Spot 100' cmt 675-775 (! 10 sxs at surface dry hole marker clean and restore locat:	ertical depths for all markers and zones pertinent 2650' spot 50' cmt or 50 feet in and out or	to this work.)* A top	
		JAN 18 '95	
14. I hereby certify that the faregoing is true and correct/	Tito Good on do d	O. C. D. AKTSSIA, GIFFICE	Date 12/20/94
(This space for Federal or State office use)	Title Geologist		

PHICLIPS FED #1

PRESENT CONDITION

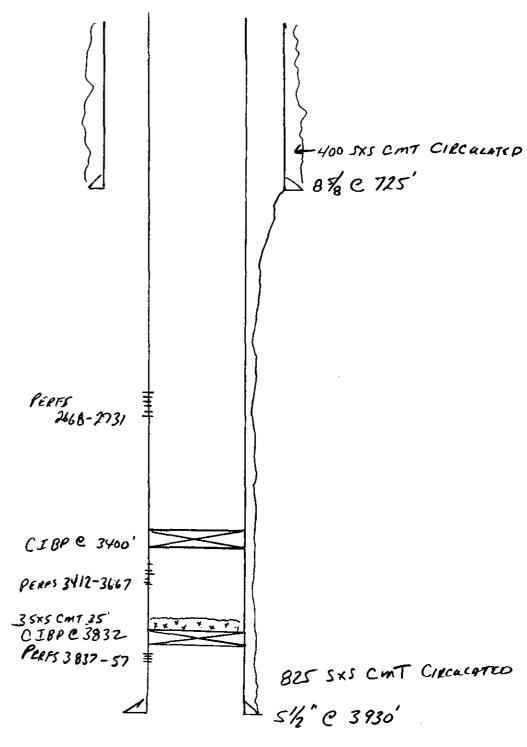

(Rev. 5/23/94)

## BUREAU OF LAND MANAGEMENT CARLSBAD RESOURCE AREA

## Permanent Abandonment of Wells on Federal Lands

## Conditions of Approval

- 1. <u>Approval:</u> Plugging operations shall commence within 90 days from the approval date of plugging procedure.
- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Eddy County call (505)887-6544; for wells in Lea County call (505) 393-3612.
- 3. <u>Blowout Preventers:</u> A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement:</u> Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C", for up to 7,500 feet of depth, mixed at 14.8 lbs./gal. with 6.3 gallons of fresh water per sack or class "H", for deeper than 7,500 feet plugs, mixed at 16.4 lbs./gal. with 4.3 gallons of fresh water per sack.

- 6. <u>Dry Hole Marker:</u> All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. Show date well was plugged.

Following the submittal and approval of the Subsequent Report of Abandonment, surface restoration conditions of approval will be developed and furnished to you.