Form 3160-5 (March 2012)

UNITED STATES

NMO	
Artes	io

FORM APPROVED	
OMB No. 1004-0137	
Expires: October 31, 2014	1

	,	GIAB III. ICC. CIS.	
$1a_{-}$		Expires: October 31, 2014	
5. Lease	Serial N	lo.	
		NM-100542	
6. If Indi	ian, Allo	ottee or Tribe Name	
:		21/2	


	ARTMENT OF THE IN	-	1	nres	<u> 1a1</u>	Expires: October 31, 2014	
. BUR	EAU OF LAND MANA	GEMENT			5. Lease Serial No.	NM-100542	
SUNDRY NOTICES AND REPORTS ON WELLS				6. If Indian, Allottee or Tribe Name			
	orm for proposals to Use Form 3160-3 (AF			S		N/A	
SUBMIT IN TRIPLICATE – Other instructions on page 2. 1. Type of Well					7. If Unit of CA/Agreement, Name and/or No. N/A		
✓ Oil Well Gas W	Vell Other				8. Well Name and No	ACIETE NEGRA #4	
2. Name of Operator JALAPENO	CORPORATION		9. API Well No. 30-005-62245				
3a. Address P.O. BOX 1608 ALBUQUERQUE, NEW MEXIC	b. Phone No. (inc. 505-242-2		le)	10. Field and Pool or Exploratory Area Wolf Lake San Andres			
4. Location of Well (Footage, Sec., T., 1 SEC. 12, T-98	R.,M., or Survey Description) , R-27E, 334' FSL & 938' FEL				11. County or Parish, CHA	State VES COUNTY, NEW MEXICO	
12. CHEC	K THE APPROPRIATE BOX	(ES) TO INDICA	TE NATURE	OF NOTIC	E, REPORT OR OTH	HER DATA	
TYPE OF SUBMISSION			TYP	E OF ACTI	ON		
Notice of Intent	Acidize Alter Casing	Deepen Fracture 7		Production (Start/Res		Water Shut-Off Well Integrity	
Subsequent Report	Casing Repair Change Plans	☐ New Cons ✓ Plug and A		=	nplete orarily Abandon	Other	
Final Abandonment Notice	Convert to Injection	Plug Back			Disposal		
Set a Cement F Pull packer out and go tag top:	is 2322'. We propose to: Plug from PBTD to 50ft above of the hole and then shoot of	off 5 1/2" casing	at 1950' in or	rder to salv		ll then wait on cement to dry urface.	
% Wait for cemen	t to dry .					800 3/18/10	
3. Fill Hole W/ Mud F/2000-2169' 4. Set 35 Sx. Cement Plug F/1900-2000'-Tag 5. Fill Hole W/ Mud F/1700-1900' 6. Set 40 Sx. Cement Plug F/1580-1700'-Tag ARTESIA DISTRICT ARTESIA DISTRICT							
14. I hereby certify that the foregoing is tr	rue and correct. Name (Printed/)	Typed)				MAR 16 2015	
H. Emmons Yates	111	Tit	le Vice Pres	ident			
Signature M.Com	N-	Da	te 03/04/201	15		RECEIVED	
THIS SPACE FOR FEDERAL OR STATE OFFICE USE							
Approved by /S/DAVII	R. GLASS		PETF	ROLEUM	ENGINEER	Date MAR 0 9 2015	
Conditions of approval, if any, are attached that the applicant holds legal or equitable tientitle the applicant to conduct operations to	tle to those rights in the subject			I	Roswell F		
Title 18 U.S.C. Section 1001 and Title 43	U.S.C. Section 1212, make it a c	rime for any person	knowingly and	d willfully to	make to any departme	ent or agency of the United States any fals	

(Amount of (Calumn) state plents of epress (Quid) as of any matter within its jurisdiction. (Instructions on page 2) JUN 0 9 2015

SEE ATTACHED FOR CONDITIONS OF APPROVAL

SCHEMATIC PRIOR TO PLUG AND ABANDON JALAPENO CORPORATION **ACIETE NEGRA #4 CHAVES COUNTY, NEW MEXICO** API NO. 30-005-62245.

2219-2297 (62 shots)

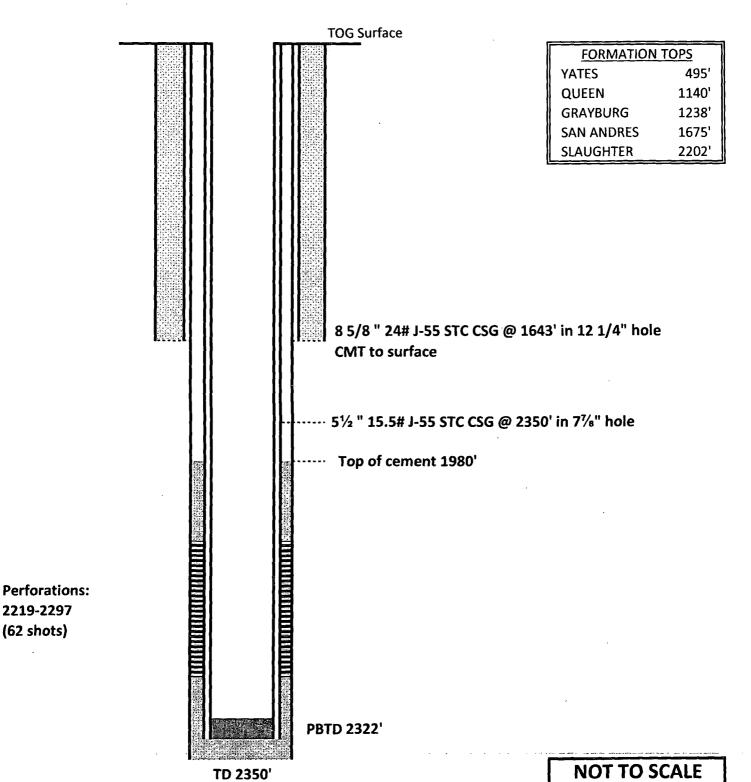


SCHEMATIC AFTER PLUG AND ABANDON

JALAPENO CORPORATION
ACIETE NEGRA #4
CHAVES COUNTY, NEW MEXICO
API NO. 30-005-62245

TD 2350'

Perforations: 2219'-2297' (62 shots)

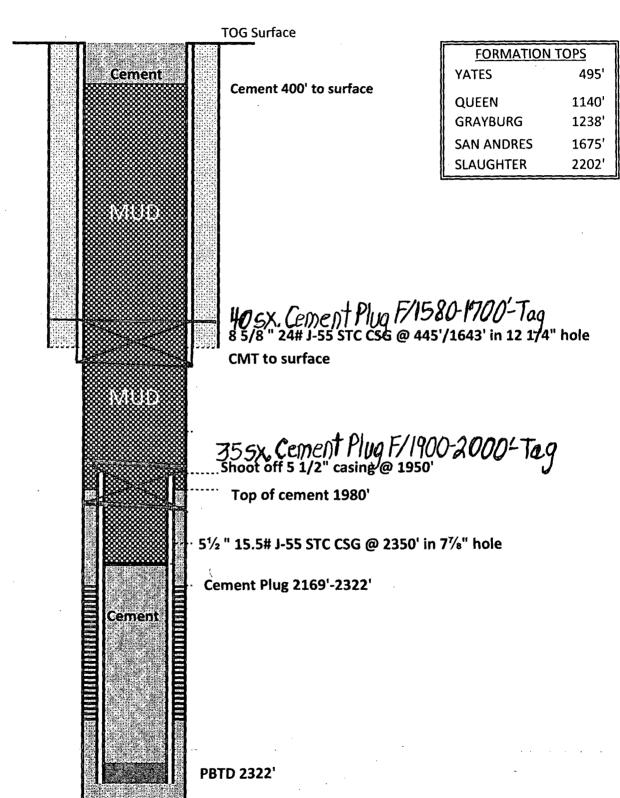

NOT TO SCALE

BUREAU OF LAND MANAGEMENT Roswell Field Office 2909 West Second Street Roswell, New Mexico 88201 (575) 627-0272

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

- 1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon. If you are unable to plug the well by the 90th day provide the BLM Roswell Field Office (RFO), prior to the 90th day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action. Unless the well has been properly plugged, the rig shall not be removed from over the hole without prior approval.
- 2. <u>Notification</u>: Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours or after office hours call (575) 627-0205. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.
- 3. <u>Blowout Preventers:</u> A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement:</u> Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

- 6. <u>Dry Hole Marker:</u> All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10 feet in length, 4 feet above the ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.