

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. French St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

NM OIL CONSERVATION

ARTESIA DISTRICT

Form C-141
Revised August 8, 2011

MAR 20 2015

Submit Copy to appropriate District Office in accordance with 19.15.29 NMAC.

RECEIVED

Release Notification and Corrective Action

NAB 1507942715

OPERATOR

☒ Initial Report ☐ Final Report

Name of Company	Devon Energy Production	Contact	Rudy Zuniga, Production Foreman
Address	6488 Seven Rivers Hwy Artesia, NM 88220	Telephone No.	575-390-5435
Facility Name	Onyx PWU 29 2H	Facility Type	Oil

Surface Owner State	Mineral Owner State	API No.	30-015-39373
---------------------	---------------------	---------	--------------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
E	29	19S	29E	2310	N	330	W	Eddy

Latitude: 32.6327760

Longitude: 104.1045141

NATURE OF RELEASE

Type of Release Spill	Oil	Volume of Release	1bbl	Volume Recovered	0bbl
Source of Release	Flare	Date and Hour of Occurrence	March 18, 2015 8:10 AM	Date and Hour of Discovery	March 18, 2015 8:10 AM
Was Immediate Notice Given?	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom?	Mike Bratcher, OCD Jeff Robertson, BLM		
By Whom?	Ray Carter, Asst. Production Foreman	Date and Hour	OCD March 18, 2015 9:30 AM BLM March 18, 2015 9:45 AM		
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse	N/A		

If a Watercourse was Impacted, Describe Fully.* N/A

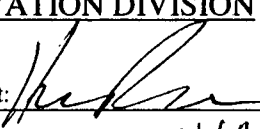
Describe Cause of Problem and Remedial Action Taken.*

The low pressure separator had some trash and rubber stuck in the dump which caused the separator to flood and send fluid into both the gas line and the supply gas for the high pressure separator, once the dump for the high pressure separator was overloaded it sent 1bbl of oil in a mist out the flare line onto location and pasture. The separators were immediately drained and the gas lines were cleared.

Describe Area Affected and Cleanup Action Taken.*

The area affected is 30x30 on the pad and into the pasture on the Southwest corner approximately 15 feet. The location will be back dragged and the pasture will be pressure washed with Dawn soap.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: Sheila Fisher	OIL CONSERVATION DIVISION		
Printed Name: Sheila Fisher	Approved by Environmental Specialist: 		
Title: Field Admin Support	Approval Date: 3/20/15	Expiration Date: N/A	
E-mail Address: Sheila.Fisher@dmv.com	Conditions of Approval:		Attached <input type="checkbox"/>
Date: 3/19/15	Phone: 575.748.1829		

Remediation per O.C.D. Rules & Guidelines
SUBMIT REMEDIATION PROPOSAL NO

LATER THAN: 4/20/15

2RP-2901

* Attach Additional Sheets If Necessary