Submit 1 Copy To Appropriate District Office	State of New Mexico		Form C-103	
<u>District 1</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240	Energy, Minerals a	nd Natural Resources	Revised July 18, 2013 WELL API NO.	
<u>District II</u> – (575) 748-1283	OIL CONSEDY	ATION DIVISION	30-015-32320	
811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178		St. Francis Dr.	5. Indicate Type of Lease	
1000 Rio Brazos Rd., Aztec, NM 87410		NM 87505	STATE X FEE	
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Santa I C,	14141 07303	6. State Oil & Gas Lease No.	
SUNDRY NOTION (DO NOT USE THIS FORM FOR PROPOSE DIFFERENT RESERVOIR. USE "APPLICATION OF THE PROPOSE OF THE PRO	CES AND REPORTS ON SALS TO DRILL OR TO DEEPI 'ATION FOR PERMIT" (FORM	EN OR PLANGED COCIDA	7. Lease Name or Unit Agreement Name CLYDE	
PROPOSALS.)	•		8. Well Number	
<ol> <li>Type of Well: Oil Well X</li> <li>Name of Operator</li> </ol>	Gas Well Other	APR 1 3 2015	9. OGRID Number 4323	
CHEVRON U.S.A. INC.			9. OGRID Number 4323	
3. Address of Operator 15 SMITH ROAD MIDLAND, TE	XAS 79705	RECEIVED	10. Pool name or Wildcat UNDES; DELAWARE	
4. Well Location DATUM 27	Y- LAT X	-LONG.		
Unit LetterP_:	660feet from the	_SOUTH line and		
Section · 22	Township 23S	Range 26-E	NMPM County EDDY	
	11. Elevation (Show whe 3,286' GL	ether DR, RKB, RT, GR,	etc.)	
	3,200 GL			
12. Check A	appropriate Box to Ind	icate Nature of Notic	ce, Report or Other Data	
NOTICE OF IN	TENTION TO:	SI	JBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK	PLUG AND ABANDON			
TEMPORARILY ABANDON	CHANGE PLANS		DRILLING OPNS.☐ P AND A ☐	
PULL OR ALTER CASING DOWNHOLE COMMINGLE	MULTIPLE COMPL	CASING/CEM	ENI JOB	
CLOSED-LOOP SYSTEM				
OTHER:		OTHER:		
			, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of	
			8' TOC SURF, 7"- 9,587" TOC 4,000' EST.	
* * *	•		,001' PB & TA – 4,620' W/35' CEMENT.	
			4,580° CIR W/ 9.5# SALT GEL. PU TO 4,050°,	
			& TAG. PU TO 2,800', MIX & SPOT 30 SX CL	
TBG. NIPPLE DOWN CUT & CAP			MENT FROM 675' TO SURFACE . POOH W/	
. CLOSED LOOP SYSTEM TO BE	USED.	10.13.7.11 11.W	ie ie gomani.	
PLA MUST Be done by	4/27/2016 Approved	for plugging of well bore only.		
DIA MIOSI BE COIN A	Liability of Calobi	made board to see to the		
•	which may	be found at OCD was p		
	Forms, ww	w.cmnrd.state.nm.us/ocd.		
			APR <b>2 2</b> 2015	
Spud Date:	Rig Re	elease Date:	RECEIVED	
			**CTIVED	
I hough, coutify that the information of	here is two and samulate	to the heat of my Imavel	oden and halles	
I hereby certify that the information	bove is true and complete	to the best of my knowle	eage and benef.	
OVER THE STATE OF	TIME!			
SIGNATURE	TITLS	Agent Chevron U.S.A	ADATE04 / 07 / 15	
	Carver E-mail address:	_ monty.mccarver@cjes	s.com PHONE: _713-325-6288	
For State Use Only		1 THE ~	1/2/	
APPROVED BY:	CV TITLE	WITTLIFE	WISO DATE 4/27/2015	
Conditions of Approval (if any):	bove)	1		

## **Current Wellbore Schematic**

WELL (PN): CLYDE 1(CVX) (890615) FIELD OFFICE: HOBBS FIELD: CARLSBAD SOUTH


STATE / COUNTY: **NEW MEXICO / EDDY** LOCATION: SEC 22-23S-26E, 660 FSL & 990 FEL ROUTE: HOB-NM-ROUTE 18- FERLIN/DAVID ELEVATION: GL: 3,286.0 KB: 3,306.0 KB

KB Height: 20.0

**DEPTHS:** TD: 12,001.0

API#: 3001532320 Serial #: SPUD DATE: 7/4/2002 **RIG RELEASE: 9/1/2002** 1ST SALES GAS: 1/1/2003 **1ST SALES OIL:** 

**Current Status: T/A** 

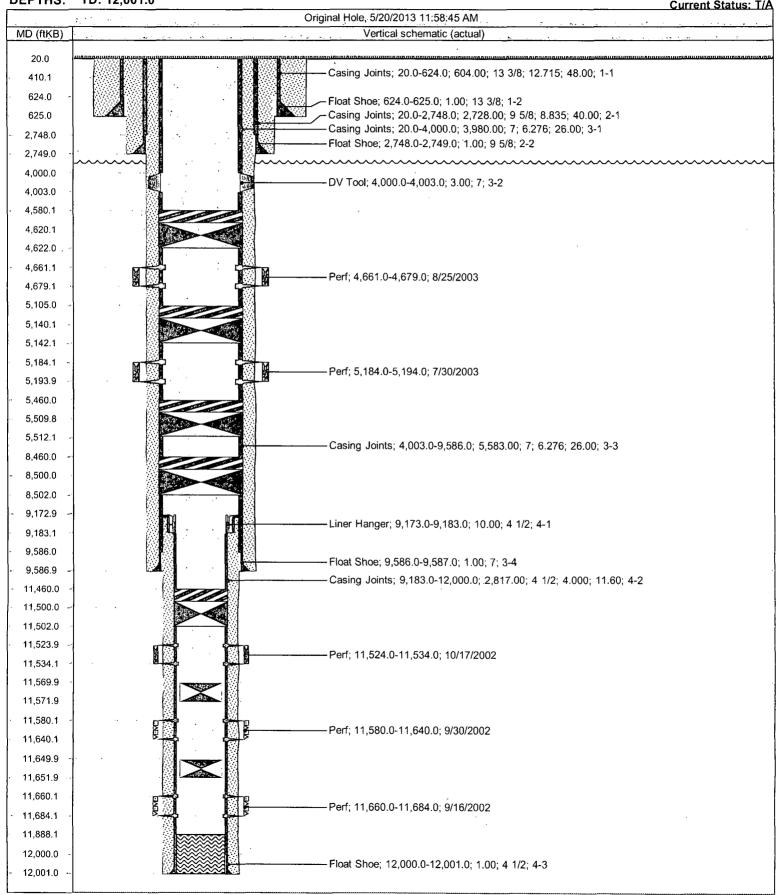

PURPOSE Wellbore Schematic
WELL (PN): CLYDE 1(CVX) (890615)
FIELD OFFICE: HOBBS
FIELD: CARLSBAD SOUTH
STATE / COUNTY: NEW MEXICO / EDDY
LOCATION: SEC 22-23S-26E, 660 FSL & 990 FEL
ROUTE: HOB-NM-ROUTE 18- FERLIN/DAVID
ELEVATION: GL: 3,286.0 KB: 3,306.0 KB Height: 20.0
DEPTHS: TD: 12,001.0

API#: 3001532320 Serial #:
SPUD DATE: 7/4/2002
RIG RELEASE: 9/1/2002
1ST SALES GAS: 1/1/2003
1ST SALES OIL:

EPTHS: TO	D: 12,001.0	Current Status: T	
AD (ftKP)	Original Hole, 5/20/2013 11:58:45 AM		
MD (ftKB)	Vertical schematic (actual)		
20.0	рациональности по при	<u>ក្រសួលក្រោះអាមាលមល់បាកអាការក្</u> យាយក្រសួលក្រុកបានបង្	
410.1	Casing Joints; 20.0-624.0; 604.00; 13 3/8; 12.715; 48.00; 1-1		
624.0	1255X FROM 675 - SURFACE Float Shoe; 624.0-625.0; 1.00; 13 3/8; 1-2		
625.0	Casing Joints; 20.0-2,748.0; 2,728.00; 9 5/8; 8.835; 40.00; 2-1		
2,748.0	Casing Joints; 20.0-4,000.0; 3,980.00; 7; 6.276; 26.00; 3-1		
2,749.0	Float Shoe; 2,748.0-2,749.0; 1.00; 9 5/8; 2-2		
4,000.0			
4,003.0	305X FROM 4,050-3,900 TAG		
4,580.1	3,000		
4,620.1			
4,622.0			
4,661.1	Perf; 4,661.0-4,679.0; 8/25/2003		
4,679.1	<b>日本</b>		
5,105.0			
5,140.1			
5,142.1			
5,184.1	Perf; 5,184.0-5,194.0; 7/30/2003	•	
5,193.9	101, 0, 104.0 0, 104.0, 1100/2000		
5,460.0			
5,509.8			
5,512.1	Casing Joints; 4,003.0-9,586.0; 5,583.00; 7; 6.276; 26.00; 3-3		
8,460.0			
8,500.0			
8,502.0			
9,172.9	Liner Hanger; 9,173.0-9,183.0; 10.00; 4 1/2; 4-1		
9,183.1			
9,586.0	Float Shoe; 9,586.0-9,587.0; 1.00; 7; 3-4		
9,586.9	Casing Joints; 9,183.0-12,000.0; 2,817.00; 4 1/2; 4.000; 11.60; 4	l-2	
11,460.0			
11,500.0			
11,502.0			
11,523.9	Perf; 11,524.0-11,534.0; 10/17/2002		
11,534.1			
11,569.9			
11,571.9			
11,580.1	Perf; 11,580.0-11,640.0; 9/30/2002		
11,640.1			
11,649.9			
11,651.9			
11,660.1	Perf; 11,660.0-11,684.0; 9/16/2002		
11,684.1			
11,888.1			
12,000.0	Float Shoe; 12,000.0-12,001.0; 1.00; 4 1/2; 4-3		
12,001.0	ENGLANCE OF THE PROPERTY OF TH		

# NEW MEXICO OIL CONSERVATION DIVISION DISTRICT 2 OFFICE 811 S. FIRST STREET ARTESIA, NM 88210 (575)748-1283

## CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT

Operator: Cherkon	
Well Name & Number: Clyd Off (	
API #: 30-015-32320	

- 1. Produced water <u>will not</u> be used during any part of the plugging & abandonment operation.
- 2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
- 3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
- 4. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
- 5. A subsequent C-103 will serve as notification that the well bore has been plugged ONLY. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
- **6.** If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
- 7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.
- 8. Cement Retainers may not be used.
- 9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
- 10. Plugs may be combined after consulting with and getting approval from NMOCD.
- 11. Minimum WOC time for tag plugs will be 4 Hrs.

DATE: 4/27/15

APPROVED BY: 7

### GUIDELINES FOR PLUGGING AND ABANDONMENT

#### DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement,
   whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50' below and 50' above all casing shoes and casing stub plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
  - o Fusselman
  - o Devonian
  - o Morrow
  - o Wolfcamp
  - o Bone Spring
  - o Delaware
  - Any Salt Section (Plug at top and bottom)
  - o Abo
  - o Glorieta
  - Yates (this plus is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing
  must be cut and pulled with plugs set at these depths or casing must be perforated and cement
  squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).