Submit I Copy To Appropriate District	State of New Mexi	со		Form C-103
District I (575) 393-6161	Energy, Minerals and Natura	Resources		Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240			WELL API NO.	
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSERVATION D	IVISION	30-0(5-33030 5. Indicate Type of Lease	
<u>District III</u> - (505) 334-6178	1220 South St. Franci	STATE	FEE	
1000 Rio Brazos Rd., Aztec, NM 87410 District <u>1V</u> – (505) 476-3460	Santa Fe, NM 875	05	6. State Oil & Gas Lease No.	
1220 S. St. Francis Dr., Santa Fe, NM			V-992	
87505	ES AND REPORTS ON WELLS	· · · · · · · · · · · · · · · · · · ·	7. Lease Name or Unit	Agreement Name
(DO NOT USE THIS FORM FOR PROPOSAI		ВАСК ТО А		-
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH			Indian Basin .	32 State
PROPOSALS.) 1. Type of Well: Oil Well G Gas Well Other			8. Well Number —	7
2. Name of Operator	9. OGRID Number			
OXY USA W			2463	
3. Address of Operator	10. Pool name or Wilde	at		
P.O. Box 5025		wildcat Y	eso	
4. Well Location			- *	
Unit Letter A : 9	68 feet from the Nonth	line and	LB feet_from_the_	east line
Section 32	Township 215 Rang	e 24E	NMPM Cou	hty Eddy
	1. Elevation (Show whether DR, R	KB, RT, GR, etc.)		
	· 4213'	•• ·		
,				,
12. Check App	propriate Box to Indicate Natu	ire of Notice, I	Report or Other Data	
	· · ·		•	
NOTICE OF INTE			SEQUENT REPOR	
		EMEDIAL WORK		
	1	OMMENCE DRIL		DA LI
		ASING/CEMENT	JOB []	
OTHER:	ПС	THER:		
	ed operations. (Clearly state all pert		give pertinent dates, inclu	uding estimated date
of starting any proposed work)	. SEE RULE 19.15.7.14 NMAC. 1	For Multiple Com	pletions: Attach wellbor	e diagram of
proposed completion or recomp	pletion.			-
TD-8780'	'M 8630'V PBTD-3869' Perfs-29	00-3202' CIBP	-3909'	
0.5/0% 2				
	5-40# csg @ 1811' w/ 1950sx, 12-1/			
/ 23-20	# csg @ 8780', DVT @ 6897' w/ 135	ousx, 8-3/4" hole,	IOC-Surf-Circ	L CONSERVATION
1. RIH &	set CIBP @ 2850', M&P 25sx cmt to	2750'	NM OI	RTESIA DISTRICT
2. M&P			0.00	
	25sx cmt @ 1270-1170' WOC-Tag			AUG 3 20.3
4. M&P :	25sx cmt @ 535-435' WOC-Tag	Approved for oly a	ring of well bore only.	
	45sx cmt @ 200'-Surface	1	id is retained pending receipt	RECEIVED
	ILF between plugs		ent Report of Well Plugging)	
Above gr	ound steel tanks will be utilized	Forms, www.cmnrd	d at OCD Web Page under .state.nm.us/ocd.	
Spud Date:	Rig Release Date:			
		L		
well Bore must be	plugged by 8.	12-2016		
I hereby certify that the information abo			and belief.	
2				
	$ \leftarrow $, (
SIGNATURE 6'Sty	TITLE Sr. Re	gulatory Advisor	DATE	3/15
Type or print name — David Stawart	E moit oddaaau	david at summer @	DUONE (
Type or print name <u>David Stewart</u>	E-mail address:	david_stewart@c	oxy.com PHONE: 4	32-685-5/17
For State Use Only	_			
A/112	A	75	$\sim \Delta$	
APPROVED BY: OY CLOCK	TITLE DIST	yeurs	DATE Ø	-12-15
		1		
A Seo A	Hached COAi			

OXY USA WTP LP - Proposed Indian Basin 32 State #7 API No. 30-015-33030

45sx @ 200'-Surface

25sx @ 535-435' WOC_Tag

25sx @ 1270-1170' WOC-Tag

25sx @ 1861-1761' WOC-Tag


" CIBP @ 2850' w/ 25sx to 2750'

7/10-CIBP @ 3909' w/ 35' cmt to 3869' Tagged

7/10-CIBP @ 4470' w/ 35' cmt to 4435' Tagged

7/10-CIBP @ 7354' w/ 35' cmt to 7320' Tagged

7/10-CIBP @ 7809' w/ 35' cmt to 7776' Tagged

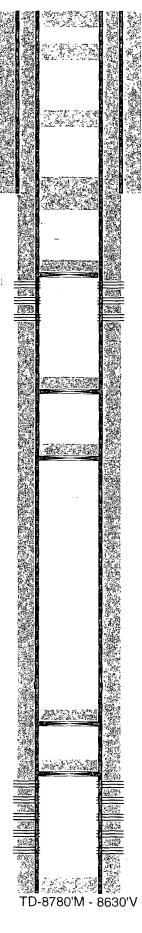

12-1/4" hole @ 1811' 9-5/8" csg @ 1811' w/ 1950sx-TOC-Surf-1"-Circ




Perfs @ 2900-3202'

Perfs @ 7859-8476'

8-3/4" hole @ 8780' 7" csg @ 8780' DVT @ 6897' w/ 1350sx-TOC-Surf-Circ

PB-8683'M 8534'V

OXY USA WTP LP - Current Indian Basin 32 State #7 API No. 30-015-33030

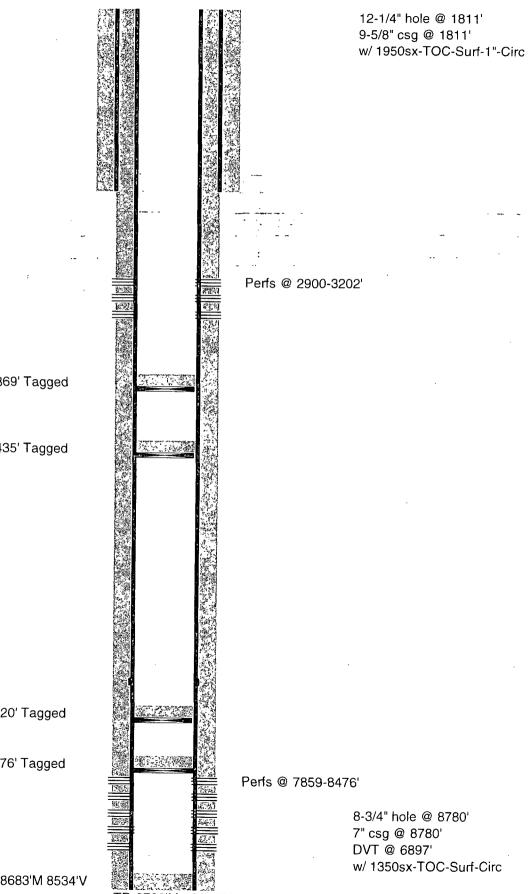

7/10-CIBP @ 3909' w/ 35' cmt to 3869' Tagged

7/10-CIBP @ 4470' w/ 35' cmt to 4435' Tagged

7/10-CIBP @ 7354' w/ 35' cmt to 7320' Tagged

7/10-CIBP @ 7809' w/ 35' cmt to 7776' Tagged

PB-8683'M 8534'V

TD-8780'M - 8630'V

NEW MEXICO OIL CONSERVATION DIVISION DISTRICT 2 OFFICE 811 S. FIRST STREET ARTESIA, NM 88210 (575)748-1283

CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT

Operator:_	Ory				
Well Name	& Number:	Indian Dasin	32	State	7
API #:	30	- 015 - 33030			

- 1. Produced water <u>will not</u> be used during any part of the plugging & abandonment operation.
- 2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
- 3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
- 4. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall-have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
- 5. A subsequent C-103 will serve as notification that the well bore has been plugged ONLY. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
- 6. If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
- 7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.
- 8. Cement Retainers may not be used.
- 9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
- 10. Plugs may be combined after consulting with and getting approval from NMOCD.
- 11. Minimum WOC time for tag plugs will be 4 Hrs.

8/12/15

GUIDELINES FOR PLUGGING AND ABANDONMENT

DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50' below and 50' above all casing shoes and casing stub plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
 - o Fusselman
 - o Devonian
 - o Morrow
 - o Wolfcamp
 - o Bone Spring
 - o Delaware
 - Any Salt Section (Plug at top and bottom)
 - o Abo
 - o Glorieta
 - Yates (this plus is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing
 must be cut and pulled with plugs set at these depths or casing must be perforated and cement
 squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section.
 Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).