

Submit'l Copy To Appropriate District		State of New Mexico		Form C-103	
<u>District I</u> - (575) 393-6161	Energy, Minerals and Nati	ural Resources	Revised July 18, 2013 WELL API NO.		
1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283			30-015-3303	\circ	
811 S. First St., Artesia, NM 88210	OIL CONSERVATION	N DIVISION	5. Indicate Type of Le		
District III - (505) 334-6178	1220 South St. Fra	ncis Dr.	STATE	FEE	
1000 Rio Brazos Rd., Aztec, NM 87410	Santa Fe, NM 8	7505	6. State Oil & Gas Les		
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	54444 2 0, 1 10 0				
87505		· · · · · · · · · · · · · · · · · · ·	V-992		
	CES AND REPORTS ON WELLS		7. Lease Name or Uni	t Agreement Name	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH		Indian Basin	32 State		
	PROPOSALS.) 1. Type of Well: Oil Well G Gas Well Other		8. Well Number	7	
2. Name of Operator		9. OGRID Number	024(2		
OXY USA WTP Limited Partnership		10. Pool name or Wild	92463		
3. Address of Operator P.O. Box 50250 Midland, TX 79710		W: Lacat			
4. Well Location			00; (ccu (
A	968 feet from the NON-				
Section 32		ange Z4E		unty Eddy	
	11. Elevation (Show whether DR		.)		
	42(3'			
12. Check A	Appropriate Box to Indicate N	Nature of Notice	, Report or Other Dat	a	
NOTICE OF IN	TENTION TO:	SUE	SEQUENT REPOR	RT OF:	
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WOR			
	CHANGE PLANS	COMMENCE DF			
PULL OR ALTER CASING		CASING/CEMEN			
CLOSED-LOOP SYSTEM					
OTHER:		OTHER:			
of starting any proposed wo proposed completion or rec		C. For Multiple Co			
0.5/9	″ 36-40# csg @ 1811' w/ 1950sx, 1	2 1 / 4" hala TOC 6			
	-26# csg @ 8780', DVT @ 6897' w/				
1 01	1 9 ant CIDD @ 2050' MARD 25 ave				
	H & set CIBP @ 2850', M&P 25sx ci				
	&P 25sx cmt @ 1861-1761' WOC-T	•		OIL CONSERVATION	
	&P 25sx cmt @ 1270-1170' WOC-T	Approved for plug	ging of well bore only.	ARTESIA DISTRICT	
	&P 25sx cmt @ 535-435' WOC-Tag	 Liability under boy 	nd is retained pending receipt		
	&P 45sx cmt @ 200'-Surface	which may be four	ent Report of Well Plugging) id at OCD Web Page under	JUN 11 2015	
	# MLF between plugs e ground steel tanks will be utilized	i li sa ma a su	state.nm.us/ocd.		
Above	e ground steer tanks will be utilized	J		RECEIVED	
Spud Date:	Rig Release D	ate:			
·		_ L			
well Boll must	Be plysed By	1-30,20	K		
I hereby certify that the information	above is true and complete to the				
	•	,			
SIGNATURE In Sa	TITLE SI	r. Regulatory Advis	orDATE	0/3/15	
Type or print name <u>David Stewa</u>	rt E-mail address:	<u>david_stewart</u>	@oxy.comPHONE:	432-685-5717	
For State Use Only	Α	C		· .	
	$n \wedge h$	-R. Jon		7/2 los	
APPROVED BY:	TITLE D'	U Up	DATE_	$r_{1}\omega_{1}\omega_{2}$	
Conditions of Approval (if any):	and not?	v		, ,	
x Jee Attack	yeu with s				

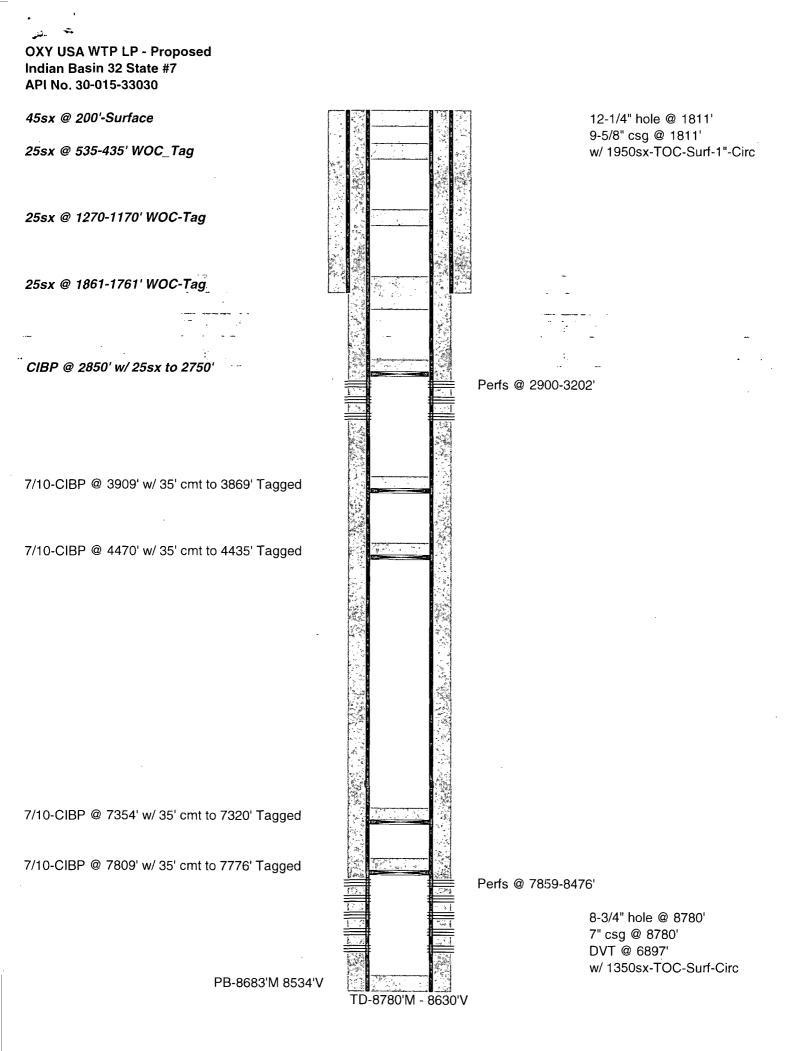

OXY USA WTP LP - Current Indian Basin 32 State #7 API No. 30-015-33030

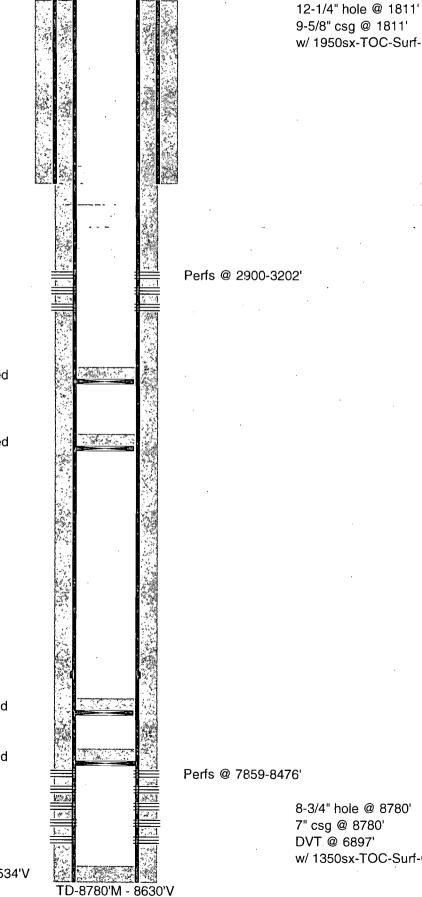

7/10-CIBP @ 3909' w/ 35' cmt to 3869' Tagged

7/10-CIBP @ 4470' w/ 35' cmt to 4435' Tagged

7/10-CIBP @ 7354' w/ 35' cmt to 7320' Tagged

7/10-CIBP @ 7809' w/ 35' cmt to 7776' Tagged

PB-8683'M 8534'V

w/ 1950sx-TOC-Surf-1"-Circ

8-3/4" hole @ 8780' w/ 1350sx-TOC-Surf-Circ

NEW MEXICO OIL CONSERVATION DIVISION DISTRICT 2 OFFICE 811 S. FIRST STREET ARTESIA, NM 88210 (575)748-1283

CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT

Operator:	Oxy	
Well Name	Number: Andrean Presin 32 State 7	
API #:	30 - 015 - 33030	

- 1. Produced water <u>will not</u> be used during any part of the plugging & abandonment operation.
- 2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
- 3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
- 4. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
- 5. A subsequent C-103 will serve as notification that the well bore has been plugged ONLY. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
- 6. If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
- 7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.
- 8. Cement Retainers may not be used.
- 9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
- 10. Plugs may be combined after consulting with and getting approval from NMOCD.
- 11. Minimum WOC time for tag plugs will be 4 Hrs.

7/30/2015

GUIDELINES FOR PLUGGING AND ABANDONMENT

DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50' below and 50' above all casing shoes and casing stub plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
 - o Fusselman i
 - o Devonian
 - o Morrow
 - o Wolfcamp
 - o Bone Spring
 - o Delaware
 - Any Salt Section (Plug at top and bottom)
 - o Abo
 - o Glorieta
 - Yates (this plus is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing must be cut and pulled with plugs set at these depths or casing must be perforated and cement squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section.
 Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).