

25216
OPERATOR: Ray Westall

API# 30-015-22333

WELL: Myrtle Myra # 3


LOCATION: K-9-21-27

SURFACE CSG- HOLE SIZE " CSG. SIZE 13 3/8" SET @ 455' SX. CMT. 500 TOC. Circ

INT.CSG- HOLE SIZE CSG. SIZE 8 5/8" SET @ 2500' SX. CMT. 2000 TOC. Circ.

LONG STRING- HOLE SIZE 7 7/8" CSG. SIZE 5.5" SET @ 5350' SX. CMT. 1500' TOC. 2642'

OTHER-

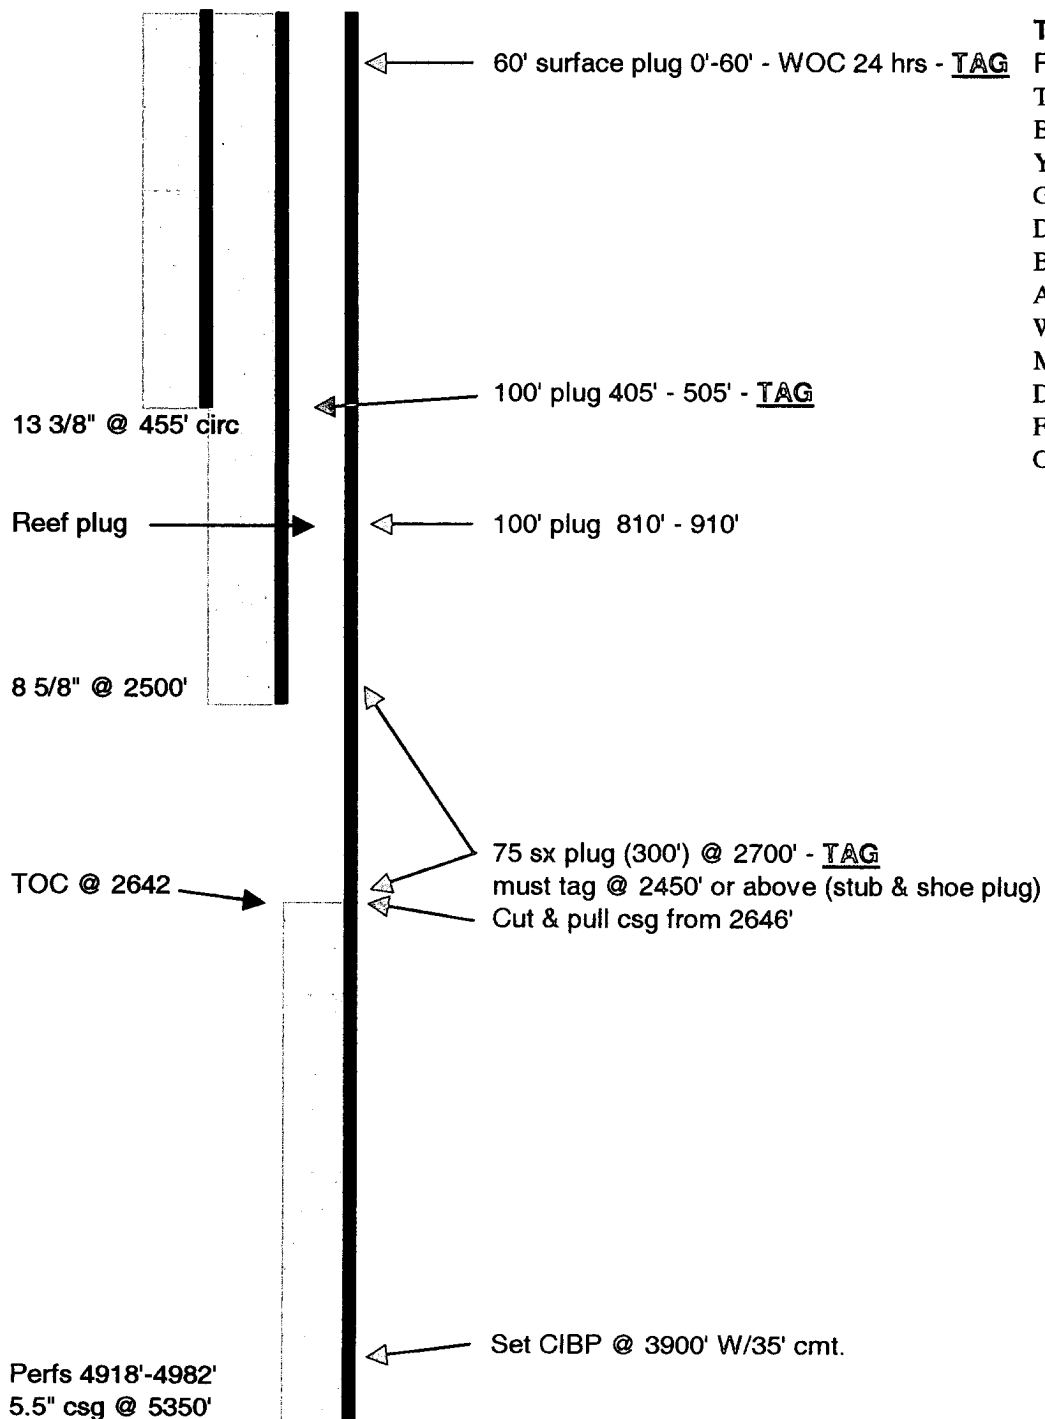

TOPS

Fresh Wtr. _____

T. Salt-----'

B. Salt-----'

Yates-----555'

Glorieta -----

Delaware-----'

Bone Sp.-----'

Abo -----

Wolfcamp -----

Morrow-----'

Devonian-----

Fusselman-----

Other-----

Submit 3 Copies To Appropriate Districts

Office

District I

1625 N. French Drive., Hobbs, NM 88240

District II

1301 W. Grand, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

2040 South Pacheco, Santa Fe, NM 87505

State Of New Mexico
Energy, Minerals, and Natural ResourcesOIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		Well API No. 30-015-25126
1. Type Of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type Of Lease State ☒ Fee ☐
Name Of Operator Ray Westall Operating		6. State Oil and Gas Lease No. L1848
Address Of Operator P.O. Box 4 - Loco Hills, New Mexico 88255		7. Lease Name Or Unit Agreement Name: Myrtle Myra
Well Location Unit Letter K : 1980 Feet From The South Line And 1980 Feet From The West Line Section 09 Township 21S Range 27E NMPM County Eddy		8. Well No. 003
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3188 GR		9. Pool Name Or Wildcat LaHuerta Delaware
11. Check The Appropriate Box To Indicate Nature Of Notice, Report Or Other Data		
NOTICE OF INTENTION TO: Remedial Work ☐ Plug And Abandon ☒ Temporarily Abandon ☐ Change Plans ☐ Pull Or Alter Casing ☐ Multiple Completion ☐ Other ☐		SUBSEQUENT REPORT OF: Remedial Work ☐ Alter Casing ☐ Commence Drilling OPNS. ☐ Plug and Abandonment ☐ Casing Test and Cement Job ☐ Other: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Set CIBP @ 4900', cap with 35' cement. Pull 5 1/2" casing from 2646'. Set 75 sxs (300') @ 2700'. - Tag must tag @ Est. top 2400'. 5 1/2" cut off - 100' above 8 5/8" casing shoe. Set 12 sxs (100') 910' - 810' across 2450' or Above captain reef. Set 12 sxs (100') 505' - 405' - 50' in and out 13 3/8" casing shoe. Set 10 sxs surface plug. - WOC 24 HRS - TAG =

TAG

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Signature Rene MatthewsTitle Production SecretaryDate 07/10/03Type Or Print Name: Rene Matthews

(THIS SPACE FOR STATE USE)

Telephone No. (505) 677-2370

APPROVED BY

Conditions Of Approval If Any:

Field Rep

Date 10 July 2003

YATES 555' — 455' 13 3/8" 650 SXS CIRC
CAPITAN REEF 860' —

DELANARE 2606 — 2500' 8 5/8" 700 SXS CIRC
2646' CSNG PATCH
2642 TOP CMT

4918-4782 DELANARE AERAS
5025 CIBP + 35' CMT
5350 5 1/2 500 SXS

CURRENT CONDITIONS

RAY WESTALL

MYATLE MYRA #3

30-015-25126

SEC 9 T 21S - R 27E