Form 3160-5 (August 2007)

FORM APPROVED

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

RY NOTICES AND REPORTS ON WELLS SEP 1 3 2016

5. Lease Serial No. NMNM0454018

ONDIN	O. 10	JU4-	0122
Expires:	July	31,	2010
Comint No.			

SUNDRY NOTICES AND REPORTS ON WELLS JET	
Do not use this form for proposals to drill or to re-enter an	
abandoned well. Use form 3160-3 (APD) for such proposals.	

abandoned well. Use form 3160-3 (APD) for such proposals.				6. If Indian, Allottee of	r Tribe Name		
SUBMIT IN TRI	PLICATE - Other instructi	ions on rev	erse side.		7. If Unit or CA/Agree	ement, Name and/or No.	
Type of Well ☐ Oil Well ☐ Gas Well ☑ Other: : INJECTION				8. Well Name and No. WERSELL FEDERAL 2			
Name of Operator Contact: DAVID A EYLER CIMAREX ENERGY COMPANY OF CO-Mail: DEYLER@MILAGRO-RES.COM					9. API Well No. 30-015-24845-00-S1		
3a. Address 202 S CHEYENNE AVE SUITE 1000 TULSA, OK 74103.4346 3b. Phone No. (include area code) Ph: 432-687-3033					10. Field and Pool, or Exploratory ESPERANZA		
4. Location of Well (Footage, Sec., T.	, R., M., or Survey Description)		······································		11. County or Parish,	and State	
Sec 4 T22S R27E NWNW 660FNL 660FWL					EDDY COUNTY	⁄, NM	
12. CHECK APPI	ROPRIATE BOX(ES) TO	INDICATE	NATURE OF N	NOTICE, RE	PORT, OR OTHE	R DATA	
TYPE OF SUBMISSION		TYPE OF ACTION					
Notice of Intent	☐ Acidize	□ Deep		,	on (Start/Resume)	□ Water Shut-Off	
☐ Subsequent Report	☐ Alter Casing	. –	ture Treat	☐ Reclama		☐ Well Integrity	
☐ Final Abandonment Notice	☐ Casing Repair☐ Change Plans	-	Construction and Abandon		arily Abandon	Other	
_ 1 mai / toulidomnont / totice	Convert to Injection	☐ Plug		☐ Water D			
testing has been completed. Final Abdetermined that the site is ready for fit. 1) SET 5-1/2" CIBP @ 2,750'; 2) PRES. TEST 5-1/2" CSG. (3) PUMP 25 SXS.CMT. @ 1,94 MIX & CIRC. TO SURF. 60 5) DIG OUT X CUT OFF WELDURING THIS PROCEDURE THE REQUIRED DISPOSAL,	inal inspection.) PUMP 25 SXS.CMT. @ 2 @ 500# X HOLD FOR 15 N 142'-1,822'(T/DLWR.).	,750'-2,620'. AINS. <i>,</i> 1 70 ~ (65' - 8"CSG.SHO DN STEEL P CLOSED-LO	(E) LATE TO CSGS	S. X INSTAL	L DRY HOLE MARI	KER.	
			SEE	ATTACH DITIONS	ED FOR OF APPRIAGO	I N I DIL CONSERVATIO ARTESIA DISTRICT	
14. I hereby certify that the foregoing is Com Name (Printed/Typed) DAVID A	Electronic Submission #34 For CIMAREX ENER Imitted to AFMSS for proces	RGY COMPA	IY OF CO, sent t	I Information o the Carlsba n 06/01/2016	System ad (16PP1327SE)	egendived	
Signature (Electronic S			Date 05/27/20	016	Cepted for S)	
	THIS SPACE FOR	R FEDERA	L OR STATE		- 12		
Approved By.)		Title Eno			Date 9/8/16	
Conditions of approval, if any, are attached certify that the applicant holds legal or equivalent would entitle the applicant to conduction.	itable title to those rights in the s		Office U)	•		
Title 19 H S C. Section 1001 and Title 42 I	U.S.C. Soution 1212 moles it a ar	in a famous no	non lenousinals and	willfully to me	ke to any department on	agonay of the United	



Cimarex Energy Co. of Colorado Wersell Federal #2 SWD

660' FNL & WL

Sec. 4, T-22-S, R-27-E; Eddy Co., NM

PIWETZ 30-015-24845

5/25/2016

8-5/8"24# J-55 @ 407"


cmt w/230 sx, cmt to surf

Baker Lockset packer @ 2740' Delaware Perfs:

2832 - 3794' (596 holes)

5-1/2" 15.5# K-55 ST&C csg @ 4650'

cmt w/1900 sx, circulated

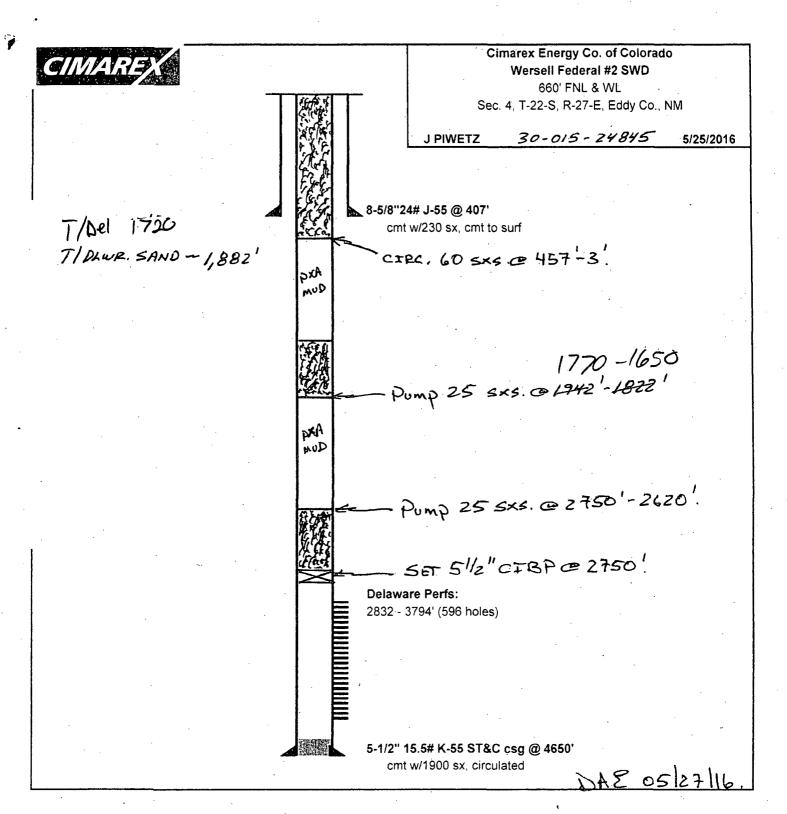

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.