Form 3/16%-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

WIM OF COMMISERVATION
WELLS
G-enter CANCT 1 1 2016 5.

FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

	Expires		
ease Seri	al No.		

SUNDRY NOTICES AND REPORTS ON WELLS	act	1
Do not use this form for proposals to drill as to se enter	// /	- 2

Do not use this form for proposals to drill or to re-enter and abandoned well. Use form 3160-3 (APD) for such proposals.

6. If Indian, Allottee or Tribe Name

NMNM15311

					<u> </u>		
SUBMIT IN TRII	erse side.		7. If Unit or CA/Agree MM 7274	ment, Name and/or No.			
Type of Well Oil Well				8. Well Name and No. EL PASO 23 FED COM 1			
Name of Operator Contact: STAN WAGNER EOG RESOURCES, INC. E-Mail: stan_wagner@eogresources.com					9. API Well No. 30-015-24039		
3a. Address P.O. BOX 2267 MIDLAND, TX 79702	(include area code) 6-3689)	10. Field and Pool, or Exploratory ROSS DRAW WOLFCAMP				
4. Location of Well (Footage, Sec., T.	, R., M., or Survey Description)			11. County or Parish, and State		
Sec 23 T26S R30E 660FSL 660FWL					EDDY COUNTY, NM		
12 CHECK APPE	ROPRIATE BOX(ES) TO		NATIBEOE	NOTICE P	EPORT OR OTHER	PDATA	
TYPE OF SUBMISSION	COLCIATE BOX(ES) TO	INDICATE			El OK1, OK OTTE	CDATA	
I THE OF SUBMISSION		TYPE OF ACTION					
☑ Notice of Intent	☐ Acidize			-		☐ Water Shut-Off	
☐ Subsequent Report	☐ Alter Casing		☐ Fracture Treat		nation	☐ Well Integrity	
	☐ Casing Repair☐ Change Plans		☐ New Construction		plete	Other	
☐ Final Abandonment Notice	☐ Convert to Injection	Z Flug	- · · ·		orarily Abandon Disposal		
13. Describe Proposed or Completed Ope			·				
determined that the site is ready for fit EOG Resources proposes to p 1. Set 4-1/2" CIBP at 11946. 2. Dump bail 35' Class H cements. 3. Circulate 9 ppg mud throug 4. Spot 60'sx Class H cements. 5. Perf and squeeze 4-1/2" cand. 6. Perf and squeeze 4-1/2" cand. 7. Cut and pull 4-1/2" casing and some set and so	plug and abandon this we tent on CIBP. WOC 4 hrs thout wellbore. It plug at 11750'. Tas at 11750' to 11750	TAG 1(530) ment at 9062 ment at 6374 casing stub. 1 nt at 3664'. 1	7458-72 NOC and TAG.	149 . 749 278' . 74 769 94 3'	g CBone String, 1904 SEE ATTACH CONDITIONS		
Name(Printed/Typed) STAN WA	For EOG RI Committed to AFMSS for	ESOURCES, II	IC., sent to the C DEBORAH MCK	Carlsbad INNEY on 08	3/30/2016 ()	4	
					01 had	l lecolo	
Signature (Electronic Submission)			Date 08/19/2	016	ACCEPTED TO		
	THIS SPACE FO	R FEDERA	L OR STATE			<u>B</u>	
Approved By U. Approved By U.	<u></u>		Title En	3		Date 9/30/16	
Conditions of approval, if any, are attached certify that the applicant holds legal or equivalent would entitle the applicant to conductive to conduct the applicant the applica	itable title to those rights in the	not warrant or subject lease	Office CF	0			
Title 18 U.S.C. Section 1001 and Title 43 l States any false, fictitious or fraudulent s	J.S.C. Section 1212, make it a tatements or representations as	crime for any pe	rson knowingly and thin its jurisdiction.	willfully to m	ake to any department or	agency of the United	


Additional data for EC transaction #348480 that would not fit on the form

32. Additional remarks, continued

11. Perf and squeeze 7" casing w/ 60 sx Class C cement at 1500". 1460-1350. Tag
12. Perf and squeeze 7" casing w/ 115 sx Class C cement at 396' until cement
reaches surface. Ensure cement is at surface in all annuluses.
13. Cut off wellhead and anchors three feet below surface. Weld on P&A marker
and bury. Clean location.


Seogresources

El Paso 23 Fed No. 1 660' FSL & 660' FWL Section 23,T26S, R30E Eddy County, New Mexico API No: 30-015-24039

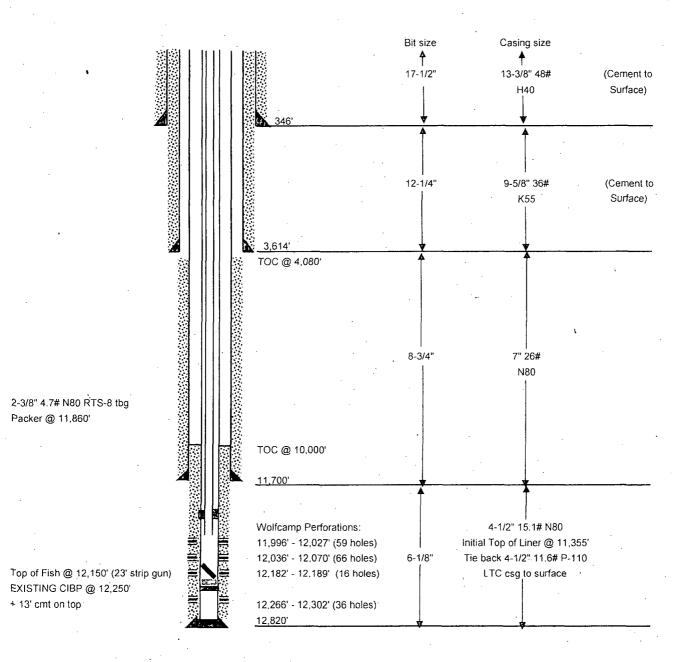

Seogresources

El Paso 23 Fed No. 1 660' FSL & 660' FWL Section 23,T26S, R30E Eddy County, New Mexico API No: 30-015-24039

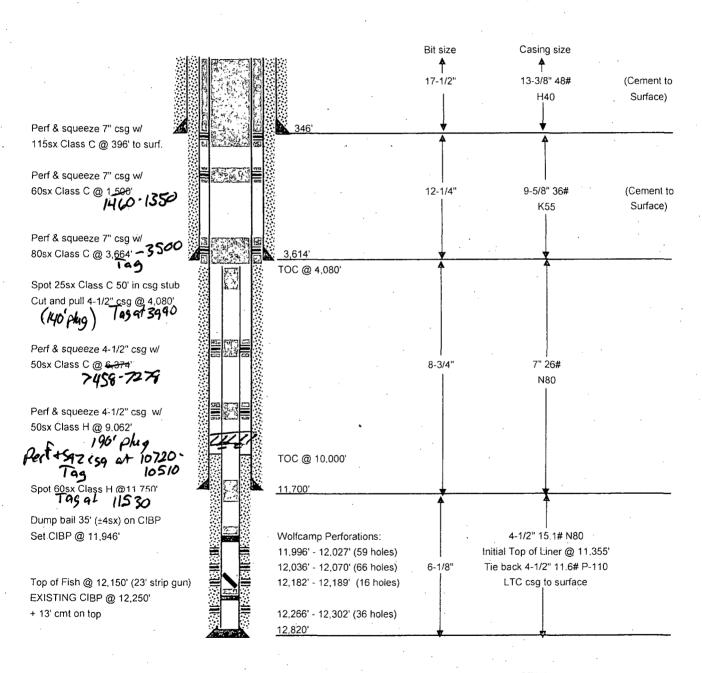

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted