Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED OMB No 1004-0137 Expires July 31, 2010

5. Lease Serial No. NMNM0415688A

					MODOL FORMANIA	
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.					6. If Indian, Allottee o	r Tribe Name
SUBMIT IN TRIPLICATE - Other instructions on page 2.					7. If Unit of CA/Agree	ement. Name and/or No.
1 Type of Well ☐ Oil Well ☐ Gas Well ☐ Other					8. Well Name and No. OLD INDIAN DRAW	
2. Name of Operator CHEVRON USA INC					9. API Well No. 30-015-20918	TONII #1
3a. Address 3b. Phone			(include area co	ode)	10. Field and Pool or Exploratory Area	
6301 DEAUVILLE BLVD RM N3002 MIDLAND, TX 79706 432-6)		INDIAN DRAW DELEAWARE	
4. Location of Well (Footage, Sec., T. R., M. or Survey Description) SEC 18 T23S, R28E 1980 FSL & 1980 FEL					11 Country or Parish, EDDY CO., NM	State
12 CHEC	K THE APPROPRIATE B	OX(ES) TO INDI	ICATE NATUR	E OF NOTIO	CE, REPORT OR OTH	ER DATA
TYPE OF SUBMISSION			TY	PE OF ACT	ION	
✓ Notice of Intent	Acidize Alter Casing	Deepe	en ure Treat	=	uction (Start/Resume) amation	Water Shut-Off Well Integrity
Subsequent Report	Casing Repair		Construction		omplete	Other
Final Abandonment Notice	Change Plans Convert to Injection		and Abandon Back	_	porarily Abandon er Disposal	
1 NOTIFY BLM 24 HRS BEFORE 2. SET CIBP@3150' AND SPOT 25 3. CIRCULATE WELLBORE WITH 4. SPOT 55SX OF CLASS "C" CEN 5. PERF & SQUEEZE 200SX OF C 6. CLEAN LOCATION, CUT-OFF V	SSX ON TOP MLF. MENT FROM 2,400'-2,200 LASS "C" CEMENT FRO	M 415'-SURFA	CE. VERIFY C		R REMEDIATION.	
ALL FLUIDS WILL BE IN CLOSED						NW ON
		-MA				ARTESIA
	٠ ٤٠	41600,	Affic design county in the			JAN
	vccepted to		SUE M LOVE	TACH	ID FOR OF APPROV	ARTESIA DISTRICT JAN: 2017
	R	L.B.				The state of the s
14 I hereby certify that the foregoing is t	rue and correct Name (Princ	ted/Typed)				
M. LEE ROARK			Title PROJECT MANAGER			THE RESERVE OF THE PARTY OF THE
Signature U La	Jank'		Date 01/03/2	:017		
	THIS SPACE	FOR FEDE	RAL OR ST	TATE OF	FICE USE	
Approved by	Jelie)		Title	5/15		Date // 17
Conditions of approval. (Pany, are attache that the applicant holds legal or equitable	title to those rights in the subj			101		
entitle the applicant to conduct operations Title 18 U S C Section 1001 and Title 43		a crime for any ne	rson knowingly	and willfully	to make to any denartmen	nt or agency of the United States any false
		ioi uny pu			to any departmen	beney or me orinted orange and talse.

fictitious or fraudulent statements or representations as to any matter within its jurisdiction

PROPOSED PA WELLBORE DIAGRAM

Old Indian Draw Lease Name: Well#: 1980' FSL & 1980' FEL Surf. Loc.: **Bottom Loc.:** 18 Sec.: 22S Township: Range: 28E

Field: Reservoir: GE: KB: DF: Status:

Indian Draw Delaware 3080 Oil Well

Hole Size:

Csg. Size:


Sxs. Cmt.:

TOC @:

Circ: Y/N:

Set @:

API #.: 30-015-20918 CHEVNO: Cost Center: 8/27/1973 Spud Date: Comp. Date: 12/3/1973 County: Eddy State: New Mexico

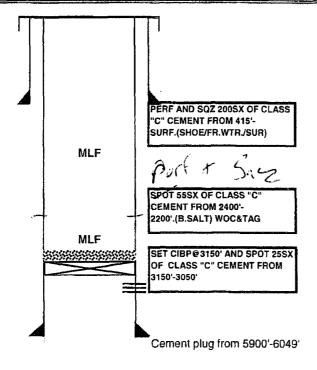

15*

365

265

Υ

11-3/4" 42#

SURFACE

Hole Size: 11 Csg. Size: 8-5/8" 24# Set @: 5933 Sxs. Cmt.: 1050 TOC @: CALCULATED Circ: Y/N: Ν

Cement plug from 9350'-9450'

Cement plug from 10900'-11000'

Cement plug from 12100'-12200'

TD: 12450 Created (By):

LRQS Updated (By):

CURRENT

Chevron U.S.A. Inc. Wellbore Diagram: OID UT 1

CITCVIO	il U.S.A. IIIC. Wellbule Dia	grain. OID	O 1 T	
Lease: OHO HOBBS FMT Well No.: OLD INDIAN DRAW UNIT 1 1		Field: INDIAN DRAW		
Location: 1980FSL1980FEL Sec.: N/A		Blk:	Survey: N/A	
County: Eddy St.: New Mexico	Refno: EN5582	API: 3001520918	Cost Center: UCRE60100	
Section: E028	Township: 18 S		Range: S022 E	
Current Status: ACTIVE		Dead Man Ancho	rs Test Date: 05/20/2013	
Directions:				
5 2472 1648 624 0		72.750 (3/4 in.) H H-40 11.750 OD ID 10.928 Drift (Cement (behind Casing Shoe (11	Spray Metal x 22 5 Rod Sub(s) @(36-46) / 42.00# Unknown Thread 11.084 g(14-364) Casing) 365 sx @(14-365) .750 OD Casing) @(364-365) D-15.0000 @(14-365)	
3735 3105		Perforations - D Perforations - D Perforations - D J-55 2.875 OD/ 2.441 ID 2.347 Producing Interv Perforations - D Pump Barrel @(
5013		1.250 (1 1/4 in.) @(3196-3571) Rod Pump (Inse 25-125-R H BC	ng Sub 2.875 @(3560-3564) (Unknown) x 25 Sinker Bar rt) (NON-SERIALIZED) - -0-0 (Bore = 1.25) @(3571) 75 @(3564-3596)	
9009		ID 7.796 Drift @ Wellbore Hole 0 Casing Shoe (8	D-11.0000 @(365-5933) .625 OD Casing) @(5932-5933) Casing) 1050 sx @(14-5933)	
9961		Plug - Cement @	•	
450		Plug - Cement @	•	

Ground Elevation (MSL): 3080.00	Spud Date: 08/27/1973	Compl. Date: 01/01/1800
Well Depth Datum: Kelly Bushing	Elevation (MSL): 3094.00	Correction Factor: 14.00
Last Updated by: keli	Date: 05/13/2015	

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.