Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

OCD Artesia

FORM APPROVED OMB No 1004-0137 Expires July 31, 2010

5. Lease Serial No.


					NMNM29234		
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.					6 If Indian, Allottee or Tribe Name		
SUBMIT IN TRIPLICATE - Other instructions on page 2.					7 If Unit of CA/Agreement, Name and/or No.		
1 Type of Well					0 11/all Name and Na		
Oil Well Gas Well Other					8 Well Name and No. LOTOS 8 FEDERAL #803		
2. Name of Operator CHEVRON USA INC					9. API Well No. 30-015-32758		
3a Address 6301 DEAUVILLE BLVD RM N3002 MIDLAND. TX 79706 ATTN LEE ROARK 3b. Phone No. (include area code) 432-687-7279					10. Field and Pool or Exploratory Area SAND DUNES		
4 Location of Well (Footage, Sec. T., R., M. or Survey Description) SEC 8, 7245, R31E 1980 FNL 8, 1980 FWL					11. Country or Parish, State EDDY CO., NM		
12 CHEC	K THE APPROPRIATE BOX	(ES) TO IND	DICATE NATUR	E OF NOTIO	CE, REPORT OR OTHE	R DATA	
TYPE OF SUBMISSION			TY	PE OF ACT	ION		
✓ Notice of Intent	Acidize Alter Casing	Deep Deep	oen ture Treat	=	uction (Start/Resume)	Water Shut-Off Well Integrity	
Subsequent Report	Casing Repair		Construction		mplete	Other	
Final Abandonment Notice	Change Plans Convert to Injection		and Abandon Back		porarily Abandon er Disposal		
determined that the site is ready fo 1. NOTIFY BLM 24 HRS BEFORE (2. SET CIBP@7800' AND SPOT 25 3. CIRCULATE WELLBORE WITH 4. SPOT 25SX OF CLASS "C" CEM 5. PERF & SQUEEZE 100SX OF CL 6. PERF & SQUEEZE 55SX OF CL 7. PERF & SQUEEZE 65SX OF CL 8. CLEAN LOCATION, CUT-OFF WALL FLUIDS WILL BE IN CLOSED	OPERATIONS. ISX ON TOP. MLF. MLF. LASS "C" CEMENT FROM 1, ASS "C" CEMENT FROM 1, ASS "C" CEMENT FROM 1, ASS "C" CEMENT FROM 2, ASS "C" CEMENT FROM 2,	4,377'-3,986 705'-1,505' 039'-839'. \ 50'-SURFA	O' WOC&TAG. (I WOC&TAG. (SH NOC&TAG. (SH DE. VERIFY CE KER AND TURN	SALT) OE) MENT TO: NOVER FO	SURFACE (SHOE/FR		
En UC (a	As Altocl	ne	O Q I E W			M OIL CONSERVATION ARTEGIA DISTRICT	
14 I hereby certify that the foregoing is t	rue and correct Name (Printed	Typed)				FER 1 3 2017	
M. LEE ROARK			Inte PROJE	CT MANAG	ER	(L.), L O CO	
Signature M /	Tink		Date 02/02/2	017		KECEIVED	
	THIS SPACE F	OR FEDI	ERAL OR ST	ATE OF	FICE USE		
Approved by WCA	9		Title 2	Eng		ale 2/4/17	
Conditions of approval, if any, are attached that the applicant holds legal or equitable the entitle the applicant to conduct operations	d Approval of this notice does n title to those rights in the subject thereon	ot warrant or lease which w	centify ould Office	cro	c!	ord	
Title 18 U S C Section 1001 and Title 43 fictitious or fraudulent statements or representations.	USC Section 1212, make it a cesentations as to any matter with	rime for any j n its jurisdicti	person knowingly a	and willfully	to make to any dipariment	or agency of the United States any false	
Conditions of approval, if any, are attached that the applicant holds legal or equitable the entitle the applicant to conduct operations. Title 18 U.S.C. Section 1001 and Title 43 fictitious or fraudulent statements or representations on page 2)				bico	epienoca R.L.B		
					17		

PROPOSED P&A WBD

LOTOS 8 FEDERAL #803

803 St. Lse: LOTOS 8 FEDERAL SAND DUNES 1980' FNL & 1980' FEL		Ltr.:	30-015-32758 Section: 8 24S-31E
St.: NM	~		
	MLF		Perf at 250' and squeeze 65sx of Class "C cement from 250'-surface. Perf at 1,039' and squeeze 55sx of Class "C cement over top of shoe from 1,039'-839'.
	MLF		Perf and Sqz. 55sx of Class "C cement over top of T.Salt from
	MLF		Perf and Sqz. 100sx of Class "C" cement over top of Shoe/Del./B.Salt from 4,377'-3,980'. WOC & TAG.
	MLF		
			ot 25sx of Class "C" cmt as spacer g from 5,800'-5,600'.
	MLF	7,8 cm	t CIBP over Delaware perfs at 00' and spot 25sx of Class "C" t. on top from 7,800'-7,600'.
	OS 8 FEDERAL AND DUNES FNL & 1980' FEL St.: NM	DS 8 FEDERAL AND DUNES FNL & 1980' FEL St.: NM MLF MLF MLF	DS 8 FEDERAL AND DUNES FNL & 1980' FEL St.: NM Directions: Chevno: MLF MLF MLF MLF Spc plu MLF Pel


PBTD: 8193' TD: 8265'

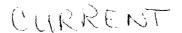

Chevron U.S.A. Inc. Wellbore Diagram: LOTOS 8 F 803



[Lease] OEU EUNICE FMT [Well No.] LOTOS 8 FEDERAL 803 803 [Field] N/A
[Location] 1980FNL1980FWL [Sec.] N/A [Bik] [Survey] N/A
[County] Eddy [St.] New Mexico [Refno] HK7856 [API] 3001532758 [Cost Center] UCPl34400
[Section] E031 [Township] 8 S [Range] S024 E
[Current Status] ACTIVE [Dead Man Anchors Test Date] NONE
[Directions]

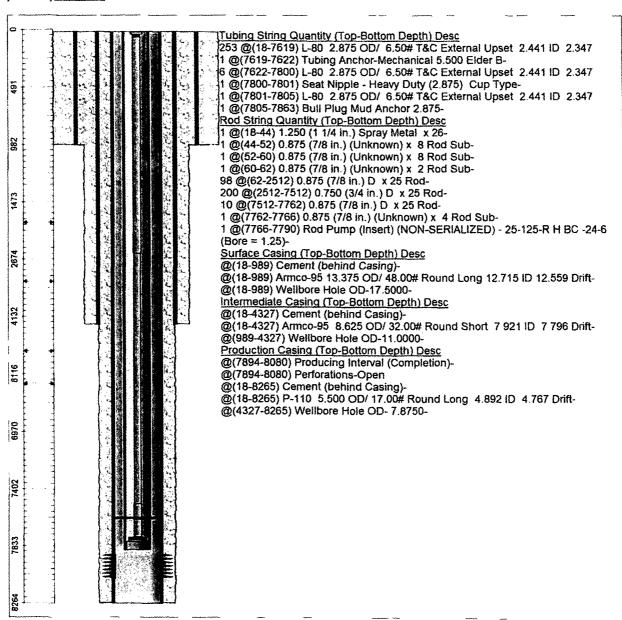

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted