

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-01941
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator State of New Mexico formerly Canyon E&P Company		6. State Oil & Gas Lease No.
3. Address of Operator 1625 N. French Drive Hobbs, NM 88240		7. Lease Name or Unit Agreement Name Artesia Metex Unit
4. Well Location Unit Letter N : 330 feet from the South line and 2410 feet from the West line Section 19 Township 18S Range 28E NMPM County Eddy		8. Well Number 23
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. OGRID Number 269864
		10. Pool name or Wildcat Artesia QU-GB-SA

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
CLOSED-LOOP SYSTEM <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

SEE ATTACHMENTS

HOBBS OCD

JUL 10 2018

RECEIVED

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mark Whitaker TITLE Petroleum Engr Specialist DATE 07/10/2018

Type or print name Mark Whitaker E-mail address: _____ PHONE: 575-393-6161

For State Use Only

APPROVED BY: Maureen Brown TITLE AO/I DATE 7/11/2018
Conditions of Approval (if any): _____

Canyon E&P Company
Artesia Metex Unit No. 23
30-015-01941
330' FSL & 2410' FWL
UL – N, Sec. 19, T18S, R28E


8 5/8" 24# csg at 439' w/ 50 sx cmt.
5 1/2" 14# csg at 1922' w/ 50 sx cmt. ETOC 1300'
OH 1922' – 2058'
TD 2058'

1. MIRU plugging equipment. POOH w/ production equipment.
2. Tag CIBP at 1806'. Circulate hole w/ mud laden fluid and pressure test casing to 500 psi.
3. Spot 50 sx cement.
4. Perforate at 489'. Pump sufficient cement to circulate to surface inside/outside of 5 1/2" casing.
5. Cut off wellhead 3 feet below ground level.
6. Verify cement to surface on all strings.
7. Install upright P&A marker and cut off anchors.

NOTES: Mud laden fluid consists of 9.5 ppg with 25 sx salt gel per 100 bbls of fluid. If casing will not hold pressure, contact the OCD for instructions prior to proceeding with P&A.

Canyon E P Company
Artesia Metex Unit No. 23

CURRENT
30-015-01941

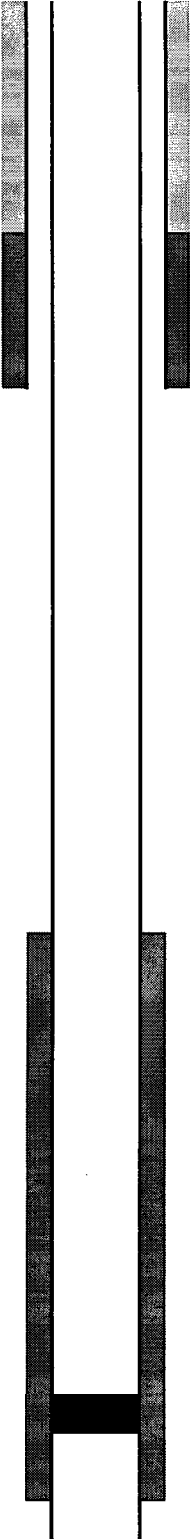

NOTES:

PA'd 1962

Re-entered 1974


TA'd 1996 w/ CIBP at 1806'

Surface hole 12 1/2" to 250'

10" hole to 439', 6 3/4" hole to TD

**Canyon E P Company
Artesia Metex Unit No. 23**

**PROPOSED
30-015-01941**

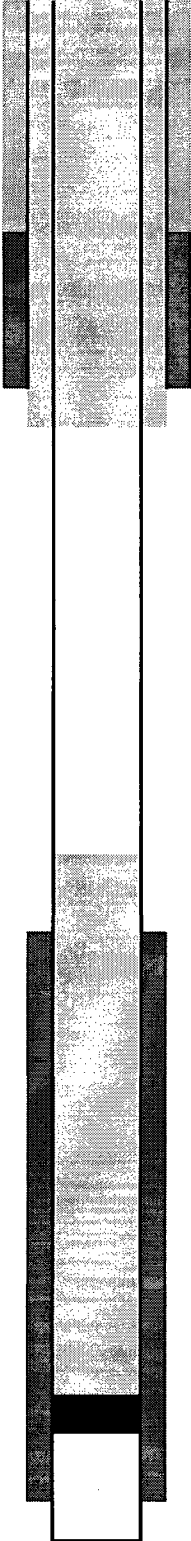

**INSTALL P&A MARKER
VERIFY CEMENT TO SURFACE ALL STRINGS
CUT OFF WELLHEAD 3' BELOW GL**

**CIRCULATE CMT TO SURFACE
PERFORATE AT 489'.**

8 5/8" 24# @ 439' w/ 50 sx

ETOC 1300'

**SPOT 50 SX CMT ON CIBP
CIRC MLF. PRESSURE TEST CSG
TAG CIBP AT 1806'**

**5 1/2" 14# @ 1922' w/ 50 sx
OH 1922' - 2058'**