UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT


OCD Artesia

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

5. Lease Serial No. NMNM93771

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an

abandoned we	o. If fildian, Affoliae	6. If fildian, Affolice of Tribe Name			
SUBMIT IN 1	7. If Unit or CA/Agre	eement, Name and/or No.			
1. Type of Well Gas Well Gas Well Oth	8. Well Name and No SHUGART WES	T 24 FEDERAL J 3			
Name of Operator MARATHON OIL PERMIAN L	9. API Well No. 30-015-31581-	00-S1			
3a. Address 5555 SAN FELIPE ST HOUSTON, TX 77056 3b. Phone No. (include area code) Ph: 713-296-3179			10. Field and Pool or SHUGART	10. Field and Pool or Exploratory Area SHUGART	
4. Location of Well (Footage, Sec., T	11. County or Parish,	State			
Sec 24 T18S R30E NWSE 23	EDDY COUNT	Y, NM			
12. CHECK THE A	PPROPRIATE BOX(ES) TO I	NDICATE NATURE OF	NOTICE, REPORT, OR OT	HER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION				
Notice of Intent ■	☐ Acidize	□ Deepen	☐ Production (Start/Resume)	■ Water Shut-Off	
_	☐ Alter Casing	☐ Hydraulic Fracturing	☐ Reclamation	■ Well Integrity	
☐ Subsequent Report	Casing Repair	■ New Construction	☐ Recomplete	Other	
☐ Final Abandonment Notice	□ Change Plans	Plug and Abandon	□ Temporarily Abandon		
	☐ Convert to Injection	□ Plug Back	■ Water Disposal		
Attach the Bond under which the wor following completion of the involved testing has been completed. Final Abdetermined that the site is ready for final of the f	operations. If the operation results in pandonment Notices must be filed only in all inspection. Ex cmt. G. 4539. (Del) G. 2720. (Slow) G. 1858 - 1738 (B) Install DHM. RECENED	a multiple completion or record after all requirements, including the season of the se	npletion in a new interval, a Form 31	Potash. Potash. Potash. Potash. Potash. Potash. Potash. Potash.	
14. I hereby certify that the foregoing is true and correct. Electronic Submission #432492 verified by the BLM Well Information System For MARATHON OIL PERMIAN LLC, sent to the Carlsbad Committed to AFMSS for processing by DEBO RAH MCKINNEY on 08/24/2018 (18DLM0611SE) Name (Printed/Typed) MELISSA SZUDERA Title REGULATORY COMPIANCE REP					
Signature (Electronic S	Submission)	Date 08/23/20	18		
	THIS SPACE FOR F	EDERAL OR STATE (OFFICE USE		
Approved By	itable title to those rights in the subject	arrant or ct lease	show field DH	9-9-18 Date	
which would entitle the applicant to condu					
Carried and Garden and Garden	***************************************		,,p	J, J	

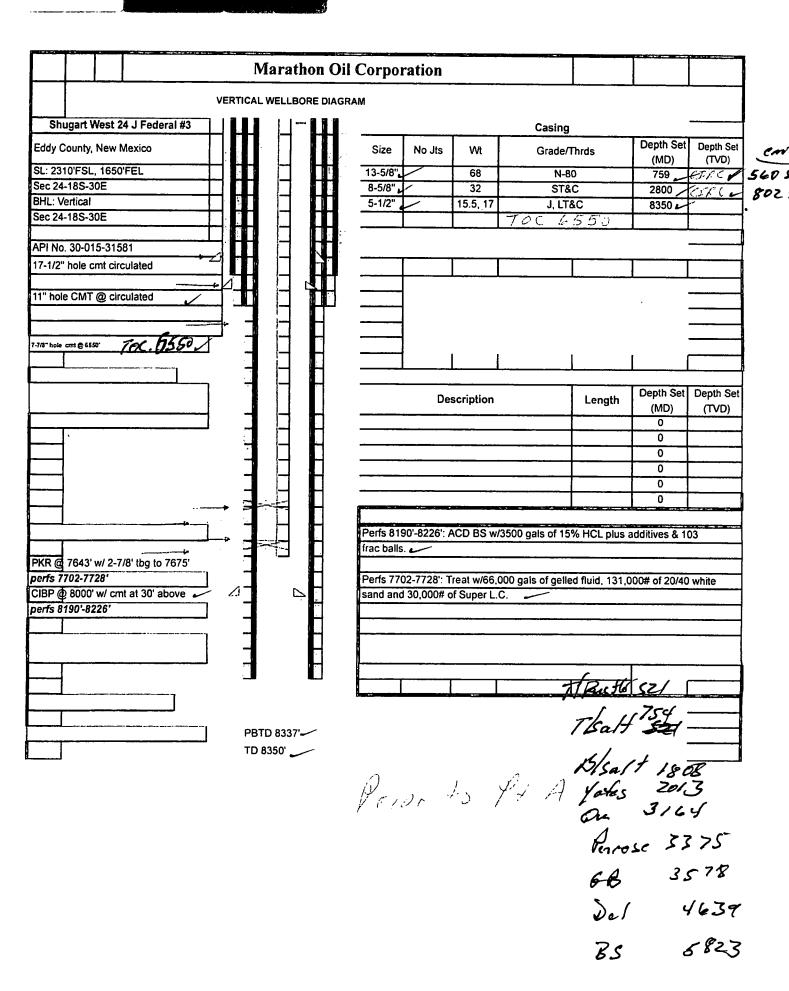

MAVERICK WELL PLUGGERS

COMPANY:


WELL NAME:

WELL#:

COUNTY:

LEASE ID:

SURFACE CASING							
OD	WT/FT	GRADE	SETAT	TOC			
13 3/4"	68		759				
INTERMEDIATE CASING							
OD	WT/FT	GRADE	SETAT	TOC			
8 3/8"	32		2.800				
PRODUCTION CASING							
OD	WT/FT	GRADE	SETAT	10C			
5 /2	15.5		8350				
TUBING							
OD	WT/FT	GRADE	SET AT	TAC			
L							

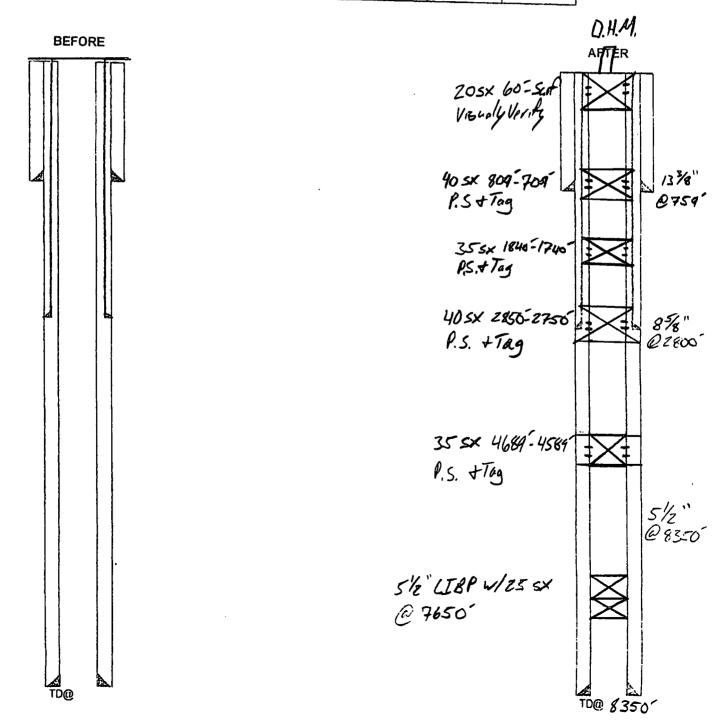

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. Show date well was plugged.
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted