Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

QCD Artesia

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

5. Lease Serial No. NMLC028446A

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an
abandoned well. Use form 3160-3 (APD) for such proposals.

abandoned well. Use form 3160-3 (APD) for such proposals.					6. If Indian, Allottee of	r Tribe Na	ime	
SUBMIT IN TRIPLICATE - Other instructions on page 2					7. If Unit or CA/Agreement, Name and/or No.			
1. Type of Well					8. Well Name and No. VANDAGRIFF 11			
Oil Well Gas Well Oth		AINICTH A	DRESTON		9. API Well No.			
2. Name of Operator Contact: KENNETH A PRESTON ROVER OPERATING LLC E-Mail: kpreston@roverpetro.com					30-015-01325-00-S1			
3a. Address 17304 PRESTON ROAD SUIT DALLAS, TX 75252	(include area code) 1-9115		10. Field and Pool or Exploratory Area RED LAKE					
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					11. County or Parish, State			
Sec 5 T17S R28E NESE 1980FSL 660FEL					EDDY COUNTY, NM			
12. CHECK THE A	PPROPRIATE BOX(ES) TO	O INDICAT	TE NATURE OI	F NOTICE,	REPORT, OR OTH	IER DA	TA	
TYPE OF SUBMISSION			TYPE OF	ACTION				
Notice of Intent	Notice of Intent		☐ Production (Start/Resume)		□ Wa	iter Shut-Off		
	☐ Alter Casing ☐ Hydraulic Fracturing ☐		□ Reclamation		■ Well Integrity			
☐ Subsequent Report	☐ Casing Repair	□ New	New Construction Reco		Recomplete		ner	
☐ Final Abandonment Notice	☐ Change Plans	🛭 Plug	and Abandon	□ Tempor	arily Abandon			
	☐ Convert to Injection ☐ Plug Back ☐ W		☐ Water D	Disposal				
Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection. Rover Petroleum respectfully wishes to inform you of intent to plug the Vandagriff #11 on September 1, 2019 Proposed Procedure: MIRU ND WH, NU BOP POOH with production equipment Set CIBP at 1300?, cap with 40 sxs cmt (expect TOC at +/-1000?) Tag TOC. Perf & squeeze at 340?, circulate if possible. Displace to 240? Tag TOC. Circulate wellbore w/cmt, POOH and fill to surface w/cmt Install dry hole marker, clean loc, RDMO								
14. I hereby certify that the foregoing is	Electronic Submission #43	PERATING L	LC. sent to the C	Carlsbad	-			
Name (Printed/Typed) BRADY W	VILTON		Title ENGINE	EER				
Signature (Electronic	Submission)		Date 09/21/20	018				
THIS SPACE FOR FEDERAL OR STATE OFFICE USE								
Approved By Conditions of approval, if any, are attaches ertify that the applicant holds legal or equ	uitable title to those rights in the si	ot warrant or ubject lease	Title Suf	IV. AE	TILLE		10-15-18 Date	
which would entifle the applicant to condu- fitie 18 U.S.C Section 1001 and Title 43 States any talse, fictitious or fraudulent	U.S.C. Section 1212, make it a cm	ime for any pe	office (acresson knowingly and thin its jurisdiction.	willfully to ma	ake to any department or	agency o	f the United	

ROVER PETROLEUM, LLC WELLBORE DIAGRAM - CURRENT

Lease/Well No.:

Vandagriff #11

ELEVATION, GL: 3589'

Location:

1980' FSL & 660' FEL

UL: I, SEC 5, T17S, R28E

EDDY County, NM

API No.:

30-015-01325

FIELD: VANDIGRIFF; KEYES, Q

Spudded: Completed:

1/21/1955 3/6/1955

Tubing Count 2-3/8" tbg

Rod Count 5/8" rods

Plugs

Cmt plug from TD to 1372'

Surface Csg:

8-5/8", 28#

Csg Set @ 503'

Gmt'd w/20 sx

TOC = 350' (calc)

Recovered.

7' @ /275

Recovered.

Pulled

Production Csg:

5-1/2" 15.5#

Csg Set @ 1,349'

Gmt'd w/ 25 sx

TOC = 1080' (calc)

600 SX 4 %

3-1 Circ.

1372' PBTD 2420' TD

FORMATIONS:

<u>TOPS</u>	DEPTH, ft			
Yates	289'			
Queen	1,141'			
San Andres	1,910'			
	•			

PERFORATIONS

DEPTHS 1349' - 1372'

ZONE

SPF - # OF HOLES
OPEN HOLE

<u>DATE</u> 3/6/1955

ROVER PETROLEUM, LLC WELLBORE DIAGRAM - CURRENT

Lease/Well No.:

Vandagriff #11

ELEVATION, GL: 3589'

Location:

1980' FSL & 660' FEL

UL: I, SEC 5, T17S, R28E

EDDY County, NM

API No. :

30-015-01325


Spudded:

1/21/1955

FIELD: VANDIGRIFF; KEYES, Q

Completed:

3/6/1955

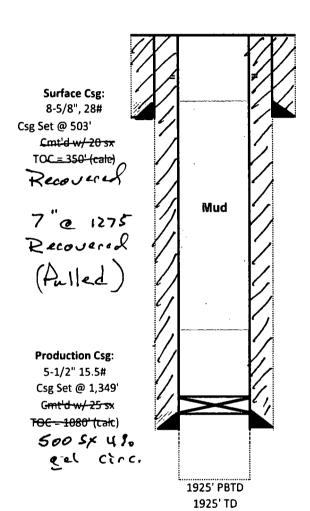

Tubing Count N/A

Rod Count

N/A

Plugs

CIBP + 25 SXS CMT @ 1300'

CMT from 340' to surface

FORMATIONS:

<u>TOPS</u>	<u>DEPTH, ft</u>
Yates	289'
Queen	1,141'
San Andres	1,910'

PERFORATIONS

DEPTHS 1349' - 1372' ZONE

SPF - # OF HOLES

OPEN HOLE

DATE 3/6/1955

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.