

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
OCD ArtesiaFORM APPROVED
OMB NO. 1004-0137
Expires: January 31, 2018**SUNDRY NOTICES AND REPORTS ON WELLS**
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.5. Lease Serial No.
NMNM45235

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

SUBMIT IN TRIPLICATE - Other instructions on page 28. Well Name and No.
PURE GOLD C-17 FEDERAL 49. API Well No.
30-015-2715310. Field and Pool or Exploratory Area
W SAND DUNES11. County or Parish, State
EDDY COUNTY, NM

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other2. Name of Operator
DEVON ENERGYContact: MAX LUBITZ
E-Mail: max.lubitiz@dvn.com3a. Address
333 WEST SHERIDAN AVENUE
OKLAHOMA CITY, OK 731023b. Phone No. (include area code)
Ph: 580-202-4593NM OIL CONSERVATION
ARTESIA DISTRICT

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Sec 17 T23S R31E Mer NMP 1780FNL 330FEL

JAN 31 2019

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize <input type="checkbox"/> Deepen <input type="checkbox"/> Production (Start/Resume) <input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing <input type="checkbox"/> Hydraulic Fracturing <input type="checkbox"/> Reclamation <input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair <input type="checkbox"/> New Construction <input type="checkbox"/> Recomplete <input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans <input checked="" type="checkbox"/> Plug and Abandon <input type="checkbox"/> Temporarily Abandon
	<input type="checkbox"/> Convert to Injection <input type="checkbox"/> Plug Back <input type="checkbox"/> Water Disposal

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

1. MIRU P&A unit.

2. Pull rod pump and 2-7/8" production tubing assembly from ~7963'.

3. Set CIBP @ 6000' Spot 20 sx CI C 5900-6000. WOC & tag (Open perfs at 6267') CIBP 6200, spot 25 sx min

4. Spot 20 sx CI C 6000-6100. WOC & Tag (DV tool 6051') 6100 25 sx min. 160' plug

5. Spot 225 sx CI C @ 4560-2831. WOC & tag (R-111P, T. Delaware 4510', B. Salt 4200', Shoe 4090')

6. Spot 225 sx CI C @ 2831-550. WOC & tag (R-111P, T. salt 1102, shoe 604')

7. Perf @ 140'. Pump 35 sx CI C in/out to surface.

8. Cut wellhead off 3' BGL. Set dry hole marker.

(well inside R-111P boundary. Salt section noted @ 1,102' - 4,200')

Secretary's Potash.

SEE ATTACHED FOR
CONDITIONS OF APPROVAL

Below ground level dry hole marker required

14. I hereby certify that the foregoing is true and correct.

Electronic Submission #449993 verified by the BLM Well Information System
For DEVON ENERGY, sent to the Carlsbad
Committed to AFMSS for processing by JAMES AMOS on 01/15/2019 ()

Name (Printed/Typed) MAX LUBITZ

Title ENGINEER

Signature (Electronic Submission)

Date 01/10/2019

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved By <u>James A. Amos</u>	Title <u>SAET</u>	Date <u>1-25-19</u>
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.	Office <u>C/O</u>	

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED **

ENTERED
1-25-19

DEVON ENERGY PRODUCTION COMPANY LP

Well Name: PURE GOLD C-17 FED 04		Field: Todd Southwest	
Location:	SEC 17-T235-R31E	County: Eddy	State: New Mexico
Elevation:		Spud Date: 10/7/1992	Compl Date: 12/16/1992
API#: 30-015-27153	Prepared by:	Date:	Rev:

CURRENT WELLBORE


17-1/2" Hole ✓
13-3/8", 54.5#, H-40 @ 604' ✓
 Cmt'd w/850 sx to surface ✓

12-1/4" Hole ✓
8-5/8", 32#, J55, @ 4090' ✓
 Cmt'd w/2320 sx to surface ✓

DV tool 6051 ✓

Perforations
 7888-7950 ✓
 7715-7769 ✓
 6808-6814 ✓
 6267-6288 ✓

7-7/8" Hole ✓
5-1/2", 15.5#, K55, @ 8070' ✓
 Cmt'd w/1250 sx CI C cmt to surf

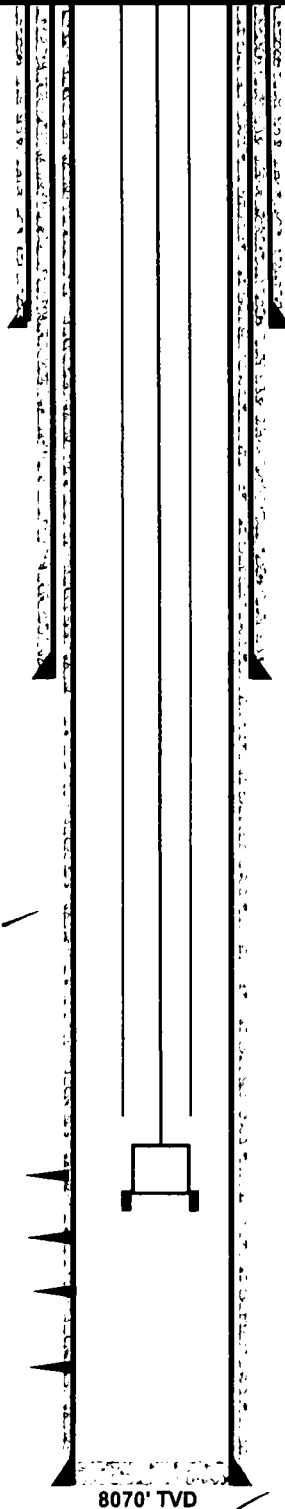

Est. { Rustler 750
 { Sacteo 912
 { B/sact 3390

oper { T/sact 1102
 { B/sact 4200

Del 4171

Cherry 5173

Bruce 6315

BS 7988

Rods to 1.5" pump at 7936

2-7/8" tubing to 7963'

DEVON ENERGY PRODUCTION COMPANY LP				
Well Name: PURE GOLD C-17 FED 04		Field: Todd Southwest		
Location: SEC 17-T235-R31E		County: Eddy		State: New Mexico
Elevation: 		Spud Date: 10/7/1992		Compl Date: 12/16/1992
API#: 30-015-27153		Prepared by: 		
		Date: Rev: 		

PROPOSED WELLBORE

17-1/2" Hole
13-3/8", 54.5#, H-40 @ 604'
 Cmt'd w/850 sx to surface

12-1/4" Hole
8-5/8", 32#, J55, @ 4090'
 Cmt'd w/2320 sx to surface

Perforations
 7888-7950
 7715-7769
 6808-6814
 6267-6288

7-7/8" Hole
5-1/2", 15.5#, K55, @ 8070'
 Cmt'd w/1250 sx Cl C cmt to surf

Proposed:

- Spot 10 sx Cl C 3'-33'.
- Cut WH off 3' BGL, Set dry hole marker.

Proposed:

- Spot 225 sx Cl C @ 2831-550. WOC & tag (R-111P, T. salt 1102, shoe 604')

Proposed:

- Spot 225 sx Cl C @ 4560-2831. WOC & tag (R-111P, T. Delaware 4510', B. Salt 4200', Shoe 4090')

Proposed:

- Spot 20 sx Cl C 6000-6100. WOC & Tag (DV tool 6051')

Proposed:

- POOH rods and tubing. Test CSG.
- Set CIBP @ 6000.
- Spot 20 sx Cl C 5900-6000. WOC & tag (Open perms at 6267')

Proposed:

1. POOH rods and tubing. Test CSG.
2. Set CIBP @ 6000.
3. Spot 20 sx Cl C 5900-6000. WOC & tag (Open perms at 6267')

**BUREAU OF LAND MANAGEMENT
Carlsbad Field Office
620 East Greene Street
Carlsbad, New Mexico 88220
575-234-5972**

**Permanent Abandonment of Federal Wells
Conditions of Approval (LPC Habitat)**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within **ninety (90)** days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. **Notification:** Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. **Blowout Preventers:** A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. **Mud Requirement:** Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. **Cement Requirement:** Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.** Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:

From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted