UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

OCD Artesia

FORM APPROVED

	Expires: January 31, 20
5.	Lease Serial No.
	NMLC064391B

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an
abandoned well. Use form 3160-3 (APD) for such proposals.

6. If Indian, Allottee or Tribe Name


abandoned wei	i. Use form 5100-5 (Ar D	ioi sacii proposais.					
SUBMIT IN 1	7.	7. If Unit or CA/Agreement, Name and/or No.					
1. Type of Well Gas Well Oth	ег		8.	8. Well Name and No. INDIAN HILLS UNIT 30			
Name of Operator OXY USA WTP LP	DAVID STEWART int@oxy.com		9. API Well No. 30-015-31655				
3a. Address P.O. BOX 50250 MIDLAND, TX 79710	1	3b. Phone No. (include: area (c) (d)) VIIII 432-685-5717 ARTESIA DISTRICT	10 IO	10. Field and Pool or Exploratory Area INDIAN BASIN MORROW			
4. Location of Well (Footage, Sec., T Sec 20 T21S R24E NWSW 14	•	JAN 3 1 2019	11	11. County or Parish, State EDDY COUNTY, NM			
32.461788 N Lat, 104.526825		RECEIVED		EDDY COONTY, NW			
12. CHECK THE A	PPROPRIATE BOX(ES) T	TO INDICATE NATURE OF	F NOTICE, RE	PORT, OR OTHI	ER DATA		
TYPE OF SUBMISSION	TYPE OF SUBMISSION TYPE OF ACTIO						
Notice of Intent ■	☐ Acidize	☐ Deepen	☐ Production	(Start/Resume)	☐ Water Shut-Off		
☐ Subsequent Report	☐ Alter Casing	☐ Hydraulic Fracturing	☐ Reclamation		☐ Well Integrity		
	Casing Repair	□ New Construction	Recomplete		Other		
☐ Final Abandonment Notice	☐ Change Plans ☐ Convert to Injection	☑ Plug and Abandon ☐ Plug Back	☐ Temporarily ☐ Water Disp				
Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all required that the site is ready for final inspection. TD-11443' PB-10106' Perfs-9728-9748' CIBP-10300 CONDITIONS OF APPROVAL 13-3/8" 54.5# csg @ 1200' w/ 1250sx, 17-1/2" hole, TOC-Surf-Circ 9-5/8" 40-43.5# csg @ 8191', DVT @ 6680' w/ 2610sx, 12-1/4" hole, TOC-Surf-Circ 7" 26# csg @ 8026-10748' w/ 350sx, 8-1/2" hole, TOC-8026'-Circ 1. RIH & set CIBP @ 9678', M&P 45sx to 9478' 2. M&P 70sx cmt @ 8244-7976' WOC-Tag 9543 (T/STrown & T/Circ All Alm from 7789-7609) 4. M&P 65sx cmt @ 6730-6560' WOC-Tag 690 9 (T/Wolf Compd To64) 5. M&P 65sx cmt @ 3715-3575' WOC-Tag 690 9 (T/Wolf Compd To64) 6. M&P 55sx cmt @ 2442-2284' WOC-Tag 260 9 2352 (T/Yeso & Goorrela)							
14. I hereby certify that the foregoing is	ll Information Sy sbad OS on 01/15/2019 GULATORY AL	0					
Name (Printed/Typed) DAVID S	IEVVARI	Title SR. RE	GULATURTAL	OVISOR			
Signature (Electronic	Submission)	Date 01/09/2	019				
	THIS SPACE FO	R FEDERAL OR STATE	OFFICE USE				
Approved By James	a. an	Title S.	PET		1.24-19 Date		
Conditions of approval, if any, are attache certify that the applicant holds legal or eq which would entitle the applicant to condi-	uitable title to those rights in the	cubiect leace	0				
Title 18 U.S.C. Section 1001 and Title 43			willfully to make	to any department or a	igency of the United		

Additional data for EC transaction #449928 that would not fit on the form

32. Additional remarks, continued

7. M&P 50sx cmt @ 1250-1135' WOC-Tag 8. M&P 105sx cmt @ 250' to surface 10# MLF between plugs - Above ground steel tanks will be utilized

*WBD's have been attached, but for some reason thay are not pulling the information and have tried saving and attaching several times. Please contact me for a copy of WBD. I appreciate the help.

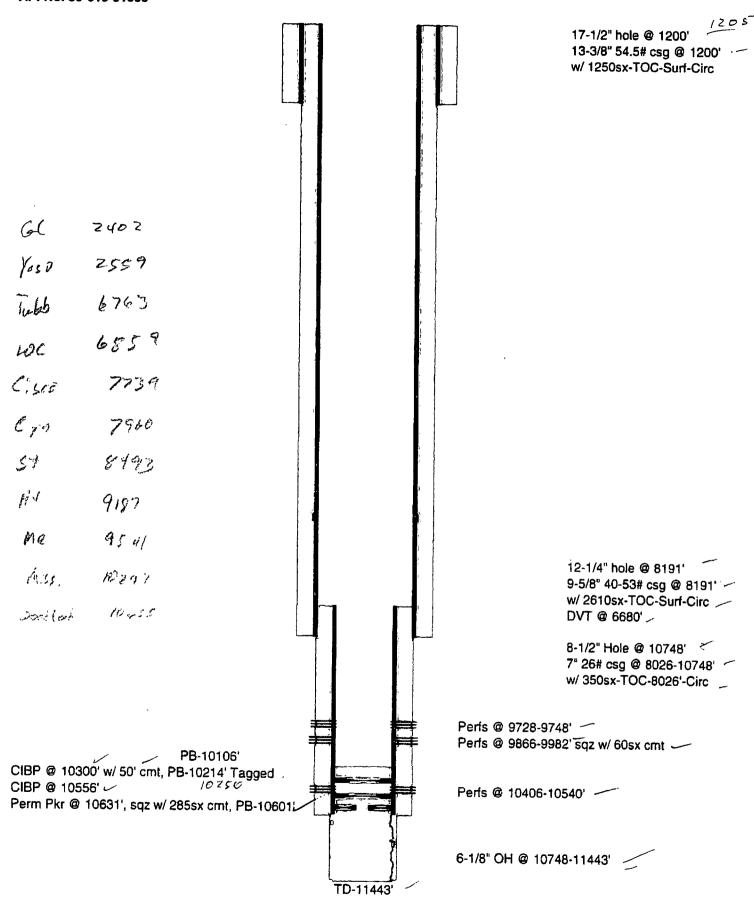

OXY-USA WTP LP - Proposed Indian Hills Unit #30 API No. 30-015-31655

105sx @ 250'-Surface

50sx @ 1250-1135' WOC-Tag

55sx @ 2412-2284' WOC-Tag

60sx @ 3715-3575' WOC-Tag


65sx @ 6112-5952' WOC-Tag

70sx @ 6730-6560' WOC-Tag

70sx @ 8241-7976' WOC-Tag

CIBP @ 9678' w/ 45sx to 9478'

PB-10106'
CIBP @ 10300' w/ 50' cmt, PB-10214' Tagged
CIBP @ 10556'
Perm Pkr @ 10631', sqz w/ 285sx cmt, PB-10601'

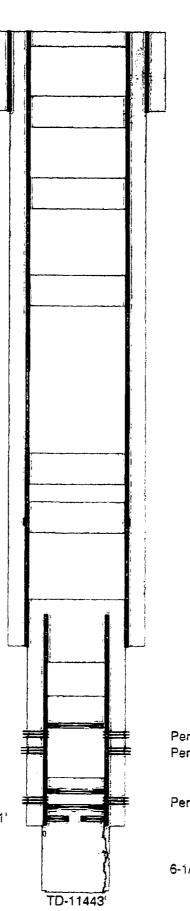

17-1/2" hole @ 1200' 13-3/8" 54.5# csg @ 1200' w/ 1250sx-TOC-Surf-Circ

12-1/4" hole @ 8191' 9-5/8" 40-43.5# csg @ 8191' w/ 2610sx-TOC-Surf-Circ DVT @ 6680'

8-1/2" Hole @ 10748' 7" 26# csg @ 8026-10748' w/ 350sx-TOC-8026'-Circ

Perfs @ 9728-9748' Perfs @ 9866-9982' sqz w/ 60sx cmt

Perfs @ 10406-10540'

6-1/8" OH @ 10748-11443'

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.