Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

	Expires: January 3
5.	Lease Serial No.
	NMLC069627A

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.


6. If Indian, Allottee or Tribe Name

apandoned wei								
SUBMIT IN 1	7. If Unit or CA/Agreement, Name and/or No. NMNM71016G							
1. Type of Well Oil Well Gas Well Oth	8. Well Name and No. POKER LAKE UNIT 235							
Name of Operator BOPCO LP		9. API Well No. 30-015-34309						
3a. Address 6401 HOLIDAY HILL RD BLD MIDLAND, TX 79707	(install Office Co	ONSERVI IA DISTRIC	TO RESH DRAW;D	exploratory Area EL/BS (AV SND)				
4. Location of Well (Footage, Sec., T.	, R., M., or Survey Description	0.0.0040	11. County or Parish, S	State				
Sec 30 T24S R30E Mer NMP	08 2019	EDDY COUNTY	, NM					
RECEIVED 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA								
TYPE OF SUBMISSION	TYPE OF ACTION							
S Notice of Intent	☐ Acidize	☐ Dee	oen	☐ Producti	on (Start/Resume)	☐ Water Shut-Off		
☑ Notice of Intent	☐ Alter Casing	🗖 Hyd	raulic Fracturing	□ Reclama	tion	■ Well Integrity		
☐ Subsequent Report	□ Casing Repair	☐ New	Construction	☐ Recomp	lete	☐ Other		
☐ Final Abandonment Notice	☐ Change Plans	🛭 Plug	and Abandon	☐ Tempora	rily Abandon			
	Convert to Injection	Plug	Back	☐ Water Disposal				
Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection. BOPCO, LP respectfully submits this sundry notice to plug and abandon the referenced well. 1. MIRU. POOH w/rods and pump. Remove wellhead and install 3K manual BOP. Test. 2. Tag PBTD @ 7412'. Spot 25 sx Class C 7275'-7050'. (T/Bone Spring) wold Tag. 3. RIH w/5-1/2" CIBP to 5500'. Set. Tag to verify setting. Spot 25 sx Class C 5500'-5400'. WOC & 5350 (150' min.) tag. Circulate 9.5# salt gel mud. Test csg to 500 psi. (BS-& Delaware perfs). 4. Spot 25 sx Class C 3400'-3500'. WOC & tag. (T/Delaware). 3476 - 3164 (T/Del & B/Salt) 5. Perf 5-1/2" csg @ 755. Sqz 185 sx Class C 755'-505'. WOC & tag (Csg shoe, T/Salt). Below ground level dry hole marker required.								
14. I hereby certify that the foregoing is true and correct. Electronic Submission #452669 verified by the BLM Well Information System For BOPCO LP, sent to the Carlsbad								
Name (Printed/Typed) TRACIE J	Title REGULATORY COORDINATOR							
Signature (Electronic S		Date 01/31/2019						
THIS SPACE FOR FEDERAL OR STATE OFFICE USE								
Approved By James Ca		Title SP	Z- Date		3-2-19 Date			
Conditions of approval, if any, are attached certify that the applicant holds legal or equ which would entitle the applicant to condu	nitable title to those rights in the ct operations thereon.	Office CFC						
Title 18 LLS.C. Section 1001 and Title 43 States any false, fictitious or fraudulent s				willfully to ma	ke to any department or	agency of the United		

Additional data for EC transaction #452669 that would not fit on the form

- 32. Additional remarks, continued
- 6. Perf 5-1/2" csg @ 60'. Sqz 25 Clss C. Verify cmt to surface.
- 7. Cut off wellhead. Install marker.

BOPCO, LP Poker Lake Unit #235 (30-015-34309) Before & After Wellbore Diagrams

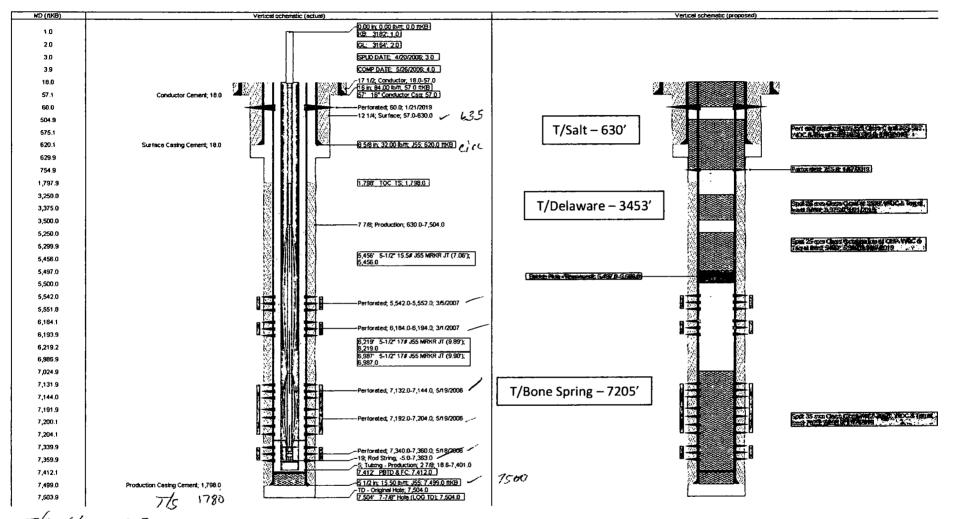

7/92/1 430
1/30/4 32/4
Lamar 3424
Bell 3452
1/20/4 4282
Brushy 5400
B5 7205
Avalor 73/0

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ½ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:

From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted