Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED OMB NO. 1004-0137

Expires: January 31, 2018 5. Lease Serial No. NMNM0542015

7. If Unit or CA/Agreement, Name and/or No.

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE - Other instructions on page 2

6. If Indian, Allottee or Tribe Name

Type of Well ☐ Gas Well ☐ Other					8. Well Name and No. S CULEBRA BLUFF 4	
Name of Operator					9. API Well No. 30-015-26534-00-S1	
3a. Address 6301 DEAUVILLE BLVD MIDLAND, TX 79706	3b. Phone No. (include area code) Ph: 661-599-5062			10. Field and Pool or Exploratory Area E LOVING		
4. Location of Well (Footage, Sec., T			11. County or Parish, State			
Sec 13 T23S R28E NWNW 66			EDDY COUNTY, NM			
12. CHECK THE AI	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE O	F NOTICE	, REPORT, OR OTH	HER DATA
TYPE OF SUBMISSION				,		
☑ Notice of Intent☐ Subsequent Report☐ Final Abandonment Notice	☐ Alter Casing ☐ Casing Repair ☐ Change Plans		pen raulic Fracturing Construction and Abandon Back	□ Reclan	plete orarily Abandon	☐ Water Shut-Off ☐ Well Integrity ☐ Other
If the proposal is to deepen directions Attach the Bond under which the wolf following completion of the involved testing has been completed. Final Attachment that the site is ready for fine Chevron USA respectfully req 1. Notify BLM 24 hours prior to 2. MIRU, pull rods, N/U BOP, 3. Tag existing CIBP @ 6100' 4. Set CIBP @ 4700', circulate minutes. If pressure test pass 5. Spot 25 sx CL C cmt f/ 4700 not WOC & tag. If pressure te 6. Spot 25 sx CL C cmt f/ 3550 7. Spot 45 sx CL C cmt f/ 2680 8. Spot 70 sx CL C cmt f/ 635'	rk will be performed or provide to operations. If the operation responded must be file in all inspection. uests to P&A this well as formal must be file in all inspection. uests to P&A this well as formal must be file in a coordance with pull tubing as spot 25 sx CL C cmt f/ 6 well with fresh water, present well with MLF and well well with MLF and well well with MLF and well with MLF and well well with MLF and well well well well well well well wel	the Bond No. or ults in a multipled only after all follows: n COAs 6100' t/ 5873 essure test case. Sure test in stag, pressure alt)	completion or recrequirements, included Accepted for Accepted for Perfs). WOC & Sasing to 500 psi ep 4 was succepted, & spot ML	A. Required sompletion in a ding reclamati 4/5// record - N & tag for 10 ssful, do	ubsequent reports must be new interval, a Form 316 on, have been completed a mocd. SEE ATTACHE CONDITIONS	filed within 30 days 0-4 must be filed once and the operator has
14. I haraby cartify that the foregoing is	true and correct				Ulausiu	OT II-ARTESIA O.C.D.
14. I hereby certify that the foregoing is true and correct. Electronic Submission #456406 verified by the BLM Well Information System For CHEVRON USA INCORPORATED, sent to the Carlsbad Committed to AFMSS for processing by DEBO RAH MCKINNEY on 03/04/2019 (19DLM0339SE) Name (Printed/Typed) NICK GLANN Title WELL ABANDONMENT ENGINEER						
Signature (Electronic Submission)			Date 03/01/2	2019		
	THIS SPACE FO	R FEDERA	L OR STATE	OFFICE U	JSE	
Approved By	as O. lims		Title SY	ET		3-9-19 Date
Conditions of approval, if any, are attached. Approval of this notice does not warrant o certify that the applicant holds legal or equitable title to those rights in the subject lease which yould entitle the applicant to conduct operations thereon.			Office C	O		
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent s					nake to any department or	agency of the United
(Instructions on page 2)						

· Additional data for EC transaction #456406 that would not fit on the form

32. Additional remarks, continued


Verify cement to surface and RDMO

SCB 13-4

Loving East - 30-015-26534

Eddy County, New Mexico

Updated by YIFL on 1/28/19

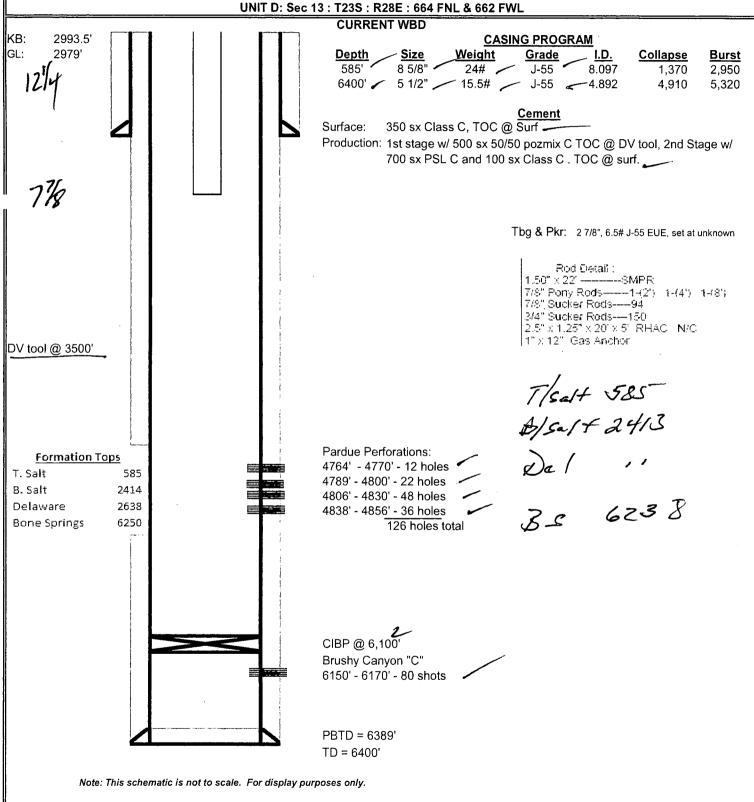


SCB 13-4

Loving East - 30-015-26534

Eddy County, New Mexico

Updated by YIFL on 1/28/19

UNIT D: Sec 13: T23S: R28E: 664 FNL & 662 FWL

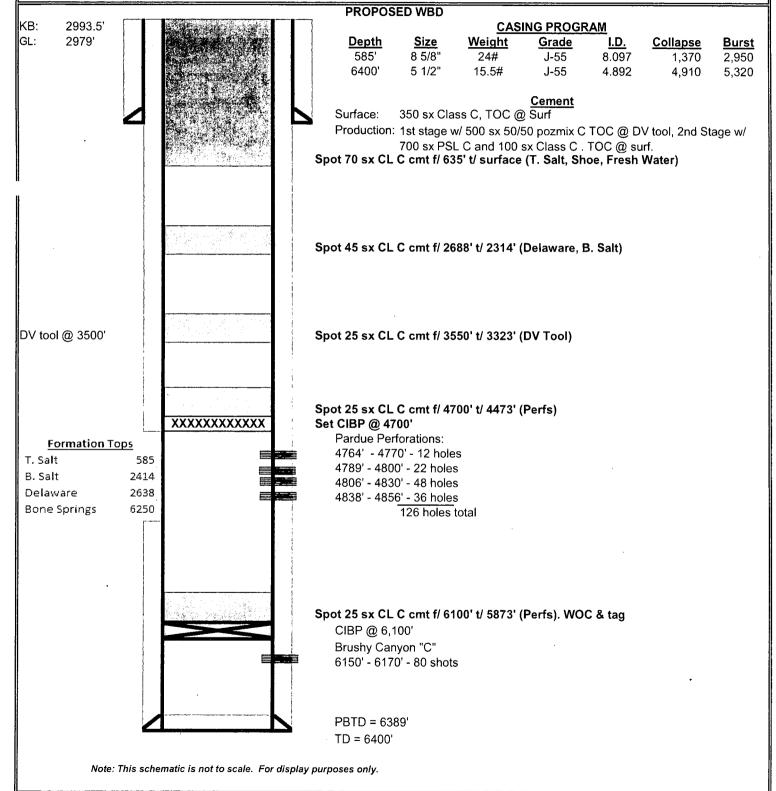

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout-Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:

From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted