

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION

1220 South St. Francis
Santa Fe, NM 87505

Form C-103

Revised July 18, 2013

WELL API NO.	30-015-32351
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	KD 3403-0003 LO 16490005
7. Lease Name or Unit Agreement Name	Carlsbad South 27 State Com
8. Well Number	7
9. OGRID Number	372098
10. Pool name or Wildcat	Carlsbad S Morrow
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	
3320 GR	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☒ Other ☐

2. Name of Operator
Marathon Oil Permian LLC

3. Address of Operator
5555 San Felipe Houston, TX 77056

4. Well Location
Unit Letter F : 1310 feet from the S line and 660 feet from the W line
Section 27 Township 23S Range 26E NMPM County Eddy

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
CLOSED-LOOP SYSTEM <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- class H cement
- woc + Tag
- 1.) 5 1/2 CIBP @ 9300' w/35 sx
 - 2.) 25 sx @ 6300'-6200'
 - 3.) 25 sx @ 3000'-2900'
 - 4.) 50 sx @ 2070'-1970' PS & Tag
 - 5.) 160 sx @ 480'-Surface P.S. Verify

Install D.H.M.

NOV 24 2013
any work done

RECEIVED

JUN 12 2019

DISTRICT II-ARTESIA O.C.D.

Spud Date:

Rig Release Date:

P & A mud between all plugs. Close luo all fluids to licensed facility.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Agent DATE 6/11/19
Type or print name Brody Pinkerton E-mail address: PHONE: 432-458-3780
For State Use Only

APPROVED BY: [Signature] TITLE Staff Mgr DATE 6/12/19
Conditions of Approval (if any):

* See Attached COA's

Must be Plugged by 6/12/20




Wellbore Schematic
Well Name: CARLSBAD SOUTH 27 STATE COM 7

30-015-32351

State/Province NEW MEXICO	Country UNITED STATES	Field Name CARLSBAD SOUTH	Latitude (°) 32.27141700	Longitude (°) -104.28708900	North/South Distance (ft) 1,310.0	North/South Reference FSL
API/PO UWI 3001532351	KB-Ground Distance (ft) 18.00	KB-Mud Line Distance (ft)	Ground Elevation (ft) 3,320.00	Drilling Rig Spud Date 10/7/2002	Well Original Completion Date	Well First Production Date 5/21/2012



CARLSBAD SOUTH 27 STATE COM 7, 6/6/2019 9:32:53 AM

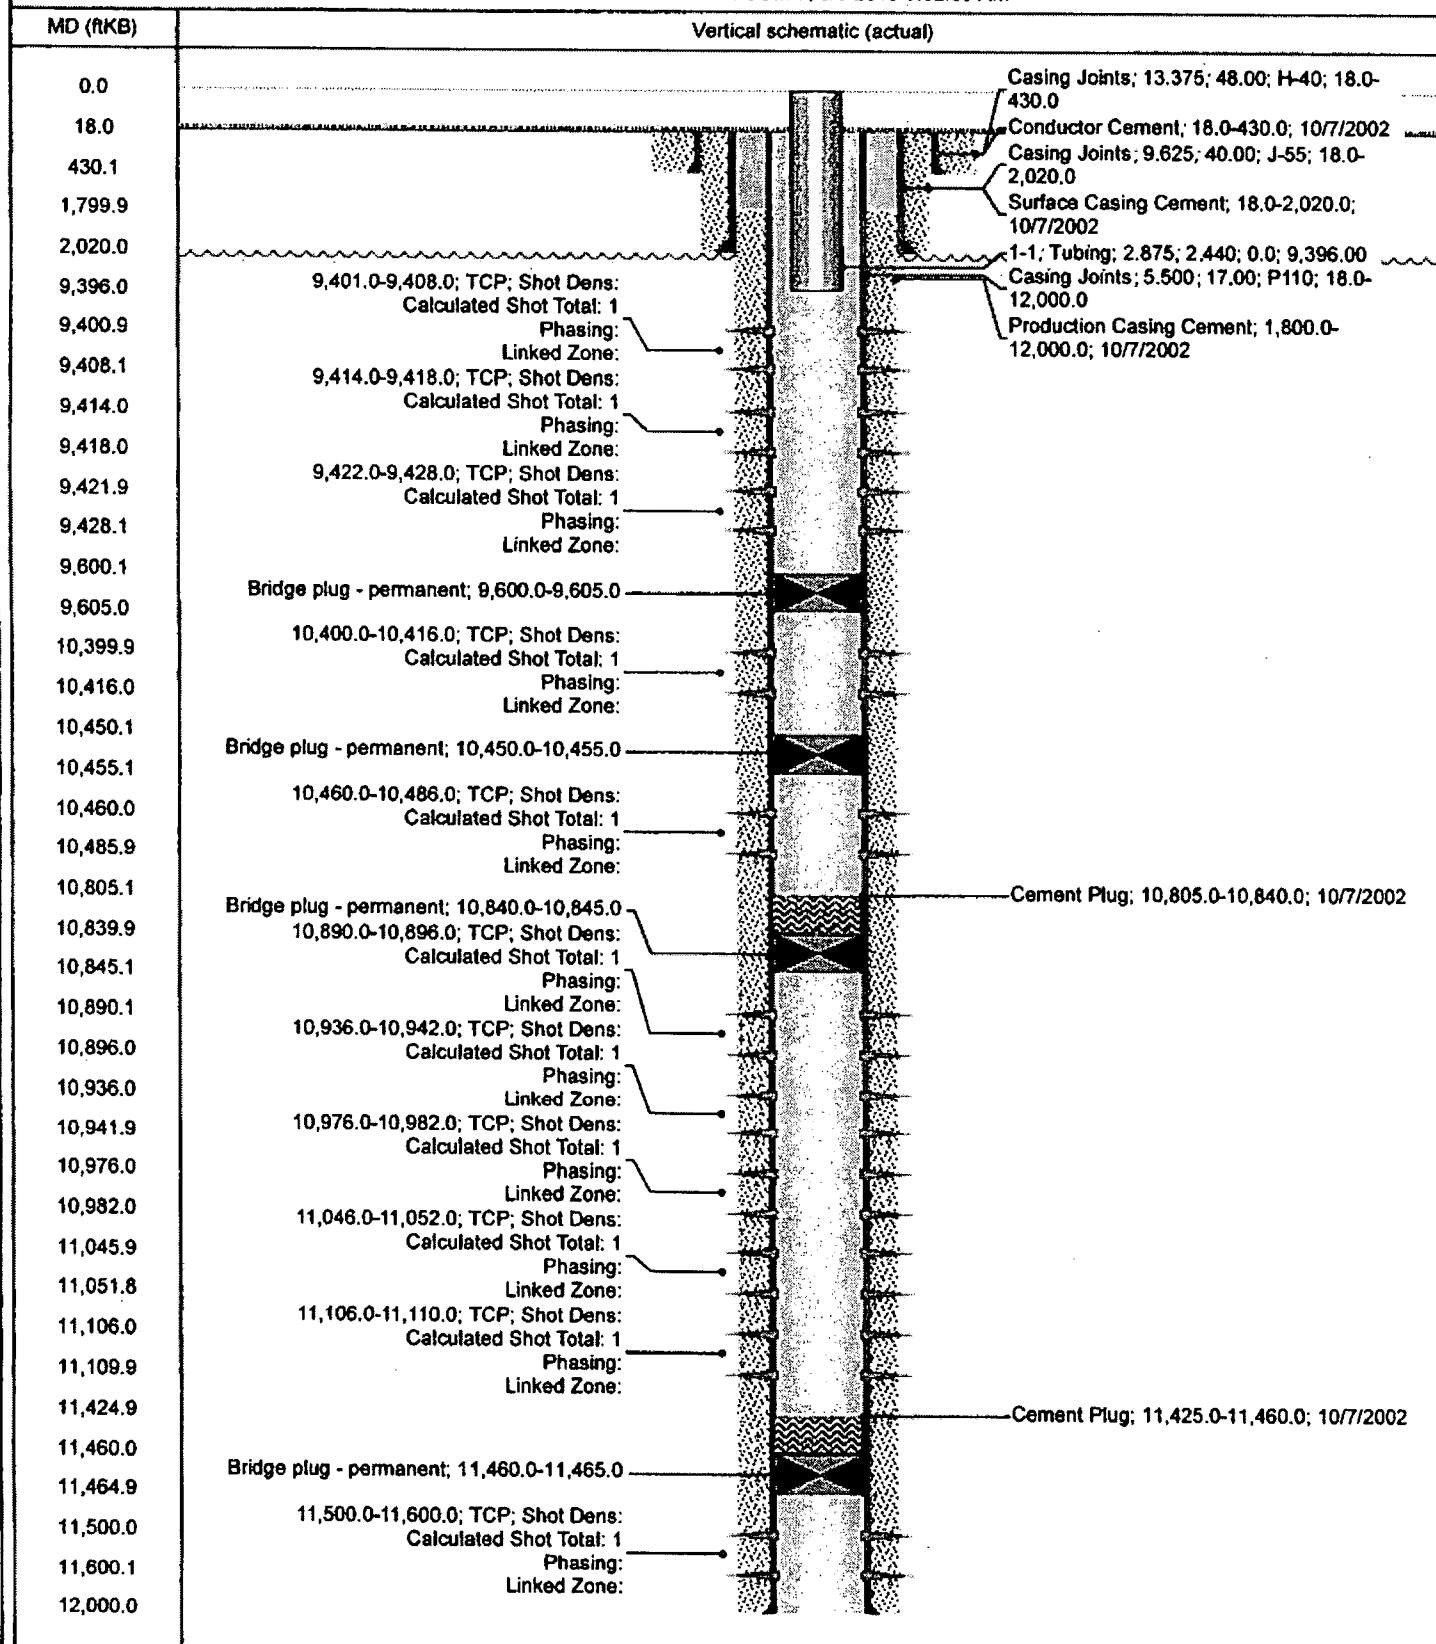

MAVERICK WELL PLUGGERS

COMPANY: MARATHON OIL
 Permian
 WELL NAME: Crystalad South 27
 ST. Com
 WELL #: 1
 COUNTY: Eddy
 LEASE ID: 403403-0003
 LO 1649 0005

SURFACE CASING				
OD	WT/FT	GRADE	SET AT	TOC
13 3/4	48	H-40	430	SURF
INTERMEDIATE CASING				
OD	WT/FT	GRADE	SET AT	TOC
9 5/8	40	J-55	2020	SURF
PRODUCTION CASING				
OD	WT/FT	GRADE	SET AT	TOC
5 1/2	17	P-110	12,000	1800
TUBING				
OD	WT/FT	GRADE	SET AT	TAC

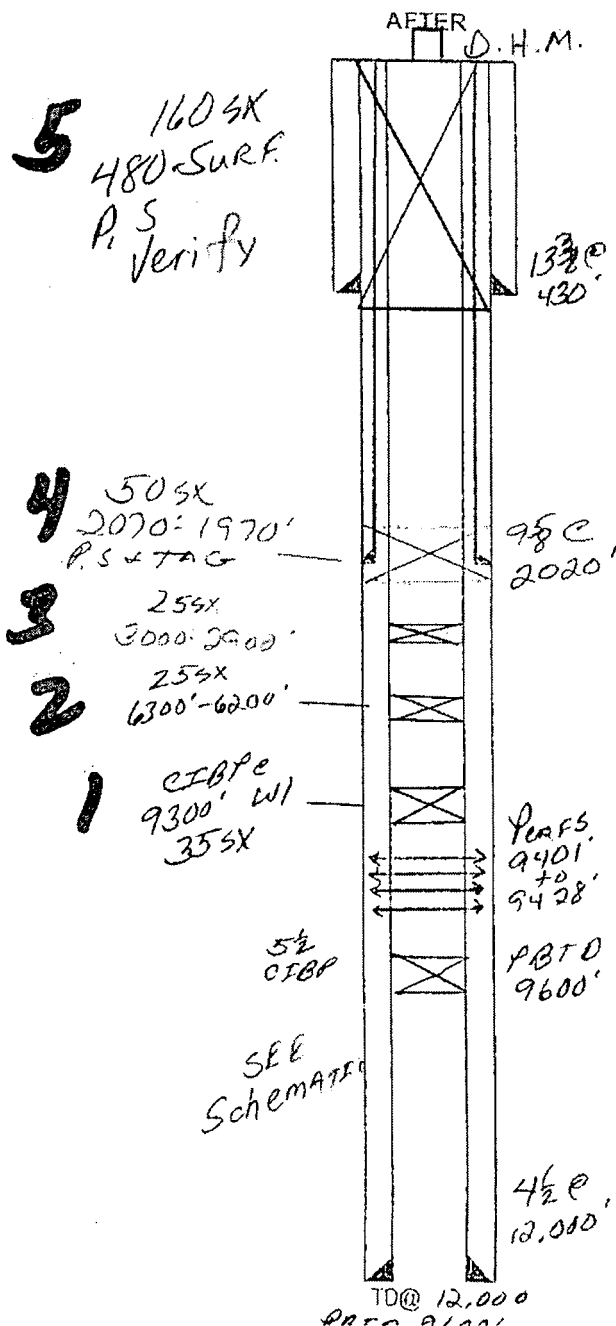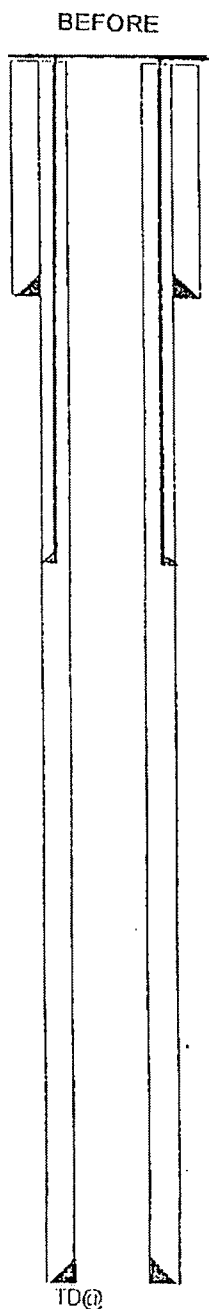

Submit 1 Copy To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
October 13, 2009

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-32351
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator MARATHON OIL Permian LLC		6. State Oil & Gas Lease No. X03403-0003 LD 16490005
3. Address of Operator 5555 San Felipe Houston, TX 77056		7. Lease Name or Unit Agreement Name Carlsbad South 27 STATE COM
4. Well Location Unit Letter F 1310 feet from the S line and 660 feet from the W line Section 27 Township 23S Range 26E NMPM County Eddy		8. Well Number 7
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3320 GR		9. OGRID Number 372098
		10. Pool name or Wildcat Carlsbad S. Morrow

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- ① 5 1/2 CROP @ 9300' w/ 35sx.
 - ② 25sx @ 6300'-6200'
 - ③ 25sx @ 3000'-2900'
 - ④ 50sx 2070'-1970' P.S. & TAG
 - ⑤ 160sx 480'-SURF' P.S. Verify
- Install D.H.M.

RECEIVED

JUN 12 2019

DISTRICT II-ARTESIA O.C.D.

Spud Date:

Rig Release Date:

PLA mud between all Plugs closed loop all fluids to licensed facility

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TITLE

AGENT

DATE

6-11-19

Type or print name **Bridy Penkerton**

E-mail address:

PHONE

432-458-3780

For State Use Only

APPROVED BY:

TITLE

DATE

Conditions of Approval (if any):

CONDITIONS FOR PLUGGING AND ABANDONMENT

District II / Artesia N.M.

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, **Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work.**

1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs.
2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
3. Trucking companies being used to haul oilfield waste fluids to a disposal – commercial or private – shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
6. If the well is not plugged within 1
7. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
8. **Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.**
9. Produced water **will not** be used during any part of the plugging operation.
10. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
11. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
12. **Class 'C' cement will be used above 7500 feet.**
13. **Class 'H' cement will be used below 7500 feet.**
14. **A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged**
15. **All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing**

16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
17. **A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.**
18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, **(WOC 4 hrs and tag).**
19. No more than **3000'** is allowed between cement plugs in cased hole and **2000'** in open hole.
20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E) Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K) **Potash---** (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, **WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.**
21. **If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing**

DRY HOLE MARKER REQUIREMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)-----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)