Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

5. Lease Serial No. NMNM040547

	OTICES AND REPORTS ON WELLS
Do not use this abandoned well.	form for proposals to drill or to re-enter an Use form 3160-3 (APD) for such proposals.

abandoned wei	6	6. If Indian, Allottee or Tribe Name				
SUBMIT IN TRIPLICATE - Other instructions on page 2				7. If Unit or CA/Agreement, Name and/or No. SW550		
1. Type of Well ☐ Oil Well ☑ Gas Well ☐ Other				8. Well Name and No. GULF FEDERAL 1		
Name of Operator Contact: DAVID A EYLER CIMAREX ENERGY COMPANY OF CO-Mail: DEYLER@MILAGRO-RES.COM				9. API Well No. 30-015-20286-00-S1		
3a. Address 600 N MARIENFELD STE 600 MIDLAND, TX 79701	. Phone No. (include area code n: 432-687-3033) 1	10. Field and Pool or Exploratory Area CARLSBAD			
4. Location of Well (Footage, Sec., T.		1	11. County or Parish, State			
Sec 1 T23S R26E NESW 198		EDDY COUNTY, NM				
12. CHECK THE AF	PPROPRIATE BOX(ES) TO	INDICATE NATURE C	OF NOTICE, R	EPORT, OR OT	HER DATA	
TYPE OF SUBMISSION		TYPE OF ACTION				
☑ Notice of Intent	☐ Acidize	□ Deepen	□ Production	n (Start/Resume)	■ Water Shut-Off	
	☐ Alter Casing	☐ Hydraulic Fracturing	☐ Reclamati	on	■ Well Integrity	
☐ Subsequent Report	□ Casing Repair	■ New Construction	□ Recomple	ete	☐ Other	
☐ Final Abandonment Notice	☐ Change Plans	☑ Plug and Abandon	☐ Temporari	ily Abandon		
	☐ Convert to Injection	□ Plug Back	■ Water Dis	sposal	1	
testing has been completed. Final At determined that the site is ready for final form. 1) SET 5-1/2" CIBP @ 11,500 2) PUMP 50 SXS.CMT. @ 10. 3) PUMP 25 SXS.CMT. @ 8,84) PUMP 75 SXS.CMT. @ 7,15) PUMP 60 SXS.CMT. @ 5,36) PERF. X ATTEMPT TO SC 7) PERF. X ATTEMPT TO SC 8) PERF. X ATTEMPT TO SC 9) PERF. X CIRC. TO SURF., 10)DIG OUT X CUT OFF WEICSGS. X INSTALL DRY HOLL DURING THIS PROCEDURE	inal inspection. 7. (*PUMP 40 SXS.CMT. @ 11, 843'-10,468'(T/ATOKA, T/ST) 848'-8,668'(T/WCMP.); WOC. 842'-5,192'(T/BNSG.). 842'-5,192'(T/BNSG.). 842'-5,192'(T/BNSG.). 842'-75 SXS.CMT. @ 2,030'-1, 895'-795 82. 90 SXS.CMT. @ 433'-333 FILLING ALL ANNULI, 75 S. LLHEAD 3' B.G.L.; VERIFY C. E MARKER.	547 ,596'-11,179'(T/MRRW.); WN). X TAG CMT. PLUG. ,5-1/2"LNR.TOP); WOC) 920'(T/DLWR.). '(T/SALT); WOC X TAG ('(16"CSG.SHOE); WOC) XS.CMT. @ 63'-3'. :MT. TO SURF. ON ALL	CIRC SEE A CMT. PLUG. X TAG. ANNULI; WELI	ATTACHE DITIONS (D FOR OF APPROVAL	
14. I hereby certify that the foregoing is	true and correct. Electronic Submission #4690	159 verified by the BLM We	II Information 9	System		
Con Name (Printed/Typed) DAVID A	For CIMAREX ENERGY nmitted to AFMSS for procession	Y COMPANY OF CO, sent	to the Carlsbad on 06/13/2019 (1	ľ	JUN 2.5 2019	
Signature (Electronic S	Date 06/13/2		DISTRI	CTII-ARTESIAO.C.D.		
Digitate (Electronic C		FEDERAL OR STATE		<u> </u>		
		1			1 111 10	
Approved By	Colore	Title SA	<u> </u>		6-14-19 Date	
Conditions of approval, if any, are attached certify that the applicant holds legal or equivalent would entitle the applicant to conductive the conductive the applicant to conduct the applicant to conductive the applicant to c	uitable title to those rights in the subject operations thereon.	ject lease Office CFC				
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent s	U.S.C. Section 1212, make it a crim statements or representations as to an	e for any person knowingly and ny matter within its jurisdiction	d willfully to make	e to any department o	r agency of the United	

Additional data for EC transaction #469059 that would not fit on the form

32. Additional remarks, continued


THE REQUIRED DISPOSAL, PER OCD RULE 19.15.17.

		O
CIMAREX	KB - 21' above GL	Cimarex Energy Co. of Colorado Gulf Federal #1 1980' FSL & 1980' FWL
開始 452		Sec. 1, T-23-S, R-26-E, Eddy Co., NM
		S. Gengler 30 - 015 - 20286 05/18/2009
		20" hole
	16	3", 75# H-40 csg @ 383'
		cmtd w/ 450 sx, cmt circ
45		200001 70 +/-
		2000' by TS
		z'hi" hole
M. Agents and Agents a Agents and Agents and		Zlki no le
		07041 T (II)
4		0 6704'. Top of liner sqzd w/ 100 sx
	5-1/2"	TOC @ 6730' by TS
है। इस	9-5/8".	40 & 43.5# N-80 & P-110 csg @ 7100'
_		atd w/ 1650 sx
	→ 354 jts	2 3/8" 4.7# N-80 Hydrii Tbg
	- 1781 1871	,
		81/2" hole
		312 121
	Baker Mo	del R pkr @ 11426'
	Baker Mo	f tailpipe @ 11553'
	<u> </u>	erfs (11647' - 11866')
	Morrow p	erfs (11647' - 11866')
	PBTD @	12030'
	5-1/2" 17	& 20# N-80 @ 12074' cmtd w/ 1350 sx
	TD @ 12	0/0

Printed 6/6/2019

CIMAREX

T/SALT - 845' T/DLWR. - 1,970' T/BNS6 - 5,267' T/WCMP. - 8,758' T/STWN. - 10,518' T/ATOKA - 10,793' T/MPRW. - 11,229'

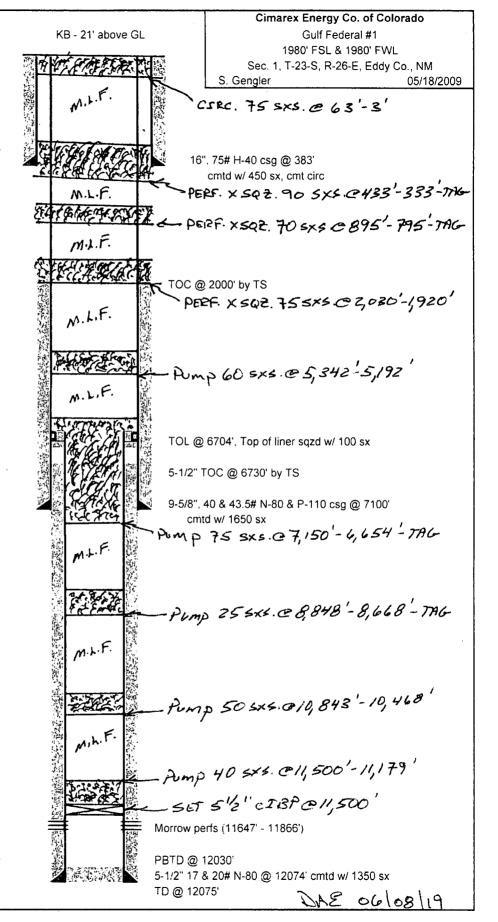

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 38220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>minety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.