Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

5. Lease Serial No. NMNM05608

SUNDRY NOTICES AND REPORTS ON WELLS 25 2019 Do not use this form for proposals to drill or to re-enter an 2 5 2019			019	NMNM05608		
abandoned wei	ll. Use form 3160-3 (AP)	D) for such proposals.	0	. If Indian, Allottee	or Tribe Name	
SUBMIT IN	140.0.D. 7	7. If Unit or CA/Agreement, Name and/or No. SW280				
1. Type of Well Gas Well Oth		en e		. Well Name and No N INDIAN BASIN		
Name of Operator OXY USA WTP LIMITED PTN	Contact:	DAVID STEWART vart@oxy.com	. 9	9. API Well No. 30-015-29305-00-\$1		
3a. Address HOUSTON, TX 77210		3b. Phone No. (include area code) Ph: 432-685-5717	1	0. Field and Pool or INDIAN BASIN		
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)			1	11. County or Parish, State		
Sec 15 T21S R23E SENW 1750FNL 1650FWL				EDDY COUNTY, NM		
12. CHECK THE AI	PPROPRIATE BOX(ES)	TO INDICATE NATURE O	F NOTICE, R	EPORT, OR OT	HER DATA	
TYPE OF SUBMISSION		. TYPE OI	FACTION			
Notice of Intent ■ Notice of Intent Notice of Inten	☐ Acidize	☐ Deepen		n (Start/Resume)	□ Water Shut-Off	
☐ Subsequent Report	☐ Alter Casing ☐ Casing Repair	☐ Hydraulic Fracturing ☐ New Construction	☐ Reclamati		☐ Well Integrity☐ Other	
☐ Final Abandonment Notice	☐ Change Plans	□ Plug and Abandon	☐ Temporar			
•	☐ Convert to Injection	□ Plug Back	☐ Water Dis	posal		
13. Describe Proposed or Completed Op. If the proposal is to deepen direction: Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f TD-9440' PBTD-*8052' Per *Fish @ 7586' & 7325' ? Csg 9-5/8" 36# csg @ 1212' w/ 52: 7" 23-26# csg @ 8140', DVT 6 1. M&P 100sx cmt @ 6810' V 2. RIH & set CIBP @ 6760' w 3. M&P 35sx cmt @ 6379-62 4. M&P 35sx cmt @ 6080-59. 5. M&P 30sx cmt @ 3545-34 6. M&P 30sx @ 2055-1935' V	ally or recomplete horizontally, rk will be performed or provide to operations. If the operation re bandoment Notices must be fil inal inspection. fs-7490-7684' Parted @ 6810' 5sx, 12-1/4" hole, TOC-S 6329' w/ 1300sx, 8-3/4" h VOC-Tag VOC-Tag 14' WOC-Tag 20' WOC-Tag 10' WOC-Tag	give subsurface locations and measu the Bond No. on file with BLM/BIA sults in a multiple completion or reco	red and true vertice. Required subsection in a new ling reclamation, I of Alack Alac	cal depths of all perticuent reports must be vinterval, a Form 31 have been completed a CSG. Far Tag. Tag. TTACHED I	inent markers and zones. e filed within 30 days 60-4 must be filed once and the operator has f. Est Rate 125% Vol to	

14. Thereby certify that the	For OXY USA WT	57414 verified by the BLM Well In LIMITED PTNRSHIP, sent to the ssing by PRISCILLA PEREZ on 06	e Carlsbad É	
Name (Printed/Typed)	DAVID STEWART	Title SR. REGU	JLATORY ADVISOR	. ,
Signature	(Electronic Submission)	Date 06/04/2019	9	
	THIS SPACE FO	R FEDERAL OR STATE OF	FICE USE	
		21	17 6	8-10

amos L. _ Conz Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. Title

Date

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Office

Additional data for EC transaction #467414 that would not fit on the form

32. Additional remarks, continued

7. M&P 25sx @ 1262-1145' WOC-Tag 8. M&P 45sx cmt @ 300' to surface 10# MLF between plugs ? Above ground steel tanks will be utilized

OXY USA WTP LP - Proposed North Indian Basin Unit Gas Com #32 'API No. 30-015-29305

65sx @ 300'-Surface

25sx @ 1262-1145' WOC-Tag

30sx @ 2055-1935' WOC-Tag

30sx @ 3545-3410' WOC-Tag

35sx @ 6080-5920' WOC-Tag


35sx @ 6379-6214' WOC-Tag

CIBP @ +/-6760', M&P 25sx to 6660' 100sx @ 6810' WOC-Tag

> 9/19 TOF @ 7325' 7jt tbg 8/13 TOF @ 7586' 11jt tbg-TAC

> > PB-8052' Cmt Plug @ 8150-8264'•

Cmt Plug @ 8840-8956'

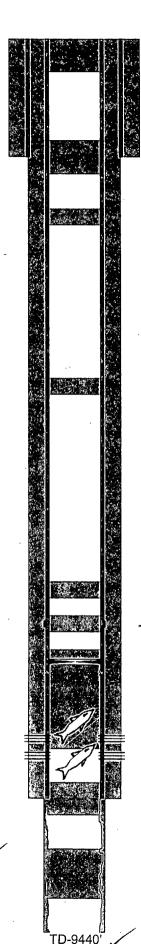

12-1/4" hole @ 1212' / 9-5/8" csg @ 1212' __ w/ 525sx-TOC-Surf-Circ 1" from 380

8-3/4" hole @ 9440' 7" csg @ 8140' w/ 1300sx-TOC-Surf-Circ DVT @ 6329',

5/19 Csg part @ 6810'

Perfs @ 7490-7538' 3/28/00 Perfs @ 7642-7684'

OH @ 8140-9440'

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat. Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.