Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED
OMB NO. 1004-0137
Expires: January 31, 2018
5. Lease Serial No. NMLC028731B

SUNDR	RY NOTICES	S AND RE	PORTS	ON WELLS	
Do not use	this form for	r proposals	to drill	or to re-enter	aı


Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					6. If Indian, Allottee or Tribe Name			
SUBMIT IN TRIPLICATE - Other instructions on page 2					7. If Unit or CA/Agree	ement, N	aine and/or No.	
1. Type of Well ☑ Oil Well ☐ Gas Well ☐ Other					8. Well Name and No. M DODD B DEEP FEDERAL 2			
Name of Operator Contact: ABIGAIL ANDERSON COG OPERATING LLC E-Mail: abbym@bcmandassociates.com					9. API Well No. 30-015-31041-00-S1			
3a. Address 600 W ILLINOIS AVENUE MIDLAND, TX 79701	(include area code 0-7161)	10. Field and Pool or Exploratory Area GRAYBURG					
4. Location of Well (Footage, Sec., T.	, R., M., or Survey Description)				11. County or Parish,	State	········	
Sec 14 T17S R29E SENE 198		EDDY COUNTY, NM						
12. CHECK THE AF	PROPRIATE BOX(ES) TO) INDICAT	E NATURE C	F NOTICE,	REPORT, OR OTH	IER D	ATA	
TYPE OF SUBMISSION	TYPE OF ACTION							
Notice of Intent ■	☐ Acidize	Deep	en	☐ Product	tion (Start/Resume)	o W	ater Shut-Off	
	☐ Alter Casing	☐ Hydraulic Fracturing ☐ F		□ Reclam	Reclamation		ell Integrity	
☐ Subsequent Report	□ Casing Repair	□ New	Construction	□ Recomp	olete		ther	
☐ Final Abandonment Notice	☐ Change Plans	🛛 Plug	and Abandon	□ Tempor	rarily Abandon			
	☐ Convert to Injection	Plug	Back	□ Water I	Disposal			
testing has been completed. Final Abdetermined that the site is ready for final Abdetermined that the site is read	nal inspection. 9400'. irculate hole w/ MLF. Pressu 00'. (spacer plug) 6230 - 82-4482'. WOC & Tag (9 5/8 00-9250'. Z781 - 265 00-990'. WOC & Tag (B/Salt	ure test csg - 1970 "Shoe) باد دار ساود	. Spot 25 sx cn (Abo) 132. Add Tog (3A)	ont @ 8965-8 Add , 1 41-44,	•	-/cise -/cise -/cs -/cs -/cs -/cs -/cs -/cs -/cs -/cs	(wc)	
14. I hereby certify that the foregoing is								
•	Electronic Submission #468 For COG OPE	RATING LL	C, sent to the C	arlsbad	_	иIN	2 5 2019	
	itted to AFMSS for processing ANDERSON	DEBOR	AH MCKINNEY Title AGEN		9 (19DLM0529SE)			
Name (Trimed/Typed) ABIGAIL F	INDERSON		THE AGEN	!	700	alCTT	-AFTESIAO.C.C	
Signature (Electronic S	Submission)	,	Date 06/12/2019					
	THIS SPACE FOR	FEDERA	OR STATE	OFFICE U	SE			
Approved By James	ex a. amos		Title S	AET			<i>6-16-19</i> Date	
Conditions of approval, if any, are attached certify that the applicant holds legal or equivalent would entitle the applicant to condu	uitable title to those rights in the sul act operations thereon.	bject lease	Office CF					
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent s					ake to any department or	agency	of the United	

COG Operating, LLC

Lease & Well # M Dodd B Deep Federal #2

API # 30-015-31041

Lat/Long: 32.8364449,-104.041069

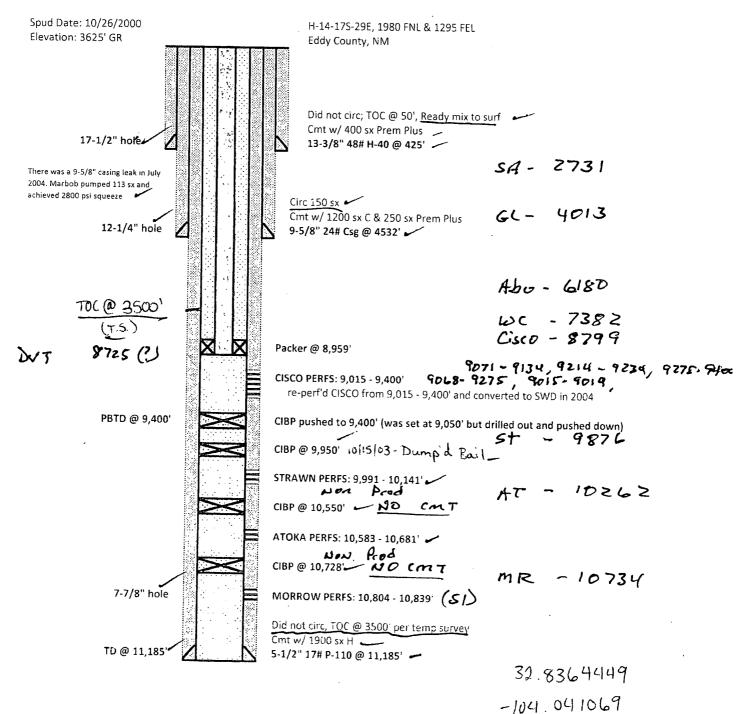


COG Operating, LLC

Lease & Well # M Dodd B Deep Federal #2

API# 30-015-31041

Lat/Long: 32.8364449,-104.041069

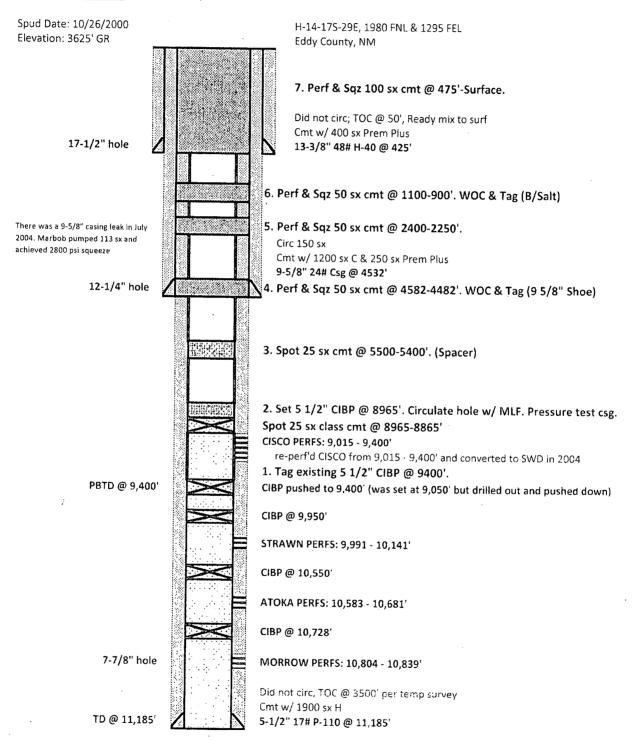

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>minety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. Show date well was plugged.
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.