Form 3160-5 (June 2015)

1. Type of Well

3a. Address

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

Lease Serial No

NMNM108025

SUNDRY NUTICES AND REPORTS ON WELLS	
Do not use this form for proposals to drill or to re-enter an ETESIAO.CD	۸
abandonad wall the fame according to a SIGNAR POINT I WAR I SIALOW	٥,

6. If Indian, Allottee or Tribe Name abandoned well. Use form 3160-3 (APD) for នយុះស្នេចទៅទៀ 7. If Unit or CA/Agreement, Name and/or No. SUBMIT IN TRIPLICATE - Other instructions on page 2 8. Well Name and No. DRY LAND SWD 1 ☐ Oil Well ☐ Gas Well 🗷 Other: **UNKNOWN OTH** Name of Operator
 COG OPERATING LLC Contact: ABIGAIL ANDERSON API Well No. E-Mail: abbym@bcmandassociates.com 30-015-33458-00-S1 10. Field and Pool or Exploratory Area 3b. Phone No. (include area code) 600 W ILLINOIS AVENUE Ph: 432-580-7161 PERMO PENN MIDLAND, TX 79701 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 11. County or Parish, State Sec 3 T21S R25E NESE 2852FSL 377FEL EDDY COUNTY, NM

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE REPORT OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION				
☑ Notice of Intent ☐ Subsequent Report ☐ Final Abandonment Notice	☐ Acidize ☐ Alter Casing ☐ Casing Repair ☐ Change Plans ☐ Convert to Injection	□ Deepen□ Hydraulic Fracturing□ New Construction☑ Plug and Abandon□ Plug Back	☐ Production (Start/Resume) ☐ Reclamation ☐ Recomplete ☐ Temporarily Abandon ☐ Water Disposal	☐ Water Shut-Off ☐ Well Integrity ☐ Other	

- 13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.
 - Set 5 1/2" CIBP @ 8350'. Circulate hole w/ MLF. Pressure test csg. Spot 25 sx cmt @ 8350-8250'.

7650

4. Spot 25 sx cmt @ 2850-2700"

5. Spot 25 sx cmt @ 1504-1404'. WOC & Tag (8 5/8" Shoe)

6. Spot 40 sx cmt @ 374-Surface.

Cut off well head, verify cmt to surface, weld on Dry Hole Marker.


SEE ATTACHED FOR CONDITIONS OF APPROVAL

14. I hereby certify that the	ne foregoing is true and correct. Electronic Submission #467396 verifie For COG OPERATING LI Committed to AFMSS for processing by DEBO	C, sen	t to the Carlsbad	
Name (Printed/Typed)	ABIGAIL ANDERSON	Title	AGENT	
Signature	(Electronic Submission)	Date	06/03/2019	
	THIS SPACE FOR FEDERA	L OR	STATE OFFICE USE	
Approved By	mallema	Title	SHET	6-8-19 Date
certify that the applicant hol	ny, are attached. Approval of this notice does not warrant or ds legal or equitable title to those rights in the subject lease licant to conduct operations thereon.	Office	CO	
Title 18 U.S.C. Section 1001	and Title 43 U.S.C. Section 1212, make it a crime for any pe	erson kno	wingly and willfully to make to any department or ag	ency of the United

· Well: DryLand SWO N 1 Lucation 2352 F9L, 377 F=1 P-3-215-250 Casing Program: Eday NM (SWD Order - 927) LIC 7506 8875 13%'C324'-400 "C" (cire 83) -8352 TK-199 27/8" 6,5 55 8350 t EVE : 124" 85/2" e 1454! -525 HLC + 250"C" (Eire 250) SA 99 D 1762 Del 35 2822 7600 Cisco-Cyn 8184 DV7506 / (Michel Plaked Phr ± 8350' 8353 Versa-Set PLT (Halliburton) 30-015-33458 T 8400 1 13 (-1) Upper Pan (ComoCape) 32.5098343 -104.3755264 8828 15/2 8875 121 250 Super H (circ 30) -750 Interfil C + 100 Str H (circ 10) A Higher

COG Sp	erating, LLC		
Author:	BCM & Associates, INC		
Well Name	Dry Land SWD	Well No.	#1
Field	SWD; Permo Penn	API#:	30-015-33458
County	Eddy	Pгор #:	
State	New Mexico	Zone:	P-3-21S-25E
Spud Date	7/16/2004	_	2852'FSL 377'FEL
GL	3272'		

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	тос
Surface Csg	13 3/8	J55	54.5	324	17 1/2	400	Circ'd
Inter Csg	8 5/8	J55	24	1,454	12 1/4	775	Circ'd
Prod Csg	5 1/2	J55/L80	17	8,875	7 7/8	1,100	Circ'd

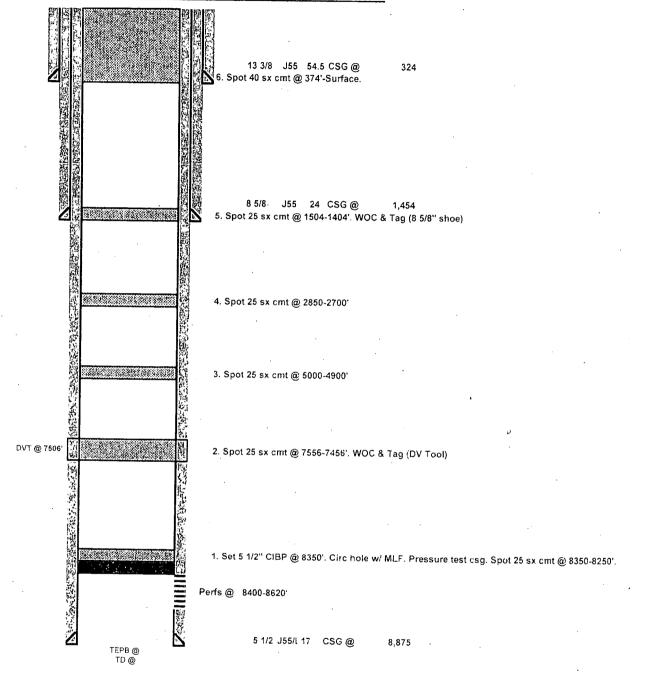

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.