Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR

FORM APPROVED OMB NO. 1004-0137

Expires: January 31, 2018 5. Lease Serial No.

SUNDRY NOTICES AND REPORTS ON WELLSJUN 2.5 2019

Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such assets.

ACCIT-6 If Indian. Allottee or Tribe Name

NMNM93477

abandoned wel	I. Use form 3160-3 (APD) for	r such proposals	SIAO. O. 11 Indian, Another	or Trioc Name
SUBMIT IN T		eement, Name and/or No.		
1. Type of Well		8. Well Name and No. RIVERBEND 23 FEDERAL 16Q		
2. Name of Operator Contact: DAVID STEWART OXY USA INC E-Mail: david stewart@oxy.com			9. API Well No.	
OXY USA INC		30-015-33598		
3a. Address P.O. BOX 50250 MIDLAND, TX 79710	Phone No. (include area code) 432-685-5717		10. Field and Pool or Exploratory Area CEDAR CANYON DELAWARE	
4. Location of Well (Footage, Sec., T		11. County or Parish,	11. County or Parish, State	
Sec 23 T24S R29E NWSE 1830FSL 1980FEL 32.200764 N Lat, 103.953079 W Lon			EDDY COUNT	Y, NM .
12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA				
TYPE OF SUBMISSION	TYPE OF ACTION			
Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	☐ Water Shut-Off
_	☐ Alter Casing	☐ Hydraulic Fracturing	☐ Reclamation	■ Well Integrity
☐ Subsequent Report	□ Casing Repair	■ New Construction	☐ Recomplete	☐ Other
☐ Final Abandonment Notice	☐ Change Plans	Plug and Abandon	☐ Temporarily Abandon	
	□ Convert to Injection	☐ Plug Back	□ Water Disposal	:
If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection. TD-8320' PBTD-7150' Perfs-5440-6735' CIBP-7150' 13-3/8" 48# csg @ 612' w/ 800sx, 17-1/2" hole, TOC-Surf-Circ-1"				
8-5/8" 32# csg @ 3060' w/ 1430sx, 11" hole, TOC-Surf-Circ 5-1/2" 15.5-17# csg @ 8320', DVT 5534' w/ 1690sx, 7-7/8" hole, TOC-1530'-CBL 1. RIH & tag Cmt/CIBP @ 7150', M&P 35sx cmt to-6875' 623 2 2. RIH & set CIBP @ 5390' w/ 25sx cmt to 5230' 3. M&P 30sx cmt @ 3205-2990' WOC-Tag 4. Perf @ 1410', sqz 85sx cmt to 1110' WOC-Tag 5. Perf @ 662', sqz 185sx cmt to surface 10# MLF between plugs ? Above ground steel tanks will be utilized				
14. I hereby certify that the foregoing is true and correct. Electronic Submission #468839 verified by the BLM Well Information System For OXY USA INC, sent to the Carlsbad Committed to AFMSS for processing by Name(Printed/Typed) DAVID STEWART Title SR. REGULATORY ADVISOR				
Signature (Electronic S	Date 06/12/20)19		
THIS SPACE FOR FEDERAL OR STATE OFFICE USE				
Approved By Jesusa C	a. amo	Title SP67		G-16-19 Date
Conditions of approval, if any, are attache certify that the applicant holds legal or eq which would entitle the applicant to condi-	varrant or ect lease Office			

itle 8 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

OXY USA Inc. - Current Riverbend 23 Federal #16Q API No. 30-015-33598

> 17-1/2" hole @ 612' 13-3/8" csg @ 612'/ w/800sx-TOC-Surf-Circ-1" T/selt 850 Est TOC 1530 Anhy 2985 11" hole @ 3060' -8-5/8" csg @ 3060'> Black w/ 1430sx-TOC-Surf-Circ / Del 3155 3ell 3182 charge 4034 Perfs @ 5440-5450' DVT 5534 (S1) Perfs @ 6707-6735' SZ/(Z1 stset Bone Spring 6882 Perfs @ 7227-7323 ND set (DHC) 7-7/8" hole @ 8320' 5-1/2" csg @ 8320' w/ 1690sx-TOC-1530'-CBL کی هدم ح DVT @ 5534' To 1531 (52) Perfs @ 7918-8066

8/08-CIBP @ 7150'

8/04-CIBP @ 7850'

PB-8192ⁱ

OXY USA Inc. - Proposed Riverbend 23 Federal #16Q API No. 30-015-33598

185sx @ 662'-Surface

85sx @ 1410-1110' WOC-Tag


30sx @ 3205-2990' WOC-Tag

CIBP @ 5390' w/ 25sx to 5230'

35sx @ 7150-6875' 8/08-CIBP @ 7150'

8/04-CIBP @ 7850'

PB-8192'

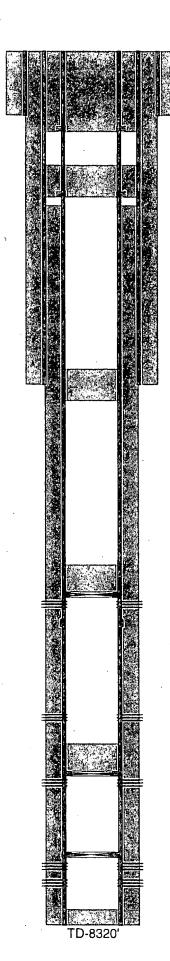

17-1/2" hole @ 612' 13-3/8" csg @ 612' w/ 800sx-TOC-Surf-Circ-1"

Perf @ 662'

Perf @ 1410'

11" hole @ 3060' 8-5/8" csg @ 3060' w/ 1430sx-TOC-Surf-Circ

Perfs @ 5440-5450'

Perfs @ 6707-6735'

Perfs @ 7227-7323'

7-7/8" hole @ 8320' 5-1/2" csg @ 8320' w/ 1690sx-TOC-1530'-CBL DVT @ 5534'

Perfs @ 7918-8066'

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>minety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged</u>.

officer such as metes and bounds).

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.