Form 3160-5 (June 20 its)

UNITED STATES

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

UNITED STATES

DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT IS OF THE INTERIOR
SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-offer an abandoned well. Use form 3160-3 (APD) for such proposals. A FIRST and abandoned well.

5. Lease Serial No. NMLC068545

6.41 Indian, Allottee or Tribe Name	

SUBMIT IN TRIPLICATE - Other instructions on p				
SOBMIT IN TRIFLICATE - Other instructions on j	page 2	7.	7. If Unit or CA/Agreement, Name and/or No. 891000303F	
I. Type of Well ☐ Gas Well ☐ Other			8. Well Name and No. POKER LAKE UNIT 204	
2. Name of Operator Contact: TRACIE J CH XTO PERMIAN OPERATING LLC E-Mail: tracie_cherry@xtoenergy.			9. API Well No. 30-015-32928-00-S1	
3a. Address 3b. Phone No. 6401 HOLIDAY HILL ROAD BLDG 5 Ph: 432-22 MIDLAND, TX 79707 Ph: 432-22	(include area code) 1-7379		10. Field and Pool or Exploratory Area NASH DRAW-DELAWARE	
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)		11.	County or Parish, Stat	e
Sec 7 T24S R30E SESW 660FSL 1980FWL			EDDY COUNTY, N	IM
12. CHECK THE APPROPRIATE BOX(ES) TO INDICA	ΓΕ NATURE OF	NOTICE, RE	PORT, OR OTHE	R DATA
TYPE OF SUBMISSION	TYPE OF	ACTION		
Acidize Deep	oen ,	☐ Production (Start/Resume)	☐ Water Shut-Off
☑ Notice of Intent ☐ Alter Casing ☐ Hyd	raulic Fracturing	Reclamation	. (☐ Well Integrity
☐ Subsequent Report . ☐ Casing Repair. ☐ New	Construction	☐ Recomplete	(Other
☐ Final Abandonment Notice ☐ Change Plans ☐ Plug	and Abandon	▼ Temporarily	Abandon	
Convert to Injection Plug		☐ Water Dispo	sal ·	
XTO Permian Operating, LLC respectfully requests approval to temp wellbore with a bridge plug and cement.XTO is evaluating this well for possible recompletion to the Brushy C	oraniy abandon t	vill be	eperd for record	MMOC
properly secured while considering recompletion options or final abar 1. MIRU workover unit. POOH with pump and rods. Remove wellhea	ndonment.		HNM OIL CON	SERVATION
properly secured while considering recompletion options or final abar	ndonment. id, install 3K BOF		H <mark>NM OIL CON</mark> ARTESIA [SERVATION DISTRICT
properly secured while considering recompletion options or final abar 1. MIRU workover unit. POOH with pump and rods. Remove wellhea w/2-7/8" tubing. 2. RIH w/10K CIBP for 5-1/2" 15.5# casing. Set CIBP at 6970'. Tag to	ndonment. id, install 3K BOF		HNM OIL CON	SERVATION DISTRICT
properly secured while considering recompletion options or final abar 1. MIRU workover unit. POOH with pump and rods. Remove wellhea w/2-7/8" tubing.	ndonment. id, install 3K BOF		H <mark>NM OIL CON</mark> ARTESIA [SERVATION DISTRICT 1 2019
properly secured while considering recompletion options or final abar 1. MIRU workover unit. POOH with pump and rods. Remove wellhea w/2-7/8" tubing. 2. RIH w/10K CIBP for 5-1/2" 15.5# casing. Set CIBP at 6970'. Tag to	ndonment. Id, install 3K BOF o verify setting. Id by the BLM Well IG LLC, sent to the	and test. POO	HNM OIL CON ARTESIA (AUG 2 RECEI	SERVATION DISTRICT 1 2019
properly secured while considering recompletion options or final abar 1. MIRU workover unit. POOH with pump and rods. Remove wellhea w/2-7/8" tubing. 2. RIH w/10K CIBP for 5-1/2" 15.5# casing. Set CIBP at 6970'. Tag to 3. Spot 25 sxs Class C on top of CIBP to 6870'. WOC & tag. 14. I hereby certify that the foregoing is true and correct. Electronic Submission #474747 verifie For XTO PERMIAN OPERATI	ndonment. Id, install 3K BOF o verify setting. d by the BLM Well IG LLC, sent to the	and test. POO	AUG 2 RECEI	SERVATION DISTRICT 1 2019
properly secured while considering recompletion options or final abar 1. MIRU workover unit. POOH with pump and rods. Remove wellhed w/2-7/8" tubing. 2. RIH w/10K CIBP for 5-1/2" 15.5# casing. Set CIBP at 6970'. Tag to 3. Spot 25 sxs Class C on top of CIBP to 6870'. WOC & tag. 14. I hereby certify that the foregoing is true and correct. Electronic Submission #474747 verifie For XTO PERMIAN OPERATII Committed to AFMSS for processing by C	ndonment. Id, install 3K BOF o verify setting. d by the BLM Well IG LLC, sent to the	Information Syse Carlsbad //24/2019 (19CV)	AUG 2 RECEI	SERVATION DISTRICT 1 2019
1. MIRU workover unit. POOH with pump and rods. Remove wellhea w/2-7/8" tubing. 2. RIH w/10K CIBP for 5-1/2" 15.5# casing. Set CIBP at 6970'. Tag to 3. Spot 25 sxs Class C on top of CIBP to 6870'. WOC & tag. 14. I hereby certify that the foregoing is true and correct. Electronic Submission #474747 verifie For XTO PERMIAN OPERATII Committed to AFMSS for processing by Committed to AFMSS for processing by Committed (Printed/Typed) TRACIE J CHERRY	ndonment. Id, install 3K BOF o verify setting. Id by the BLM Well IG LLC, sent to the ANDY VIGIL on 07 Title REGULA Date 07/23/20	Information Syse Carlsbad (724/2019 (19CV)	AUG 2 RECEI	SERVATION DISTRICT 1 2019
1. MIRU workover unit. POOH with pump and rods. Remove wellhea w/2-7/8" tubing. 2. RIH w/10K CIBP for 5-1/2" 15.5# casing. Set CIBP at 6970'. Tag to 3. Spot 25 sxs Class C on top of CIBP to 6870'. WOC & tag. 14. I hereby certify that the foregoing is true and correct. Electronic Submission #474747 verifie For XTO PERMIAN OPERATII Committed to AFMSS for processing by C Name (Printed/Typed) TRACIE J CHERRY Signature (Electronic Submission)	ndonment. Id, install 3K BOF o verify setting. Id by the BLM Well IG LLC, sent to the ANDY VIGIL on 07 Title REGULA Date 07/23/20	Information System Carlsbad (124/2019 (19CV) ATORY COORI	ARTESIA E AUG 2 RECEI	SERVATION DISTRICT 1 2019

Additional data for EC transaction #474747 that would not fit on the form

32. Additional remarks, continued

4. Load casing with packer fluid and biocide, pressure test to 500 psi for 30 mins.

BLM and NMOCD will be notified prior to setting of CIBP and MIT.

Revisions to Operator-Submitted EC Data for Sundry Notice #474747

Operator Submitted

BLM Revised (AFMSS)

Sundry Type:

TA NOI

Lease:

NMLC068545

Agreement:

NMNM71016G

Operator:

XTO PERMIAN OPERATING LLC 6401 HOLIDAY HILL RD BLDG 5 MIDLAND, TX 79707 Ph: 432-221-7379

Admin Contact:

TRACIE J CHERRY REGULATORY COORDINATOR E-Mail: tracie_cherry@xtoenergy.com

Ph: 432-221-7379

Tech Contact:

TRACIE J CHERRY REGULATORY COORDINATOR E-Mail: tracie_cherry@xtoenergy.com

Ph: 432-221-7379

Location:

State: County: **EDDY**

Field/Pool:

NASH DRAW; DEL/BS (AV SND)

Well/Facility:

POKER LAKE UNIT 204 Sec 7 T24S R30E Mer NMP SESW 660FSL 660FWL

NOI

NMLC068545

891000303F (NMNM71016G)

XTO PERMIAN OPERATING LLC 6401 HOLIDAY HILL ROAD BLDG 5 MIDLAND, TX 79707 Ph: 432.683 2277

TRACIE J CHERRY
REGULATORY COORDINATOR
E-Mail: tracie_cherry@xtoenergy.com

Ph: 432-221-7379

TRACIE J CHERRY
REGULATORY COORDINATOR
E-Mail: tracie_cherry@xtoenergy.com

Ph: 432-221-7379

EDDY


NASH DRAW-DELAWARE

POKER LAKE UNIT 204 Sec 7 T24S R30E SESW 660FSL 1980FWL

XTO Permian Operating LLC Poker Lake Unit #204 30-015-32928 Temporarily Abandon

Before

After

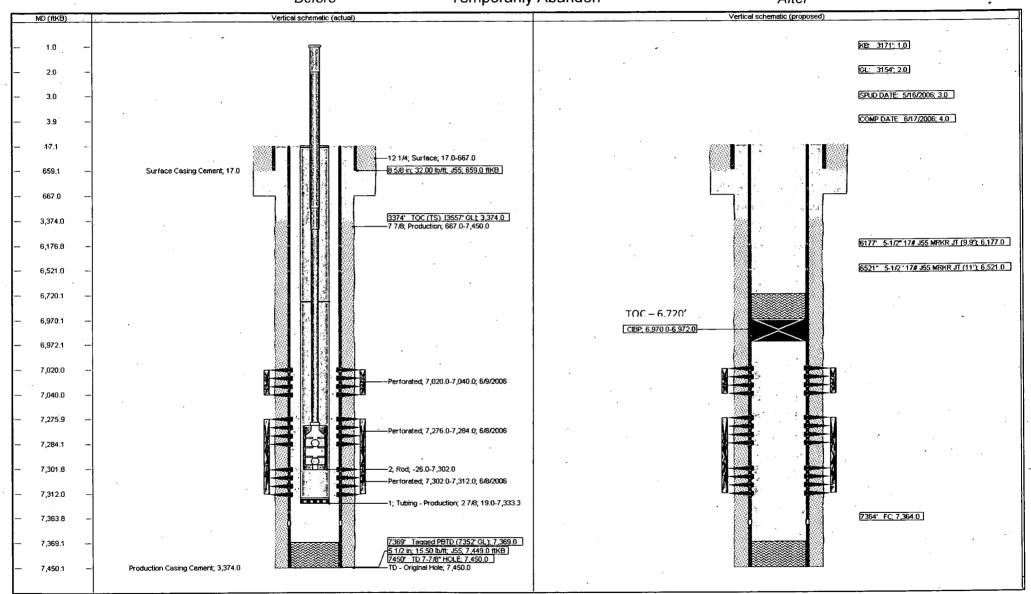

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Conditions of Approval for Temporary Abandonment of Wells

Definition: A temporarily abandoned well is a completion that is not capable of production in paying quantities but which may have future value. Pursuant to 43 CFR 3162.3-4 (c), no well may be temporarily abandoned for more than 30 days without the prior approval of the authorized officer.

Note: TA status "will be effective for a period up to 1 year from the date of NOI approval and can be renewed annually thereafter" per IM NM-2016-017.

- 1. A bridge plug (CIBP) must be installed 50 to 100 feet above any open perforations or open hole. The CIBP must be capped with either a minimum of 25 sacks of cement if placed with tubing or 35 feet of cement if placed with a bailer. The top of the cement must be verified by tagging.
- 2. The wellbore must be filled with corrosion inhibited fluid and pressure tested to 500 psi. The casing shall be capable of holding this pressure for at least 30 minutes. If the well does not pass the casing integrity test, then the operator shall, within 30 days, submit a procedure to either repair the casing or to plug and abandon the well.
- 3. Contact the appropriate BLM office at least 24 hours prior to the scheduled Casing Integrity Test. For wells in Eddy County, 575-361-2822; Lea County 575-393-3612.
- 4. All downhole production/injection equipment (tubing, rods, etc.) shall be removed from the casing if it is not isolated by a packer.
- 5. A bradenhead test must be conducted. If the test indicates a problem, a remedial plan and time frame for remediation shall be submitted within ninety (90) days of the test.
- 6. Submit a subsequent Sundry Notice (Form 3160-5) with the following information:
 - a. A well bore diagram with all perforations, CIBP's, and tops of cement on CIBP's.
 - b. A description of the temporary abandonment procedure.
 - c. A clear copy or the original of the pressure test chart.