Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED OMB NO. 1004-0137

	Expues.	January	-
Lease Se	rial No.		_
NIMANIM	05551/	Δ	


SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.				6. If Indian, Allottee or Tribe Name		
SUBMIT IN TRIPLICATE - Other instructions on page 2			7. If Unit or CA/Agreement, Name and/or No. NMNM91035			
1. Type of Well	8. Well Name and No. BONE FLATS 12 FEDERAL COM 4					
☑ Oil Well ☐ Gas Well ☐ Oth						
Name of Operator Contact: DAVID STEWART OXY USA WTP LIMITED PTNRSHIP E-Mail: david_stewart@oxy.com				9. API Well No. 30-015-28675-00-S1		
3a. Address 3b. Phone No. (ii			ea code)	10. Field and Pool or Exploratory Area S DAGGER DRAW-UPPER PENN		
HOUSTON, TX 77210 Ph: 432-685-						
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)				11. County or Parish, State		
Sec 12 T21S R23E SWSW 660FSL 660FWL				EDDY COUNTY, NM		
12. CHECK THE AI	PPROPRIATE BOX(ES) T	O INDICATE NATU	JRE OF NOTICE	, REPORT, OR OT	HER DATA	
TYPE OF SUBMISSION						
Notice of Intent ■	☐ Acidize	□ Deepen	☐ Produc	tion (Start/Resume)	☐ Water Shut-Off	
-	☐ Alter Casing ☐ Hydraulic Fracturing ☐ Rec		turing 🔲 Reclam	nation	■ Well Integrity	
☐ Subsequent Report	Casing Repair	■ New Construct	ion 🗖 Recom	plete	□ Other	
☐ Final Abandonment Notice	☐ Change Plans	☑ Plug and Aband	•	rarily Abandon		
	☐ Convert to Injection ☐ Plug Back ☐ Waration: Clearly state all pertinent details, including estimated starting date of		☐ Water I	•		
testing has been completed. Final Al determined that the site is ready for f TD-8100' PBTD-8013' Perfs 9-5/8" 36# csg @ 1200' w/ 75/7" 23-26# csg @ 8100', DVT 6 1. RIH & set CIBP @ 7490' w 2. M&P 35sx cmt @ 6455-62' 3. M&P 30sx cmt @ 4765-46 4. M&P 70sx cmt @ 3090-27 5. M&P 25sx cmt @ 2235-20	inal inspection. s-7540-7892' 0sx, 14-3/4" hole, TOC-Sur 6404' w/ 1150sx, 8-3/4" hole // 35sx cmt to 7315' 90' WOC-Tag 15' WOC-Tag 50' WOC-Tag 10' WOC-Tag	f-Circ-1"	G Acce VATIONEE A'	copted for record.	2/19 MOCD	
6. M&P 25sx cmt @ 1250-11. 7. M&P 110sx cmt @ 530' to-	35' WOC-Tag	AUG 21 20	19			
		,				
14. I hereby certify that the foregoing is	true and correct	RECEIVED		·		
	Electronic Submission #47 For OXY USA WTP itted to AFMSS for processir	LIMITED PTNRSHIP, 19 19 by DEBORAH MCKII	sent to the Carlsba	d 9 (19DLM0620SE)		
		_				
Signature (Electronic S	Submission)	Date 0	8/08/2019			
	THIS SPACE FOR	R FEDERAL OR ST	ATE OFFICE U	SE		
Approved By	O Chara	Title (SAFT		8-10-19 Date	
Conditions of approval, if any, are attache certify that the applicant holds legal or equivalent would entitle the applicant to conductive the applicant to conduct the applicant the applicant to conduct the applicant to conduct the applicant th	itable title to those rights in the s	ot warrant or	?F0			
Fitle 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent	U.S.C. Section 1212, make it a crestatements or representations as to	ime for any person knowin	gly and willfully to m	ake to any department or	agency of the United	

Additional data for EC transaction #477241 that would not fit on the form

32. Additional remarks, continued

10# MLF between plugs - Above ground steel tanks will be utilized

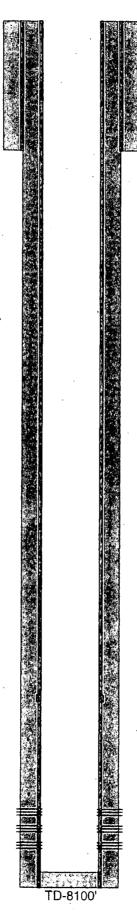

14-3/4" hole @ 1200' / 9-5/8" csg @ 1200' / w/ 750sx-TOC-Surf-Circ-1"

Pu Surf.

SA S30

Gol 2152

Yeso 2272

Basal S810

WC 6342

UP 7538

8-3/4" hole @ 8100' 7" csg @ 8098' w/ 1150sx-TOC-Surf-Circ DVT @ 6404'

Perfs @ 7540-7678' -

Perfs @ 7804-7892' ---

PB-8013'

OXY USA WTP LP - Proposed Bone Flats 12 Federal Com #4 API No. 30-015-28675

110sx @ 530'-Surface

25sx @ 1250-1135' WOC-Tag


25sx @ 2235-2010' WOC-Tag

70sx @ 3090-2750' WOC-Tag

30sx @ 4765-4615' WOC-Tag

35sx @ 6455-6290' WOC-tag

CIBP @ 7490' w/ 35sx to 7315'

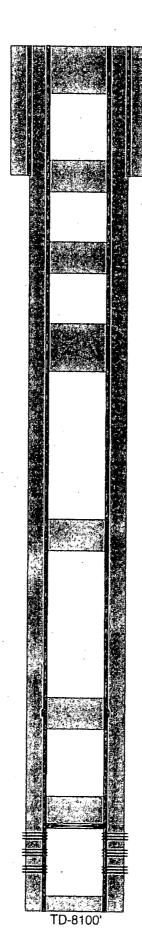

14-3/4" hole @ 1200' 9-5/8" csg @ 1200' w/ 750sx-TOC-Surf-Circ-1"

8-3/4" hole @ 8100' 7" csg @ 8098' w/ 1150sx-TOC-Surf-Circ DVT @ 6404'

Perfs @ 7540-7678'

Perfs @ 7804-7892'

PB-8013¹

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

 The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and
- embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged</u>.
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.