

	· · · · ·		tesia	~			
Form 3160-5 (June 2015) DE	UN. LD STATES		ED	FORM APPROVED OMB No. 1004-0137 Expires: January 31, 2018			
	BUREAU OF LAND MANAGEMENT AUG 2 1 2019 SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enternes			5. Lease Serial No. NMLC028775B			
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter BIAOC abandoned well. Use Form 3160-3 (APD) for Superposals				. If Indian, Allottee or Tribe Name			
abandoned well.	Torm for proposals to Use Form 3160-3 (API	drill or to re-enter	RESIAU.				
SUBMIT IN TRIPLICATE - Other instructions on page 2					ement, Name and/or No.		
1. Type of Well							
Oil Well Gas Well Other				8. Well Name and No. Robinson Jackson Unit# 108			
2. Name of Operator COG Operating, LLC				9. API Well No. 30-0*	15-31127		
3a. Address 600 W Illinois Midland TX 79701 3b. Phone No. (include area code)				10. Field and Pool or I	Exploratory Area		
4. Location of Well (Footage, Sec., T.R.M., or Survey Description)				Grayburg Jackson		·····	
Sec 27, T17S, R29E 1740'FNL & 2310'FWL				11. Country or Parish, State Eddy County, NM			
12. CHE	CK THE APPROPRIATE BOX	(ES) TO INDICATE NAT	URE OF NOTI				
TYPE OF SUBMISSION			TYPE OF AC			······································	
Notice of Intent					oduction (Start/Resume) Water Shut-Off		
	Alter Casing Hydraulic Fracturing Re				Humation Well Integrity		
Subsequent Report	Casing Repair	New Construction		omplete porarily Abandon	Other		
Final Abandonment Notice	Convert to Injection	Plug Back		er Disposal			
 Set 5 1/2" CIBP @ 2600°. C. Set 5 1/2" CIBP @ 2150°. Pi Spot 25 sx cmt @ 900-700°. Perf & Sqz 90 sx cmt @ 406 Cut off well head, verify cmt May want He SQ2. to 	essure test csg. Circulate ho WOC & Tag (B/Salt) i' to Surface. (T/Salt & 8 5/8" to surface, weld on Below Gr to Shut Sc assure	le w/MLF. Spot 25 sx cl Shoe) round Dry Hole Marker. c,f. Va(ua flaa Shu	s to		ressare a		
G C 8/22/19 Accepted for record - NMOCD 14. Thereby certify that the foregoing is true and correct. Name (Printed/Typed)				SEE ATTACHED FOR CONDITIONS OF APPROVAL			
A Thereby certify that the foregoing is	true and correct. Name (Printed						
- Hbigail Hnolersc	<u>×n</u>	Title A	gent			·	
Signature Abiquil	Inderson	Date 04	1	2019			
	THE SPACE F	OR FEDERAL OR	STATE OF	ICE USE			
Approved by	2. anno	Title	SAE	7 0	Date 4-22-1	9	
Conditions of approval, if any, are attack certify that the applicant holds legal or e which would entitle the applicant to con	quitable title to those rights in the duct operations thereon.	ne subject lease Office	CFD				
Title 18 U.S.C Section 1001 and Title 42 any false, fictitious or fraudulent stateme	U.S.C Section 1212, make it a ints or representations as to any	crime for any person know matter within its jurisdicti	ringly and willf on.	fully to make to any dep	partment or agency of the U	United States	
(Instructions on page 2)	· · · · · ·						

X

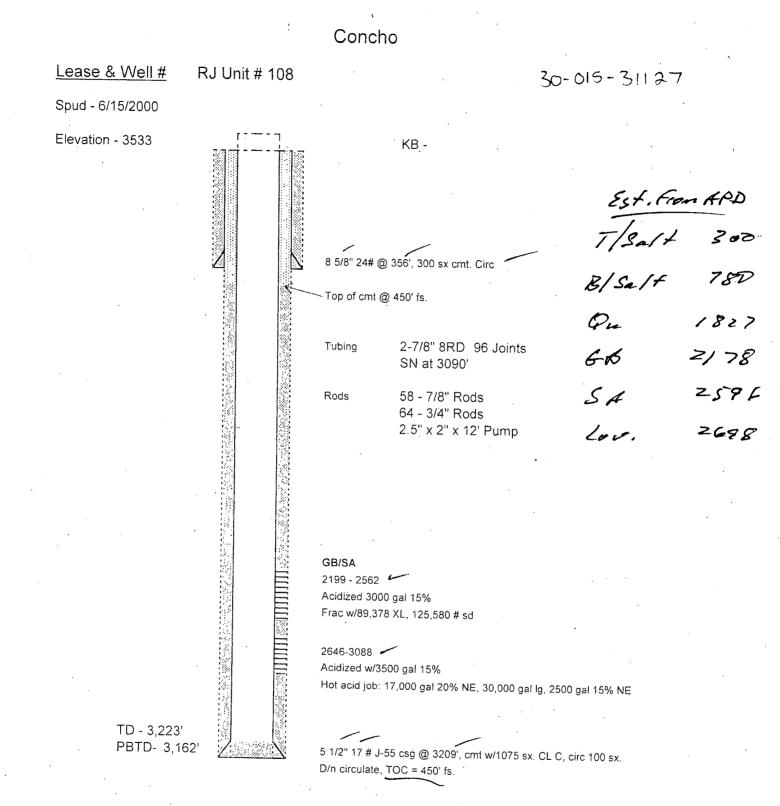

32,8080254

-104.0636978

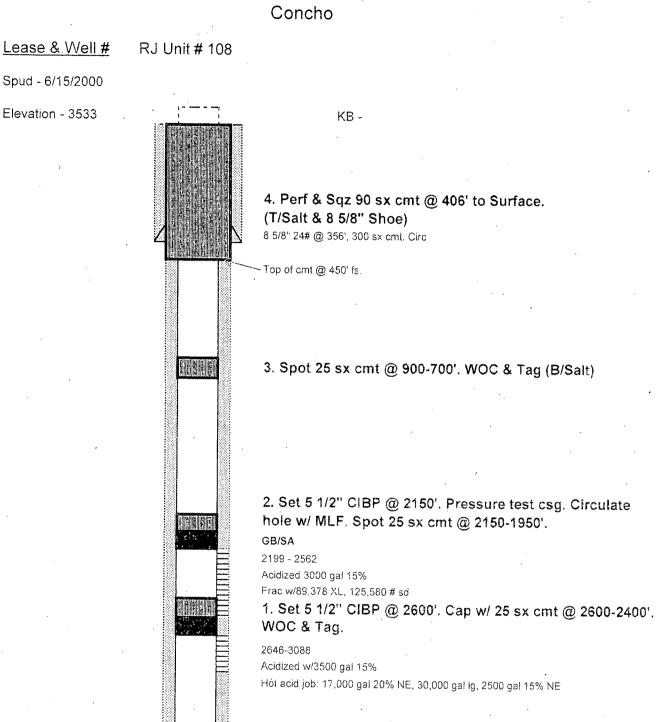

TD - 3,223' PBTD- 3,162'

5 1/2" 17 # J-55 csg @ 3209', cmi w/1075 sx. CL C. circ 100 sx. D/n circulate, TOC = 450' fs.

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90^{th} day provide this office, prior to the 90^{th} day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.