Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

5. Lease Serial No.

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an chandened well lise form 3160-3 (APD) for such proposals

6. If Indian, Allottee or Tribe Name

NMNM0281482A

abandoned well. Use form 3160-3 (APD) for such proposals.							
SUBMIT IN TRIPLICATE - Other instructions on page 2					7. If Unit or CA/Agreement, Name and/or No.		
1. Type of Well ☑ Oil Well ☐ Gas Well ☐ Other					8. Well Name and No. MOBIL FEDERAL 9		
2. Name of Operator Contact: DAVID STEWART OXY USA INCORPORATED E-Mail: david_stewart@oxy.com					9. API Well No. 30-015-37339-00-S1		
3a. Address 5 GREENWAY PLAZA SUITE 110 Ph: 432.68 HOUSTON, TX 77046-0521			. (include area code) 5.5717		10. Field and Pool or Exploratory Area COTTON DRAW SAND DUNES WEST		
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)				11.	11. County or Parish, State		
Sec 29 T23S R31E SWNE 19			EDDY COUNTY, NM				
12. CHECK THE AI	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE O	F NOTICE, RE	PORT, OR OTH	ER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION				-		
Notice of Intent ■	☐ Acidize ☐ D		epen Produc		tion (Start/Resume)		
	☐ Alter Casing	🗖 Hyd	raulic Fracturing	□ Reclamation		■ Well Integrity	
☐ Subsequent Report	□ Casing Repair	□ New Construction . □ Re		☐ Recomplete		Other	
☐ Final Abandonment Notice	☐ Change Plans 🔁 Plug		and Abandon .	☐ Temporarily	emporarily Abandon		
	☐ Convert to Injection ☐ Plu		Back	■ Water Disposal			
following completion of the involved testing has been completed. Final Al determined that the site is ready for f TD-7921' PBTD-5902' Perfs 11-3/4" 42# csg @ 428' w/ 35' 8-5/8" 32# csg @ 4055' w/ 11' 5-1/2" 17# csg @ 7921',DVT's 1. RIH & tag CR @ 5902', M& 2. M&P 130sx cmt @ 4150-3 3. M&P 130sx cmt @ 3150-2 4. M&P 130sx cmt @ 2150-1 5. M&P 150sx cmt @ 1150' to 10# MLF between plugs - Abo	pandonment Notices must be final inspection. s-6267-6576' Osx, 14-3/4" hole, TOC-S 30sx, 10-5/8" hole, TOC-S 5930',4100' w/1710sx,7 RP 25sx cmt to 5752', W0 150' WOC-Tag 150' WOC-Tag 150' WOC-Tag 20 surface ave ground steel tanks with	Gurf-Circ Surf-Circ Surf-Circ 7-7/8" hole,TO	requirements, includ	Ing reclamation, har TR - 11 George for reconcepted for recon	I-P S ACHED F IONS OF A NIMIOLE CONTROLS	PPROVAL ONSERVATION BIA DISTRICT	
14. I hereby certify that the foregoing is	Electronic Submission # For OXY US	A INCORPORA	TED, sent to the	Carlsbad		2 1 2019	
Committed to AFMSS for processing by PRISCIL					•		
Name (Printed/Typed) DAVID ST	Title REGUL	ATORY ADVIS	DR RE	CEIVED			
Signature (Electronic S			Date 06/28/2				
	THIS SPACE F	OR FEDERA	L OR STATE	OFFICE USE			
Approved By Conditions of approval, if apy, are attached. Approval of this notice does not warrant or			Title Sp	45		7.20-19 Date	
certify that the applicant holds legal or equ which would entitle the applicant to condu	ect operations thereon.			60			
Title 18 U.S.C. Section 1001 and Title 43 States any felse, fictitious or fraudulent	U.S.C. Section 1212, make it a statements or representations a	a crime for any pe is to any matter w	erson knowingly and ithin its jurisdiction.	willfully to make to	any department or	agency of the United	

OXY USA Inc. - Current Mobil Federal #9 API No. 30-015-37339

14-3/4" hole @ 428' 11-3/4" csg @ 428' / w/ 350sx-TOC-Surf-Circ /

Rustler 379

Salado 706

4100

Bell 4127

Cherry 5033 Brushy 6285

10-5/8" hole @ 4055' ~ 8-5/8" csg @ 4055' ____ w/ 1130sx-TOC-Surf-Circ ___

10/18-Csg Lk @ 5930-5966', sqz w/ 400sx cmt

Perfs @ 6267-6576'

7-7/8" hole @ 7921' / 5-1/2" csg @ 7921' / DVT's @ 5930', 4100' ~ w/ 1710sx-TOC-Surf-Circ

Perfs @ 7315-7365' sqz w/ 400sx cmt-10/18 ---

Perfs @ 7728-7738' ~

10/18-CR @ 5902' 10/18-CP @ 6012'

10/18-CP @ 6608'

10/18-CR @ 7285'

10/18-CIBP @ 7404'

PB-7919'

OXY USA Inc. - Proposed Mobil Federal #9 API No. 30-015-37339

150sx @ 1150'-Surface

130sx @ 2150-1150' WOC-Tag

130sx @ 3150-2150' WOC-Tag

130sx @ 4150-3150' WOC-Tag

25sx @ 5902-5752' WOC-Tag


10/18-CR @ 5902' 10/18-CP @ 6012'

10/18-CP @ 6608'

10/18-CR @ 7285'

10/18-CIBP @ 7404'

PB-7919'

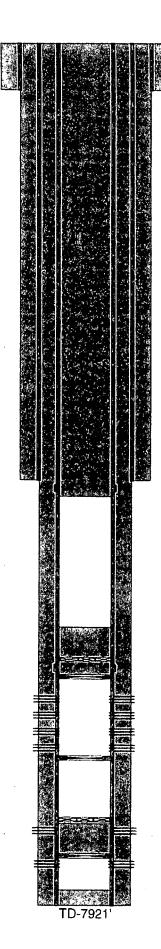

14-3/4" hole @ 428' 11-3/4" csg @ 428' w/ 350sx-TOC-Surf-Circ

10-5/8" hole @ 4055' 8-5/8" csg @ 4055' w/ 1130sx-TOC-Surf-Circ

10/18-Csg Lk @ 5930-5966', sqz w/ 400sx cmt

Perfs @ 6267-6576'

7-7/8" hole @ 7921' 5-1/2" csg @ 7921' DVT's @ 5930', 4100' w/ 1710sx-TOC-Surf-Circ

Perfs @ 7315-7365' sqz w/ 400sx cmt-10/18

Perfs @ 7728-7738'

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>minety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In heu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted