
Form 3160-5 (June 2015) DE BU SUNDRY Do not use thi abandoned wel	FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No. NMLC028775B 6. If Indian, Allottee or Tribe Name						
SUBMIT IN TRIPLICATE - Other instructions on page 2					 If Unit or CA/Agreement, Name and/or No. 8910123980 		
1. Type of Well					8. Well Name and No. RJ UNIT 107		
2. Name of Operator Contact: ABIGAIL ANDERSON COG OPERATING LLC E-Mail: abbym@bcmandassociates.com					9. API Well No. 30-015-03177-00-S1		
3a. Address3b. Phone No. (include area code)600 W ILLINOIS AVENUEPh: 432-580-7161MIDLAND, TX 79701Ph: 432-580-7161					10. Field and Pool or Exploratory Area GRAYBURG		
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					11. County or Parish, State		
Sec 27 T17S R29E SENW Tract 2 1980FNL 1980FWL					EDDY COUNTY, NM		
12. CHECK THE AI	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE OI	F NOTICE,	REPORT, OR OTH	IER DATA	4
TYPE OF SUBMISSION	TYPE OF ACTION						
Notice of Intent	Intent CAcidize Deepen		pen	Product:	tion (Start/Resume)		Shut-Off
	Alter Casing	🗖 Hyd	Hydraulic Fracturing 🔲 Reclar		ation	U Well Integrity	
Subsequent Report	Casing Repair	□ New Construction □ Recom			Other		
Final Abandonment Notice			U Tempor	prarily Abandon Disposal			
testing has been completed. Final Al determined that the site is ready for f 1. Set 7" CIBP @ 2600'. Spot 2. Set 7" CIBP @ 2300'. Spot MLF. Add Plan,	inal inspection. 25 sx cmt on top. Circula 25 sx cmt on top. Pressu 2 WOC & Tag. 190. surface.	te hole w/ ML re test csg. to S& Z C~ (Shoc					or nas
GC 8/22/19 Accepted for record - NMIOCD SEE ATTACHED FOR CONDITIONS OF APPROVAL							U
14. I hereby certify that the foregoing is true and correct. Electronic Submission #463562 verified by the BLM Well Information System For COG OPERATING LLC, sent to the Carlsbad Committed to AFMSS for processing by PRISCILLA PEREZ on 04/30/2019 (19PP1871SE) AUG 2 1 2019 Name (Printed/Typed) ABIGAIL ANDERSON Title AGENT							
Signature (Electronic	Submission)		Date 04/30/2	019			
	THIS SPACE FO		L OR STATE	OFFICE U	SE		
Approved By James		Title SACT		S-S Date		-5-19	
Conditions of approval, if any, are attache certify that the applicant holds legal or eq which would extitle the applicant to condu	uitable title to those rights in the	s not warrant or e subject lease	Office CFa	2			
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent	U.S.C. Section 1212, make it a statements or representations as	crime for any post s to any matter w	erson knowingly and ithin its jurisdiction.	willfully to m	ake to any department of	agency of th	e United
(Instructions on page 2) ** BLM REV	ISED ** BLM REVISE	D ** BLM R	EVISED ** BLN	I REVISE	D ** BLM REVISE	D **	~


.

-

F

COG Operating LLC

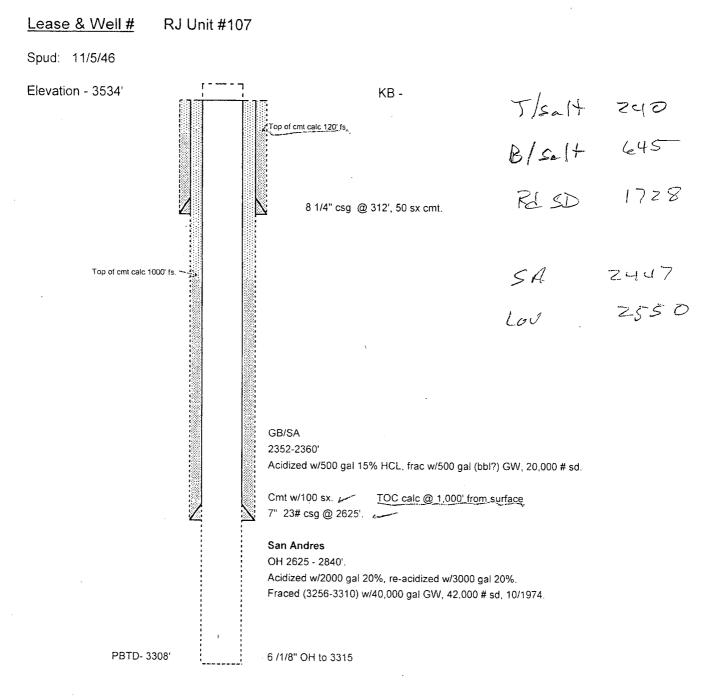

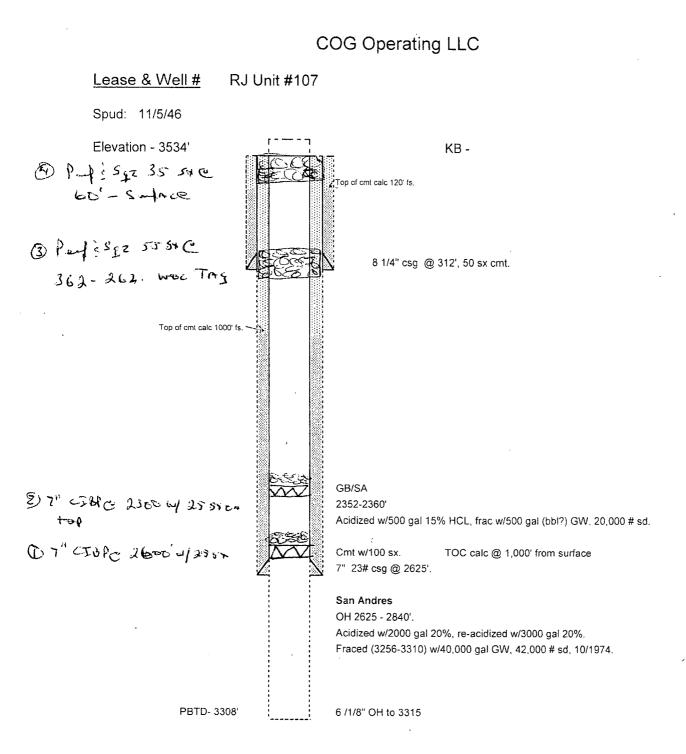

4/25/2019

RJ Unit # 107 Wellbore diagram (2)

-104.0647736

32.8073654

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico \$8220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>minety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged</u>.

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.