Form 3160-5 (June 2015)

OCD Artesia

UNITED STATES

FORM APPROVED

DEPARTMENT OF THE INTERIOR					es: January 31, 2018
BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.			5.	5. Lease Serial No. NMNM0544986	
			6.	6. If Indian, Allottee or Tribe Name	
SUBMIT IN TRIPLICATE - Other instructions on page 2				7. If Unit or CA/Agreement, Name and/or No.	
1. Type of Well				Well Name and	No.
☑ Oil Well ☐ Gas Well ☐ Other				TODD 25M FEDERAL 13	
2. Name of Operator Contact: ARMON RADFA DEVON ENERGY E-Mail: ARMON.RADFAR@DVN.CO			9.	9. API Well No. 30-015-27386	
3a. Address 333 WEST SHERIDAN AVENUE OKLAHOMA CITY, OK 73102		3b. Phone No. (include area code Ph: 405-552-5014			l or Exploratory Area LS (DELAWARE)
4. Location of Well (Footage, Sec., T)	11	11. County or Parish, State		
Sec 25 T23S R31E Mer NMP		İ	EDDY COU	NTY, NM	
•					
12. CHECK THE AI	PPROPRIATE BOX(ES)	TO INDICATE NATURE C	OF NOTICE, RE	PORT, OR (OTHER DATA
TYPE OF SUBMISSION	TYPE OF ACTION				
	☐ Acidize	☐ Deepen	☐ Production	(Start/Resume	e) Water Shut-Off
■ Notice of Intent	☐ Alter Casing	☐ Hydraulic Fracturing	_	•	☐ Well Integrity
☐ Subsequent Report	☐ Casing Repair	■ New Construction ,	_		Other
Final Abandonment Notice	☐ Change Plans	☑ Plug and Abandon	☐ Temporaril		
	Convert to Injection	☐ Plug Back	☐ Water Disp	•	
13. Describe Proposed or Completed Op If the proposal is to deepen direction: Attach the Bond under which the wo following completion of the involved testing has been completed. Final Al determined that the site is ready for f 1. MIRU P&A unit. 2. Pull rod pump and 2-7/8" pr 3. Set CIBP @ 6700'. Tag. Cir 4. Spot 25 sx CI C from 5750'.	ally or recomplete horizontally, rk will be performed or provide to operations. If the operation res- bandonment Notices must be file inal inspection. roduction tubing assembly rc 10# salt gel. Spot 25 sx	give subsurface locations and measing the Bond No. on file with BLM/BL sults in a multiple completion or reced only after all requirements, include from ~8,100'. CI C from 6700'-6450'. (Perf	ured and true vertica A. Required subseq completion in a new ding reclamation, ha	al depths of all p uent reports mus interval, a Form ave been comple	ertinent markers and zones, st be filed within 30 days a 3160-4 must be filed once
5. Spot 30 sx Cl C from 4570'- 4370')	43004. WOC & tag. (Top i	Delaware @ 4518', B. Salt @) 4480'; Shoe @	4193	
6. Perf at 1200', Squeeze 105 sx CI C from 1200'-800', WOC & tag. (T. Salt @ 1130'; Shoe @ 860') 7. Perf @ 140', Pump 35 sx CI C in/out to surface. 8. Cut wellhead off 3' BGI. Set dry hole marker.					
CONDITIONS OF APPROVAL					
Below ground	level dry	hole mark	cer segu	ired	THOTAL
14. I hereby certify that the foregoing is	Electronic Submission #4	472413 verified by the BLM We ON ENERGY, sent to the Carl		stem NM	OIL CONSERVATIO
Name (Printed/Typed) ARMON F	Title PRODI	UCTION ENGIN	EER	SEP 2 3 2019	
				Service Comments	
Signature (Electronic S	Date ^07/08/2		*.	RECEIVED	
THIS SPACE FOR FEDERAL OR STATE OFFICE USE					

Approved By

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would enable the applicant to conduct operations thereon.


Office (//


Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED **



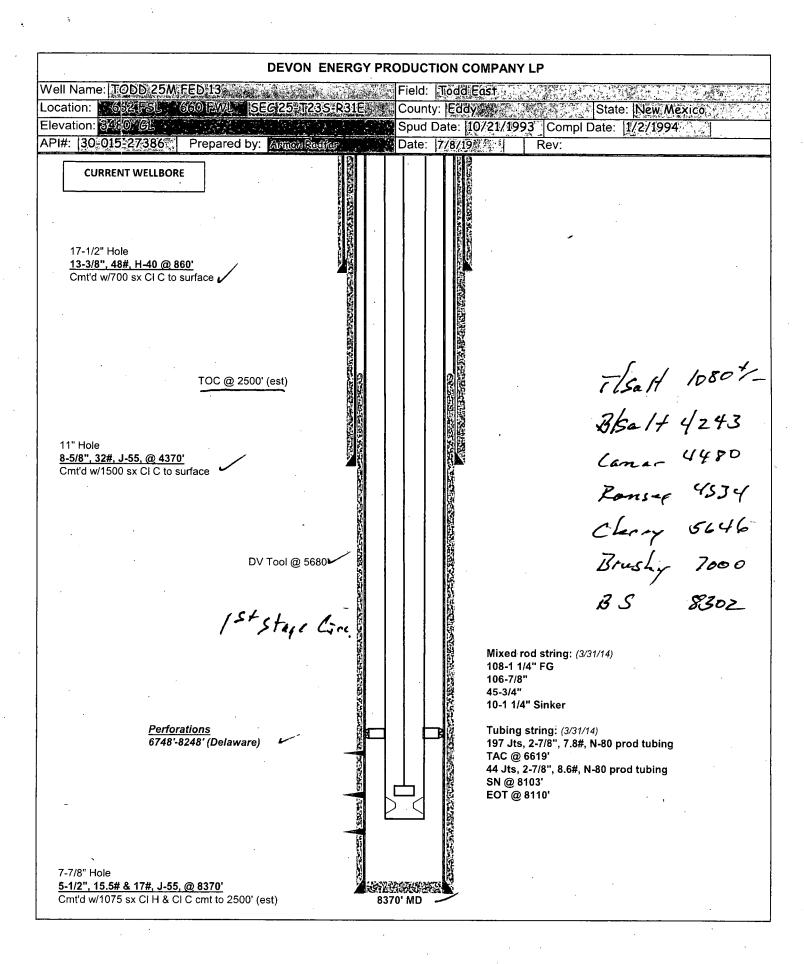

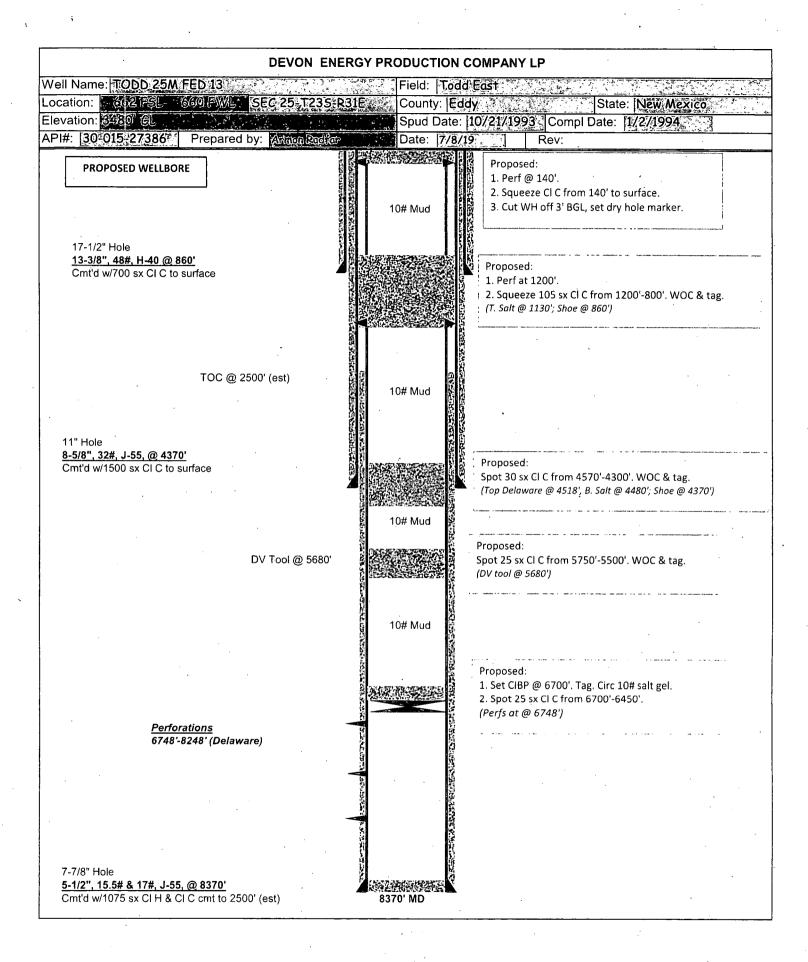

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted