Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED OMB NO. 1004-0137 xpires: January 31, 2018

	Expires: January 3
ί,	Lease Serial No.
	NIMI COSTAGE

SUNDRY N	OTICES AND REPORTS ON WELLS
Do not use this	form for proposals to drill or to re-enter an
abandoned well.	Use form 3160-3 (APD) for such proposals.

1111120001100	
6. If Indian, Allottee or Tribe Name	

abandoned wei		o. It indian, Another of Tribe Name							
SUBMIT IN	7. If Unit or CA/Agreement, Name and/or No.								
Type of Well	ner			8. Well Name and No. FEDERAL AK 1					
2. Name of Operator EOG Y RESOURCES INC	Contact: T E-Mail: tina_huerta@	INA HUERT Deogresource			9. API Well No. 30-015-00111-0	0-S1			
3a. Address 104 S 4TH STREET ARTESIA, NM 88210		(include area code) 8-4168		10. Field and Pool or Exploratory Area PENASCO DRAW					
4. Location of Well (Footage, Sec., T	., R., M., or Survey Description)				11. County or Parish, S	State			
Sec 3 T19S R25E NESE 1980	DFSL 660FEL	•			EDDY COUNTY, NM				
12. CHECK THE AI	PPROPRIATE BOX(ES) T	O INDICAT	TE NATURE OI	NOTICE,	REPORT, OR OTH	ER DATA			
TYPE OF SUBMISSION			TYPE OF	ACTION					
☑ Notice of Intent	Acidize D		en	☐ Product	ion (Start/Resume)	☐ Water Shut-Off			
Notice of Intent	☐ Alter Casing	☐ Hydi	raulic Fracturing	☐ Reclam	ation	■ Well Integrity			
☐ Subsequent Report	□ Casing Repair	□ New	Construction	☐ Recomp	olete	Other			
☐ Final Abandonment Notice	☐ Change Plans	🛛 Plug	and Abandon	☐ Tempor	arily Abandon				
			Back	☐ Water I	Disposal				
If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection. EOG Resources, Inc. plans to plug and abandon this well as follows: 1. MIRU all safety equipment as needed. POOH with production equipment. 2. Make a GR/JB run to 5700 ft. 3. Set a CIBP at 5690 ft. Spot 25 sx Class C cement on top of CIBP to 5340. WOC and tag Fover ATTACHED FOR 4. Load hole with plugging mud. Perforate at 4470 ft. Attempt to establish an injection rate. Squeeze a 25 sx Class C in/out cement plug from 4470 ft - 4320 ft. WOC and tag. Covers ONDITIONS OF APPROVAL 5. Perforate at 2440 ft. Attempt to establish an injection rate. Squeeze a 25 sx Class C in/out cement plug from 2440 ft - 2290 ft. WOC and tag. Covers Glorieta top. 6. Perforate at 1280 ft. Attempt to establish an injection rate. Squeeze a 25 sx Class C in/out cement plug from 1280 ft - 1130 ft. WOC and tag. Covers 8-5/8 inch casing shoe and San Andres top. ARTESIA DISTRICT									
14. I hereby certify that the foregoing is	Electronic Submission #48	SOURCES	NC, sent to the C	arisbad	roystem	17 2019			
Name (Printed/Typed) TINA HUE	RTA	Title REGUL	ATORY SP	ECIALIST REC	EIVED				
Signature (Electronic S	Submission)	Date 09/30/20)19						
	THIS SPACE FOR	R FEDERA	L OR STATE	OFFICE U	SE				
Approved By Conditions of approval, it any, are attache certify that the applicant holds legal or equivalent would entitle the applicant to conduct the conduction of the con	uitable title to those rights in the s act operations thereon.	Title SA	7		10-5-19 Date				
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.									

⁽Instructions on page 2) ** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED **




Additional data for EC transaction #485772 that would not fit on the form

32. Additional remarks, continued

7. Spot a 10 sx Class C cement plug from 150 ft up to surface.8. Cut off wellhead and install dry hole marker. Clean location as per regulated.

Wellbore schematics attached

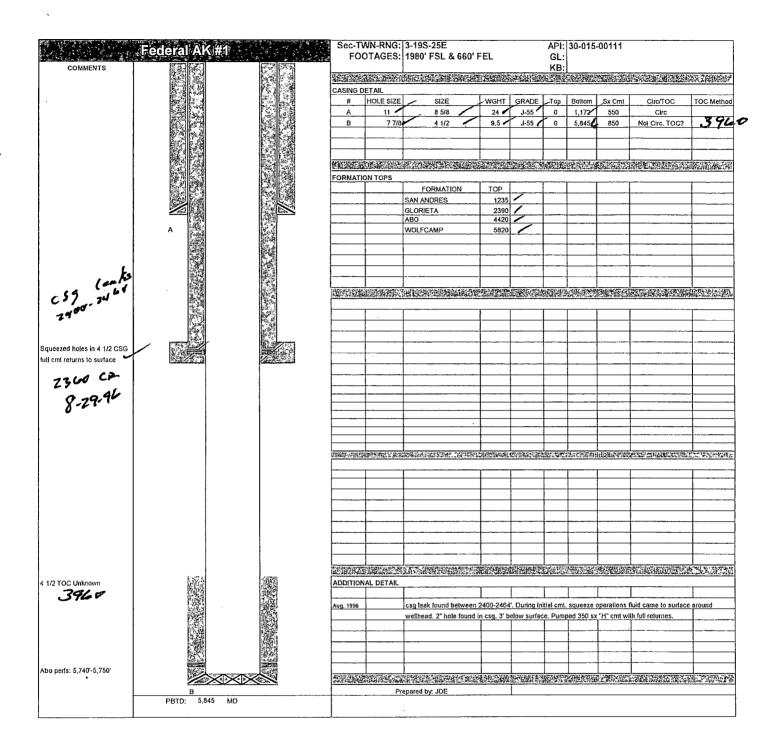

	Federal AK #1			c-TWN-RNG: FOOTAGES:	3-19S-25E 1980' FSL & 660'	FEL		GL:	30-015-00	111	•	
COMMENTS				KB:								
			Entrol Manager and Control of the Co					SANT SAISE, PEGAR				
	i de la companya de l			HOLE SIZE	SIZE	WGHT	GRADE	Тор	Battom	Sx Cmt	Circ/TOC	TOC Method
ļ			A	11	8 5/8	24	J-55	0	1,172	550	Circ	
			В	7 7/8	4 1/2	9.5	J-55	0	5,845	850	Not Circ. TOC?	
ļ				٠								
											ļ. <u></u>	
			10/25	Sales and an outside the section of	TANK AND WEST PROPERTY OF THE PER	**********	CONTRACTOR	(T) are test tend	CONTRACTOR AND PORTER	<i>ขอาสสเกรา</i> การ	Record to the personal control	CTATION BURNINGS
					IN A LUTUS OF THE BASIS	الكانك المدر	NE MAIN	1163467841重	MICHAEL PION	BEAM FOR	n-orallic Bell	ALL: TOTAL
			FORM	AATION TOPS		I	ī			1	Γ"	
					FORMATION	TOP				 	 	
					SAN ANDRES GLORIETA	1235 2390						
			 		ABO	4420				 		
	A				WOLFCAMP	5820	Ī					
		164										
	[4]										ļ	
	4	7.3	ļ				ļ			L	<u> </u>	
		78.4				<u> </u>	-		ļ.——	-	<u>. </u>	
			1277272	CHIPPLIC PRINCIPLES	ios acceptatos	CH STATES	2002-10032001-	CONTRACTOR OF STATE	A SECTION OF COURSE	100200000	Transmission Care transmission	THE PERSONS
	[3]				dan dan merikana	LEGITATE	MCACA COLUMN	自3-34000 000	thur CT thus	SUMPLE	Sall Shalder start	CHARGEMENT
	12		Plugs		CHT CI	I	втм	I	Desail	alla a	T	T
		13.4	#	SX 25	CMT Class Class C	Top 5340		-	Descri		erfs and WC lop.	WOC and tan
2,400'-2,460'			2	25	Class C	4320	4470				queeze. Abo top.	
Squeezed holes in 4 1/2 CSG			3	25	Class C	2290					eze. Glorieta top.	
full cmt returns to surface	37.70	, a	4	25	Class C	1130					sg Shoe & SA to	
			5	10	Class C	0	150	-				Surface Plug
				3 10 Class C 0 100								
										,	·	
										 	 	
							ļ		ļ	<u> </u>		
									İ			
			D CT-TSC	TO THE POST OF THE PARTY OF	HEAGUSTAN UNIVE	The second second	Stricture 4.78	THE TO THE PLANT	CONTRACTORY	GE HARTON EST	l Survey outermen	Herry Tille Tiles
1		1	<u> </u>	Charlest a annual tract con	to the contract of the track of the track of	CONTRACTOR	لد ويد تو دوسوه	4 hera 1000 1 1 1 1 1 1	T. 6 45 W. 47 - 4.	-Trees, al. 25.4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	284.16.15 1 812 M4.7 04	Ca. 44. W 1. 1011
İ			-		I	Ι	ī	1				
i												
								L				
1						ļ		ļ <u> </u>				
1						ļ	1		ļ			
			ļ			 	<u> </u>	ļ				
		STATE OF THE STATE	<u> </u>					 	ļ			
			12707995	A a constant when		AND THE PARTY OF	1 389 468 FC	- 15 24 10 4 699	I Brans The	SALL MARKET STATE	777553975737577	2001 - POME
	Mesc a service		-		Carland Company	Har bell alt.	3124126.2	en in Paris Trackle	Lus Ing York	المناطقة المناسب	CIRA PARENTE SAN	trinteent, In 1888 b.
	EVE TO	22530	ADDI	TIONAL DETAIL		T	T		1	T	T	
4 1/2 TOC Unknown	1			1	csg leak found between	2400-24	24'		 	 		
		(外間	Aug. 1	1330	during initial cmt. sque	ze onerni	ions fluid (came to sur	face around w	elihead.		1
					2" hole found in csg 3'	below sur	face. Pum	ped 350 sx	"H" cmt with f	uli returnes		
					1	[T					
1	23											
Abo perfs; 5,740'-5,750'	1290					<u> </u>	1		L			
			Par	Kertalan ing	THE LEW PROPERTY.	T. J. J. J.	THEME	THE LUID	ET PLEAT	建即並		
	В	·		Pre	pared by: JDE		<u> </u>					
	PBTD: 5,845 MD											

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. Mud Requirement: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brime water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.
- The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged</u>.
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.