


Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources
OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised June 10, 2003

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-104) FOR SUCH PROPOSALS.)		WELL API NO. 30-005-61443
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
2. Name of Operator Pecos River Operating		6. State Oil & Gas Lease No.
3. Address of Operator 400 W. Illinois, Suite 1070, Midland, TX 79701		7. Lease Name or Unit Agreement Name Mitchell
4. Well Location Unit Letter <u>D</u> : <u>660</u> feet from the <u>North</u> line and <u>990</u> feet from the <u>West</u> line Section <u>9</u> Township <u>6-S</u> Range <u>26-E</u> NMPM <u>Chaves</u> County		8. Well Number 1
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3644' GR		9. OGRID Number 017081
		10. Pool name or Wildcat Pecos Slope Abo

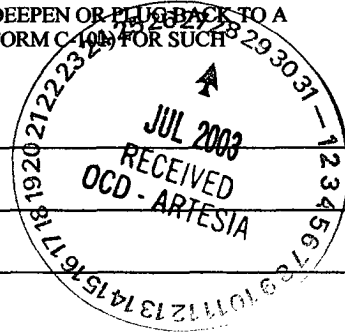

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input checked="" type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/> OTHER: <input type="checkbox"/>	SUBSEQUENT REPORT OF: REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input type="checkbox"/> CASING TEST AND CEMENT JOB <input type="checkbox"/> OTHER: <input type="checkbox"/>

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Notify OCD 24 hrs before starting.

1. POH w/pkr set @ 4060.
2. Spot 300' plug @ 4060 (perf 3843 to 3878, 4019 to 4042) WOC tag.
3. Perf 4 1/2 @ 1622 sqz 40 sxs leave 100' cmt inside 4 1/2 WOC tag.
4. Spot 100' plug @ 900 (10 3/4 shoe @ 850 pump 250 sxs cmt down 1" loc 300') WOC tag.
5. Perf 4 1/2 100' circulate cmt to surface.
6. Cut off wellhead install dry hole marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE William R. Huck TITLE VP - Engr & Operations DATE 7/25/03

Type or print name William R. Huck E-mail address: billh@pecosproduction.com Telephone No. 432-620-8480
(This space for State use)

APPROVED BY [Signature] TITLE [Signature] DATE APPROVED AUG 13 2003
Conditions of approval, if any:

OPERATOR: Pecos River Operating			API#	30-005-61443	
WELL: Mitchell # 1			LOCATION:	D-9-6-26	
SURFACE CSG-HOLE SIZE"	CSG. SIZE	10 3/4"	SET @	850'	SX. CMT. TOC. Circ
INT.CSG- HOLE SIZE	CSG. SIZE	"	SET @	'	SX. CMT. TOC.
LONG STRING- HOLE SIZE	CSG. SIZE	4.5"	SET @	4400'	SX. CMT. TOC. 2200'
OTHER-					

