

Submit 3 Copies To Appropriate District
Office
District I
1625 S. French Dr., Hobbs, NM 88240
District II
1371 W. Grand Ave., Artesia, NM 88216
District III
1009 Rio Arriba Rd., Aztec, NM 87416
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO 30-041-10015
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☐ FEE ☒
2. Name of Operator Thompson, J. Cleo		6. State Oil & Gas Lease No LC-060978
3. Address of Operator P. O. Box 12577, Odessa, TX 79768-2577		7. Lease Name or Unit Agreement Name: Milnesand San Andres Unit
4. Well Location Unit Letter E : 1980 feet from the North line and 660 feet from the West line. Section 7 Township 8S Range 35E NMPM County Roosevelt		8. Well No. 125
10. Elevation (State whether DR, FKB, RT, GR, etc.)		9. Pool name or Wildcat Milnesand (San Andres)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒ TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐ OTHER ☐	SUBSEQUENT REPORT OF: REMEDIAL WORK ☐ ALTERING CASING ☐ COMMENCE DRILLING OPNS ☐ PLUG AND ABANDONMENT ☐ CASING TEST AND CEMENT JOB ☐ OTHER ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion recompletion.

Proposed Plug and Abandon

Note: CICB set @ 4555 w/ 2 sx of cement ✓


Plug #1 Pump 20 sx cement plug @ 4127 to 4027 (Tag)

Plug #2 Perf and Squeeze 80 sx cement plug @ 2750 to 2650 (Tag)

Plug #3 Set packer @ 2150. Perf and Squeeze 80 sx cement plug @ 2150 to 2250 (Tag)

Plug #4 Set packer @ 280. Perf and Squeeze w/ 150 sx cement @ 440. Circulate cement on Backside. (Tag)

Plug #5 Pump 10 sx plug @ surface. Install dry hole marker.

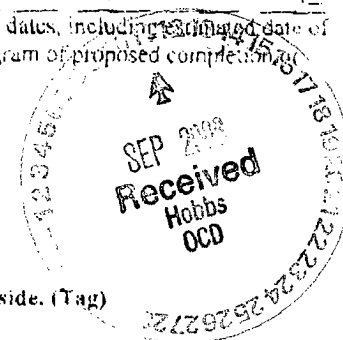

**THE OIL CONSERVATION DIVISION MUST
BE NOTIFIED 24 HOURS PRIOR TO THE
BEGINNING OF PLUGGING OPERATIONS.**

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Roger D. Brooks TITLE Agent DATE 9/11/06

Type or print name Roger Brooks Telephone No. 505-631-0573
(This space for State use)

APPROVED BY Chris Williams TITLE OC DISTRICT SUPERVISOR/GENERAL MANAGER DATE SEP 11 2006

Conditions of approval, if any

J. Cleo Thompson James Cleo Thompson Jr., L.P.


Proposed P&A - Milnesand Unit #125

Milnesand (San Andres)

1980' INL & 660' FWL, Sec 7, Township 8S, Range 35E, Roosevelt County, NM

Spud 01/09/1963

Ground Level Elevation: 4252' w/ KB @ 4262'

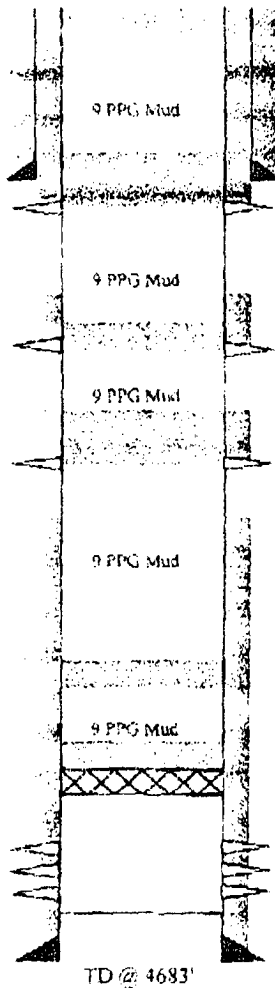

Plug #5: 10 sxs @ surface

Surface String

8-5/8", 24#, J-55 set @ 380'

Cement w/ 250 sxs, TOC @ surface (Circ)

Plug #4: Set pkr @ 280'. Perf & pump 150 sxs @ 440'. Circ. cnt on the backside (Tag)
Perforate @ 430'

Plug #3: Set pkr @ 2150'. Perf & squeeze 80 sxs cnt plug from 2150' to 2250' (Tag)
Perforate @ 2250'

Plug #2: Perf & squeeze 80 sxs cnt plug @ 2750' to 2850' (Tag)
Perforate @ 2750'

Production String

4-1/2", 11.6#, J-55, set @ 4683'

7 7/8" bit to 4683'

Cement w/ 200 sxs neat cnt

TOC: +/- 3800' (Temperature Survey)

Plug #1: Pump 20 sxs plug @ 4127' to 4027' (Tag)

FBTD: CIBP set @ 4555' w/ 2 sacks of cement on top

San Andres

Perfs: 4591' - 4662'