


Submit 3 Copies To Appropriate District

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised May 08, 2003

District I
1625 N. French Dr., Hobbs, NM 87240
District II
1301 W. Grand Ave., Artesia, NM 88201
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

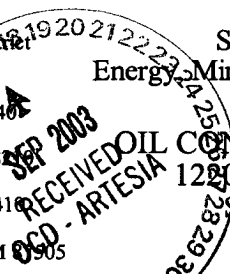

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30.015.00724
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: Empire Abo Unit "I"
8. Well No. 16
9. OGRID Number 00778
10. Pool name or Wildcat Empire Abo

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other	7. Lease Name or Unit Agreement Name: Empire Abo Unit "I"
2. Name of Operator BP America Production Company	8. Well No. 16
3. Address of Operator P.O. Box 1089 Eunice NM 88231	9. OGRID Number 00778
4. Well Location Unit Letter A : 330 feet from the E line and 990 feet from the N line Section 02 Township 18S Range 27E NMPM County Eddy	10. Pool name or Wildcat Empire Abo

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPLETION ☐
OTHER: ☐	

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒	ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐	
OTHER: ☐	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

TD: 5920' PED: 5728' PERFS: 5444-5786'

08.07.03: MIRUPU. NDWH. NUBOP. Unset pkr & POH w/175 jts 2-3/8" tbg.
08.08.03: RIH w/bit & scraper & 180 jts tbg. Tag. LD 1 jts. & hot oil tbg.
08.12.03: RIH w/sand drill.
08.18.03: PU swivel. Drill plug. Tag @ 5845'. POH.
08.19.03: LD sand bailer. RU wireline & log well.
08.20.03: Perfs as follows w/2 JSPF: 5444-46', 5479-82', 5504-12', 5589-91', 5606-42', 5657-66', 5698-5734', 5772-86' = 236 holes.
08.21.03: Test tbg in hole w/pkr. Set pkr @ 5840'. Spot 7.12 hbbls 15% HCL. PU & set pkr @ 5320'. Pmp 135.7 hbbls 15% HCL w/2% ASOL & paraffin reducer dropping 600 ball sealers. POH.
08.22.03: RIH w/prod. tbg. Set @ 5825'. Waiting on flowline to produce well.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kellie D. Murrish TITLE Sr. Administrative Assistant DATE 09.15.03

Type or print name Kellie D. Murrish Telephone No. 505.394.1649

(This space for State use)

FOR RECORDS ONLY

SEP 18 2003

APPROVED BY _____ TITLE _____ DATE _____
Conditions of approval, if any: