HIGH CAVEKARST 730 FORM APPROVED Form 3160 -3 JUN 29 2007 OCD-ARTESIA OMB No. 1004-0137 Expires March 31, 2007 OCD-ARTESTA UNITED STATES Lease Serial No. R-111-POTASH DEPARTMENT OF THE INTERIOR NM-86024 BUREAU OF LAND MANAGEMENT 6. If Indian, Allotee or Tribe Name PPLICATION FOR PERMIT TO DRILL OR REENTER 7 If Unit or CA Agreement, Name and No. XX DRILL REENTER 8. Lease Name and Well No. X Oil Well Gas Well CYPRESS "34" FEDERAL #5 lb. Type of Well: Single Zone Multiple Zone 35899 Name of Operator 9. API Well No. (RICHARD WRIGHT 432-685-8140) POGO PRODUCING COMPANY 30-015-35693 3b. Phone No. (include area code) 3a. Address P.O. BOX 10340. 10. Field and Pool, or Exploratory MIDLAND, TEXAS 79702-7340 432-685-8100 CEDAR CANYON-BONE: SPRING 4. Location of Well (Report location clearly and in accordance with any State requirements.*) 11. Sec., T. R. M. or Blk. and Survey or Area At surface 990' FNL & 1690' FWL SECTION 34 T23S-R29E EDDY CO. SECTION 34 T23S-R29E EOH 330' FNL & 330' FEL SEC.34 At proposed prod. zone Horizontal hole 12. County or Parish 13. State 4. Distance in miles and direction from nearest town or post office* Approximately 9 miles East Southeast of Loving New Mexico New Mexico EDDY CO. 5. Distance from proposed 16. No. of acres in lease 17. Spacing Unit dedicated to this well location to nearest property or lease line, ft. 990 1600 (Also to nearest drig, unit line, if any) 19. Proposed Depth TVD-8025 20. BLM/BIA Bond No. on file 3. Distance from proposed location* to nearest well, drilling, completed, 500' NATION WIDE WYB-000238 applied for, on this lease, ft. MD-11,0981 Elevations (Show whether DF, KDB, RT, GL, etc.) 23. Estimated duration 22. Approximate date work will start* 3048' WHEN APPROVED 42-48 Days to drill 24. Attachments e following, completed in accordance with the requirements of Onshore Oil and Gas Order No. 1, shall be attached to this form: Well plat certified by a registered surveyor. 4. Bond to cover the operations unless covered by an existing bond on file (see Item 20 above). A Drilling Plan. A Surface Use Plan (if the location is on National Forest System Lands, the 5. Operator certification SUPO shall be filed with the appropriate Forest Service Office). Such other site specific information and/or plans as may be required by the authorized officer. Name (Printed Typed) Signatu Date Joe T. Janica 04/22/07 roved by (Signature) Linda S. C. Rundell Name (Printed Typed) Date JUN 1 4 2007 /s/ Linda S. C. Rundell Office STATE DIRECTOR NM STATE OFFICE oplicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to If earthen pits are used in NTROLLED WATER RASIN APPROVAL FOR TWO YEARS issociation with the drilling of this make it a crime for any person knowingly and willfully to make to any department or agency of the United vell, an OCD pit permit must be entations as to any matter within its jurisdiction. btained prior to pit construction.

SEE ATTACHED FOR CONDITIONS OF APPROVAL

APPROVAL SUBJECT TO GENERAL REQUIREMENTS AND SPECIAL STIPULATIONS ATTACHED DISTRICT I
1825 N. French Dr., Hobbs, NM 88240
DISTRICT II
1301 W. Grand Avenue, Artesia, NM 88210

1000 Rio Brazos Rd., Aztec, NM 87410

1220 S. St. Francis Dr., Santa Fe, NM 87505

DISTRICT III

DISTRICT IV

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-102 Revised October 12, 2005

Submit to Appropriate District Office

State Lease - 4 Copies Fee Lease - 3 Copies

OIL CONSERVATION DIVISION

1220 South St. Francis Dr. Santa Fe, New Mexico 87505

☐ AMENDED REPORT

WELL LOCATION AND ACREAGE DEDICATION PLAT

API Number	Pool Code		
	11520	CEDAR CANYON-BONE SPRING	
Property Code 35899	CYPRESS	Well Number 5H	
0GRID No. 17891		perator Name DUCING COMPANY	Elevation 3048'


Surface Location


UL or lot No	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
С	34	23 S	29 E		990	NORTH	1690	WEST	EDDY

Bottom Hole Location If Different From Surface

UL or lot No.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
A	34	23 S	29 E		330	NORTH	330	EAST	EDDY
Dedicated Acres Joint or Infill Consolidation (Code Or	der No.						
120									

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

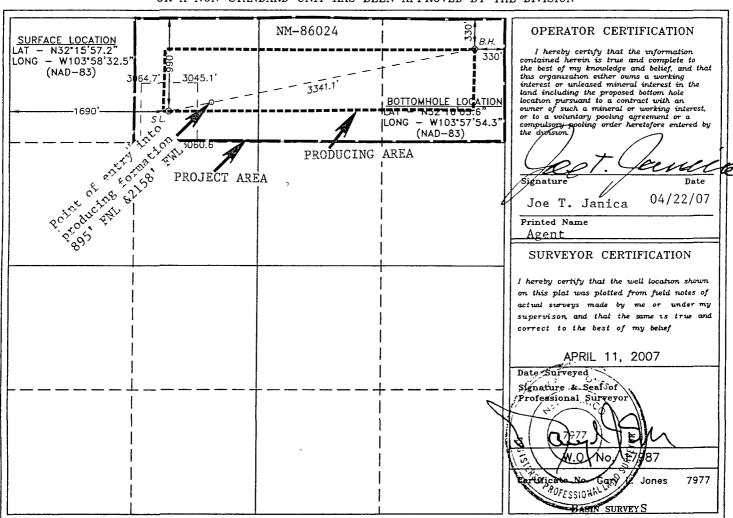

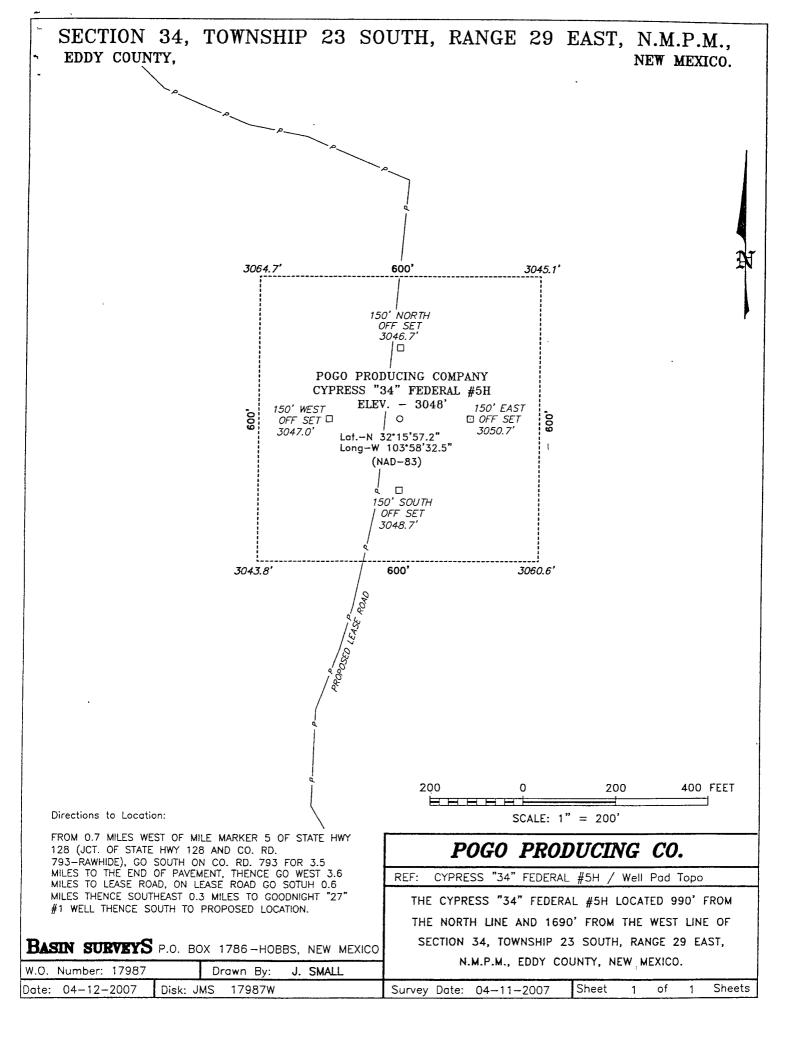

SURFACE CASING:

17 ½" HOLE DRILLED W/ FRESH WATER. SET 13 3/8" 48 # H-40 CASING @ 550 ft. CMT'D W/ 450 SKS 65:35:6 (C:POZ:GEL) TAILED W/ 200 SKS "C" W/ 2% CACL2. CMT CIRCULATED TO SURFACE.

INTERMEDIATE CASING:

NIPPLE UP 3K BOP EQUIPMENT

11" HOLE DRILLED W/ BRINE WATER. SET 9 5/8" CASING @ 3000'. CMT W/ 800 SKS 65:35:6 (C:POZ:GEL) + 5% NACL. TAILED W/ 200 SKS "C" W/ 2% CACL2. CMT CIRCULATED TO SURFACE. CMT LEAD SLURRY ADJUSTED AFTER RUNNING FLUID CALIPER.

CASING PROGRAM = 3000 9 5/8" 36# J-55 LTC

PRODUCTION CASING:

NIPPLE UP 3K BOP EQUIPMENT. DRILL 8 ½" HOLE THROUGH CURVE TO \pm 8123. CHANGE HOLE SIZE TO 7 7/8" & COMPLETE LATERAL TO \pm 11,118'. RUN 5 ½" 17# N-80 CASING TO TOTAL DEPTH. STAGE TOOL @ 4500' & 2500'. CEMENT 1ST STAGE W/ \pm 1800 SKS PREMIUM PLUS MIXED @ 14.1 PPG. 2ND STAGE CMT'D W/ 650 SKS PREMIUM PLUS MIXED @ 14.1 PPG. 3RD STAGE CMT'D W/ 650 SKS PREMIUM PLUS LIGHT FOLLOWED BY 100 SKS PP MIXED @ 14.8 PPG. TOC CIRCULATED. CASING PROGRAM = 5 ½ INCH 17# N-80 LTC & BTC

APPLICATION TO DRILL

POGO PRODUCING COMPANY
CYPRESS "34" FEDERAL # 5
UNIT "C" SECTION 34
T23S-R29E EDDY CO. NM

In response to questions asked under Section II of Bulletin NTL-6, the following information on the above will is provided for your information.

- 1. LOCATION: 990' FNL & 1690' FWL SECTION 34 T23S-R29E EDDY CO. NM
- 2. ELEVATION ABOVE SEA LEVEL: 3048' GL.
- 3. GEOLOGIC NAME OF SURFACE FORMATION: Quaternery Aeolian Deposits.
- 4. DRILLING TOOLS AND ASSOCIATED EQUIPMENT: Conventional rotary drilling rig using drilling mud as a circulating medium for solids removal from hole.
- 5. PROPOSED DRILLING DEPTH: 8025' TVD MD-11,098'

6. ESTIMATED TOPS OF GELOOGICAL MARKERS:

Basal Anhydrite	2936'	Brushy Canyon	5288 '
Delaware Lime	3160'	Bone Spring	6918 '
Delaware Sand	3190'	lst Bone Spring Sd.	7917 '
Cherry Canyon	4040 '	lst Bone Spring Pay	8025

7. POSSIBLE MINERAL BEARING FORMATION:

Brushy Canyon 0il
Bone Spring 0il

8. CASING PROGRAM:

Hole Size	Interval	OD of Casing	Weight	Thread	Colla	r Grade
26"	0-40	20"	NA	ŅA	NA	Conductor
17½"	0-5501	13 3/8"	48#	8-R	ST&C	H-40
12111	0-3000'	9 5/8"	36#	8-R	ST&C	J-55
81177 7/81	0-8123/11,098	5111	17#	8-R	LT&C/BTC	08-и

APPLICATION TO DRILL

POGO PRODUCING COMPANY
CYPRESS "34" FEDERAL # 5
UNIT "C" SECTION 34
T23S-R29E EDDY CO. NM

20"	Conductor	Set 40' of 20" conductor pipe and cement to surface with Redi-mix.
13 3/8"	Surface	Set 550' of 13 3/8" 48# H-40 ST&C casing. Cement with 450 Sx. of 65/35 Class "C" POX/GEL, tail in with 200 Sx. Class "C" cement + additives, circulate cement to surface.
9 5/8"	Intermediate	Set 3000' of 9 5/8" $36\#$ J-55 ST&C casing. Cement with 800 Sx. of 65/35/6 Class "C" POZ/GEL + 5% NaCl, tail in with 200 Sx. of Class "C" cement + 2% CaCl, $+\frac{1}{4}\#$ Flocele /Sx. Circulate cement to surface.
5½"	Production .	Set 11,098" of 5½" 17# N-80 LT&C & BTC casing. Cement in 3 stages with DV Tools at 4500±' & 2500±'. Cement 1st stage with 1800 Sx. of Premium Plus cement mixed @ 14.1 PPG, cement 2nd stage with 650 Sx. of Premium Plus cement mixed @ 14.1PPG, cement 3rd stage with 650 Sx. of Premium Plus cement Plus cement, tail in with 100 Sx. of premium Plus cement mixed @ 14.8 PPG, circulate cement to surface.

10. PRESSURE CONTROL EQUIPMENT: Exhibit "E" shows a 900 series 3000 PSI working perssure B.O.P. consisting of an annular bag type preventor, middle blind rams, and bottom pipe rams. The B.O.P. will be nippled up on the 13 3/8" casing and tested to API specifications. The B.O.P. will be operated at least once each 24 Hr. period and the blind rams will be operated when the drill pipe is out of on trips. Full opening stabbing valve and upper kelly cock will be available in case if needed. Exhibit "E-1" shows a hydraulically operated closing unit and a 3" 3000 PSI choke manifold with adjustable chokes. No abnormal pressures or temperatures are expected while drilling this well. No problems in offset wells.

11. PROPOSED MUD CIRCULATING SYSTEM:

DEPTH	MUD WI.	VISC.	FLUID LOS	S TYPE MUD SYSTEM
40-550 '	8.4-8.7	29-32	NC	Fresh water Spud mud use paper to control seepage
550-3000'	10.0-10-2	29-36	NC	Brine water use paper to control seepage, and high viscosity sweeps to clean hole.
3000-11,098	9.6-10.0	32-40	NC*	Cut Brine use high viscosity sweeps to clean hole. If WL is required to maintain hole go to a Polymer mud system to control water loss

^{*} Water Loss may have to be controlled in order to run casing, run logs and any jests.

Sufficient mud materials will be kept on location at all times in order to combat lost circulation, or unexpected kicks. In order to run DST's, open hole logs, and casing, viscosity, and water loss may have to be adjusted to meet these needs.

APPLICATION TO DRILL

POGO PRODUCING COMPANY
CYPRESS "34" FEDERAL # 5
UNIT "C" SECTION 34
T23S-R29E EDDY CO. NM

12. LOGGING, CORING, AND TESTING PROGRAM:

- A. Open hole logs: Run Dual Laterolog, CNL, LDT, Gamma Ray, Caliper from 7550'± back to 9 5/8" casing shoe. Run Gamma Ray, Neutron from 9 5/8" casing shoe back to surface.
- B. No DST's or cores are planned at this time.
- C. Mud logger will be rigged up on hole at 6900't.

13. POTENTIAL HAZARDS:

No abnormal pressures or temperatures are expected. There is no known presence of $\rm H^2S$ in this area. If $\rm H^2S$ is encountered the operator will comply with the provisions of Onshore Oil and Gas Order No. 6. No lost circulation is expected to occur. All personnel will be familiar with all aspects of safe operation of equipment being used to drill this well. Estimated BHP 3800 PSI, and Estimated BHT 180°.

14. ANTICIPATED STARTING DATE AND DURATION OF OPERATION:

Road and location construction will begin after the BLM has approved the APD. Anticipated spud date will be as soon after BLM approval and as soon as a rig will be available. Move in operation and drilling is expected to take 40-45 days. If production casing is run then an additional 30 days will be needed to complete well and construct surface facilities and/or lay flowlines in order to place well on production.

15. OTHER FACETS OF OPERATIONS:

After running casing, cased hole Gamma Ray, Neutron Collar logs will be run from TD back to all possible productive zones. The <u>Bone Spring</u> formation will be perforated and stimulated in order to establish production. The well will be swab tested and potentialed as an oil well.


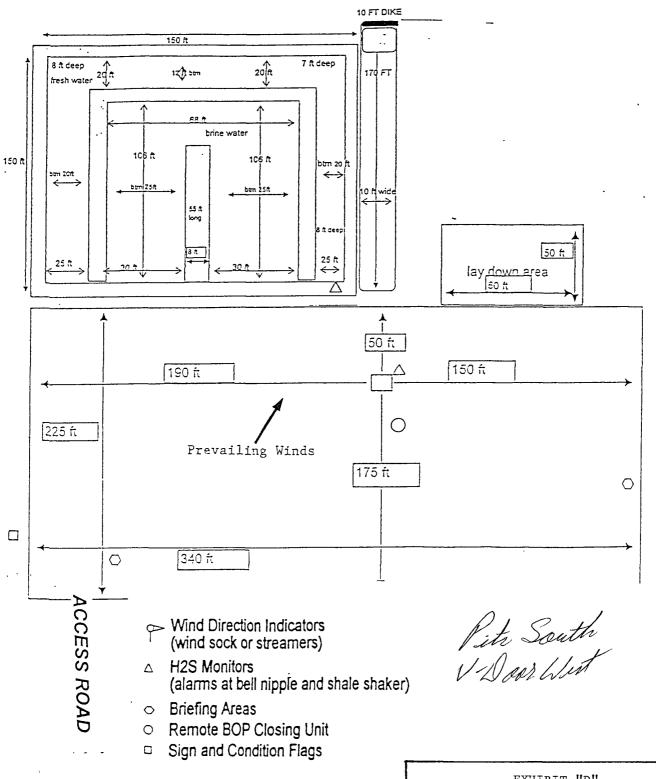


EXHIBIT "D"
RIG LAY OUT PLAT

POGO PRODUCING COMPANY
CYPRESS "34" FEDERAL #5H
UNIT "C" SECTION 34
T23S-R29E EDDY CO. NM

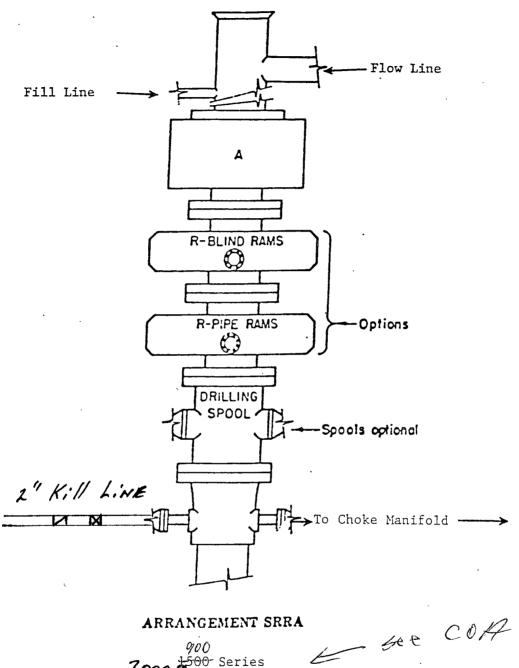

3000 \$500 Series _5000# Working Pressure

> EXHIBIT "E" SKETCH OF B.O.P. TO BE USED ON

POGO PRODUCING COMPANY CYPRESS "34" FEDERAL #5H UNIT "C" SECTION 34 T23S-R29E EDDY CO. NM



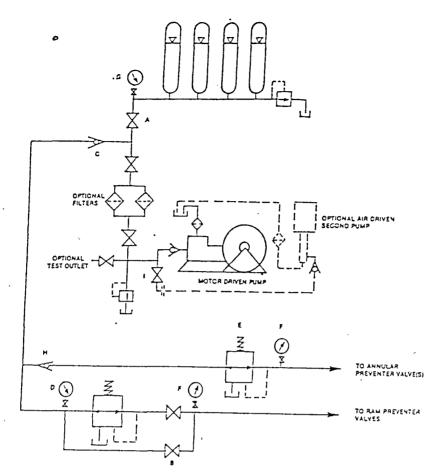


FIGURE K6-1. The schematic sketch of an accumulator system shows required and optional components.

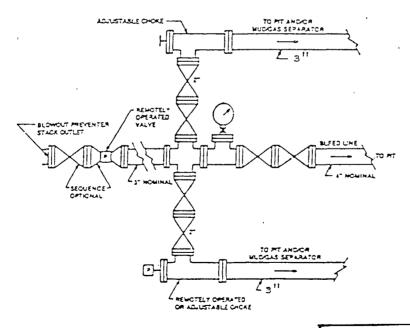


FIGURE X42. Typical choice installation assembly for IM rated work pressure service — surface installation.

bee COA EXHIBIT "E-1"
CHOLE MANIFOLD &CLOSING UNIT

POGO PRODUCING COMPANY
CYPRESS "34" FEDERAL #5H
UNIT "C" SECTION 34
T23S-R29E EDDY CO. NM

HYDROGEN SULFIDE DRILLING OPERATIONS PLAN

- 1. All Company and Contract personnel admitted on location must be trained by a qualified H₂S safety instructor to the following:
 - A. Characteristics of H₂S
 - B. Physical effects and hazzards
 - C. Proper use of safety equipment and life support systems.
 - D. Principle and operation of H2S detectors, warning system and briefing areas.
 - E. Evacuation procedure, routes and first aid.
 - F. Proper use of 30 minute pressure demand air pack.
- 2. H₂S Detection and Alarm Systems
 - A. H₂S detectors and audio alarm system to be located at bell nipple, end of blooie line (mud pit) and on derrick floor or doghouse.
- 3. Windsock and/or wind streamers
 - A. Windsock at mudpit area should be high enough to be visible.
 - B. Windsock at briefing area should be high enough to be visible.
 - C. There should be a windsock at entrance to location.
- 4. Condition Flags and Signs
 - A. Warning sign on access road to location.
 - B. Flags to be displayed on sign at entrance to location. Green flag, normal safe condition. Yellow flag indicates potential pressure and danger. Red flag, danger, H2S present in dangerous concentration. Only emergency personnel admitted to location.
- 5. Well control equipment
 - A. See exhibit "E"
- 6. Communication
 - A. While working under masks chalkboards will be used for communication.
 - B. Hand signals will be used where chalk board is inappropriate.
 - C. Two way radio will be used to communicate off location in case of emergency help is required. In most cases cellular telephoned will be available at most drilling foreman's trailer or living quarters.
- 7. Drillstem Testing
 - A. Exhausts will be watered.
 - B. Flare line will be equipped with an electric ignitor or a propane pilot light in case gas reaches the surface.
 - C. If location is near any dwelling a closed D.S.T. will be performed.

HYDROGEN SULFIDE DRILLING OPERATIONS PLAN

- 8. Drilling contractor supervisor will be required to be familiar with the effects H_2S has on tubular goods and other mechanical equipment.
- 9. If H_2S is encountered, mud system will be altered if necessary to maintain control of formation. A mud gas seperator will be brought into service along with H_2S scavengers if necessary.



COPYRIGHT 1990 MITCHELL ENGINEERING, PO BOX 1492. GOLDEN, CO, 80402, USA (303) 273 3744

LONG'S METHOD OF SURVEY COMPUTATION

OBLIQUE CIRCULAR ARC INTERPOLATION DISTANCE TABLE

MD OF INTERPOLATION DEPTH, (feet) TVD COORDINATE OF THE DEPTH (feet)

STATION B STATION A

3212.29

0.00

	#N/A	TVD CO	ORDINATE	OF THE DEP				
	#N/A	N/S CO	ORDINATE	OF DEPTH (fe	et)			
	#N/A	EW CO	ORDINATE	OF DEPTH (fe	eet)			
•		l		3 D DISTANCE BE	TWEEN STATION	A AND STATION B	0.00	ft
TΔRI	_E OF SURV	FY STA				•	Calculator =	
STA	ΔMD	INCL	AZIM	MD	TVD	N+/S-	E+/W-	DLS
#	ft	deg	deg	ft	ft	ft	ft	deg/100FT
1	TIE POINT =>	0	0	7548.00	7548.00	0.00	0.00	-
2	100	12	78.55494	7648.00	7647.27	2.07	10.23	12.00
3	100	24	78.55494	7748.00	7742.20	8.19	40.46	12.00
4	100	36	78.55494	7848.00	7828.65	18.09	89.37	12.00
5	100	48	78.55494	7948.00	7902.83	31.35	154.84	12.00
6	100	60	78.55494	8048.00	7961.50	47.37	233.99	12.00
7	100	72	78.55494	8148.00	8002.10	65.47	323.36	12.00
8	100	84	78.55494	8248.00	8022.85	84.84	419.05	12.00
9	50	90	78.55494	8298.00	8025.46	94.74	467.97	12.00
10	100	90	78.55494	8398.00	8025.46	114.59	565.98	0.00
11	100	90	78.55494	8498.00	8025.46	134.43	663.99	0.00
12	100	90	78.55494	8598.00	8025.46	154.27	762.01	0.00
13	100	90	78.55494	8698.00	8025.46	174.11	860.02	0.00
14	100	90	78.55494	8798.00	8025.46	193.96	958.03	0.00
15	100	90	78.55494	8898.00	8025.46	213.80	1056.04	0.00
16	100	90	78.55494	8998.00	8025.46	233.64	1154.05	0.00
17	100	90	78.55494	9098.00	8025.46	253.49	1252.06	0.00
18	100	90	78.55494	9198.00	8025.46	273.33	1350.07	0.00
19	100	90	78.55494	9298.00	8025.46	293.17	1448.09	0.00
20	100	90	78.55494	9398.00	8025.46	313.01	1546.10	0.00
21	100	90	78.55494	9498.00	8025.46	332.86	1644.11	0.00
22	100	90	78.55494	9598.00	8025.46	352.70	1742.12	0.00
23	100	90	78.55494	9698.00	8025.46	372.54	1840.13	0.00
24	100	90	78.55494	9798.00	8025.46	392.38	1938.14	0.00
25	100	90	78.55494	9898.00	8025.46	412.23	2036.16	0.00
26	100	90	78.55494	9998.00	8025.46	432.07	2134.17	0.00
27	100	90	78.55494	10098.00	8025.46	451.91	2232.18	0.00
28	100	90	78.55494	10198.00	8025.46	471.76	2330.19	0.00
29	100	90	78.55494	10298.00	8025.46	491.60	2428.20	0.00
30	100	90	78.55494	10398.00	8025.46	511.44	2526.21	0.00
31	100	90	78.55494	10498.00	8025.46	531.28	2624.22	0.00
32	100	90	78.55494	10598.00	8025.46	551.13	2722.24	0.00
33	100	90	78.55494	10698.00	8025.46	570.97	2820.25	0.00
34	100	90	78.55494	10798.00	8025.46	590.81	2918.26	0.00
35	100	90	78.55494	10898.00	8025.46	610.66	3016.27	0.00
36	100	90	78.55494	10998.00	8025.46	630.50	3114.28	0.00
77	400	2	70 EE 404	44000 00	9025 40	650.24	2242 20	0.00

100

90


78.55494

11098.00

8025.46

CYPRESS WELL GROUPINGS

Sec 34, T-23-S, R-29-E, Eddy County, New Mexico

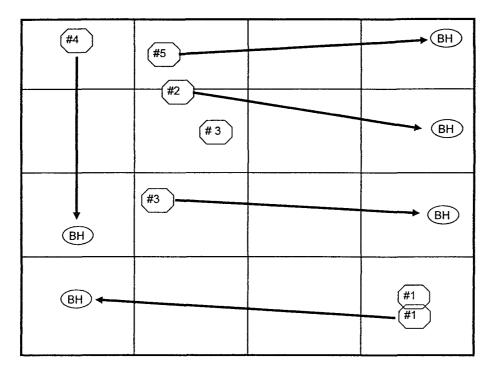

Well Name	Legal Location in 34	Depth and Strata	Current Prod Zone
CYPRESS 34 FD # 5	990 FNL & 1690 FWL	PROPOSED Pogo	1ST BONE SPRINGS
CYPRESS 34 FD # 4	480 FNL & 560 FWL	PROPOSED Pogo	1ST BONE SPRINGS
CYPRESS 34 FD # 3	2100 FSL & 1650 FWL	PROPOSED Pogo	1ST BONE SPRINGS
CYPRESS 34 FD # 1	430 FSL & 660 FEL	BONE SPRINGS HORIZONTAL	1ST BONE SPRINGS
CYPRESS 34 FD # 2	1400 FNL & 1800 FWL	PROPOSED Pogo	N/A
COCHITA 34 FD # 1	660 FSL & 660 FEL	Staked Not Drilled"Devon"	8300 BS ON PERMIT
BLAKEMORE EST FD 3	1980 FNL & 2130 FWL	Staked Not Drilled"EXXON"	7000 BS ON PERMIT

100 PM

POGO PRODUCING COMPANY
CYPRESS "34" FEDERAL # 5
UNIT "C" SECTION 34
T23S-R29E EDDY CO. NM

- 1. EXISTING ROADS & PROPOSED ROADS: Area maps; Exhibit "B" is a reproduction of a County General Hi-way Map. Exhibit "C" is a reproduction of a USGS Topographic Map, showing existing and proposed roads. All existing roads will be maintained in a condition equal to or better than current conditions. Any new roads will be constructed to BLM specifications.
 - A. Exhibit "A" shows the proposed well site as staked.

.

- B. From Hobbs New Mexico take U.S. Hi-wqy 62-180 West toward Carlsbad New Mexico go 42± miles to WIPP Road, turn Left go 13 miles to CR 802 turn Right go 3.7± miles to State Hi-way 128, turn Right go 6± miles to Rawhide Road (CR-793) turn Left go 3.9± miles, turn Left go .3miles, turn Right go .9± miles , turn Left go .3 miles, turn Right follow lease road 2.8± miles, turn Right (West) go 2 miles, bear Left go Northwest go 1.3± miles to Devon Energy well # 2 bear Northeast go .45 miles, turn Left go .5 miles to Pogo Cypress "34" Federal # 1, continue on new lease road Southwest .4 miles turn Northwest go 1+ mile to location.
- C. Powerline and flowline will be follow lease road to the tank battery at Cypress "34" Federal well # 1.
- 2. PLANNED ACCESS ROADS: Approximately 1 mile of new road will be constructed.
 - A. The access roads will be crowned and ditched to a 12' wide travel surface with a 40' Right-of-Way.
 - B, Gradient of all roads will be less than 5.00%.
 - C. If turn-outs are necessary they will be constructed.
 - D. If needed roads will be surfaced with a minimum of 4" of caliche. This material will be obtained from a local source.
 - E. Center-line for new roads will be flagged. Earth-work will be will be done as field conditions require.
 - F. Culverts will be placed in the access road if they are necessary. The roads will be constructed to utilate low water crossings for drainage as required by topography.
- 3. LOCATIONS OF EXISTING WELLS IN A ONE MILE RADIUS. EXHIBIT "A-1"
 - A. Water walls None known
 - B. Disposal wells None known
 - C. Drilling wells None known
 - D. Producing wells As shown on Exhibit "A-1"
 - E. Abandoned wells As shown on Exhibit "A-1"

POGO PRODUCING COMPANY
CYPRESS "34" FEDERAL # 5
UNIT "C" SECTION 34
T23S-R29E EDDY CO. NM

4. If on completion this well is a producer the operator will lay pipelines and construct powerlines along existing road R-O-W's or other existing R-O-W's.

5. LOCATION AND TYPE OF WATER SUPPLY:

Water will be purchased locally from a commercial source and trucked over the access roads or piped to location in flexible lines laid on top of the ground.

6. SOURCE OF CONSTRUCTION MATERIAL:

If possible construction material will be obtained from the excavation of drill site, if additional material is needed it will be obtained from a local source and transported over the access roads as shown on Exhibit "C".

7. METHODS OF HANDLING WASTE MATERIAL:

- A. Drill cuttings will be disposed of in the reserve pits.
- B. All trash, junk and other waste material will be contained in trash cages or trash bins to prevent scattering. When the job is completed all contents will be removed and disposed of in a approved sanitary land fill.
- C. Salts remaining after .completion of well will be picked up by the supplier, including broken sacks.
- D. Waste water from living quaters will be drained into holes with a minium of 10'. These holes will be covered during drilling and will be back filled when the well is completed. A Porto-John will be provided for the rig crews. This equipment will be properly maintained during the drilling and completion operations and will be removed when all operations are complete.
- E. Remaining drilling fluids will be allowed to evaporate in the reserve pits until the pits are dry enough to be broken out for furthed drying. If the drilling fluids do not evaporate in a reasonable time they will be hauled off by transports to a state approve disposal site. Later pips will be broken out to speed drying. Water produced during completion will be put in reserve pits. Oil and condensate produced will be put in storage tanks and sold.

8. ANCILLARY FACILITIES:

A. No camps or air strips will be constructed on location.

POGO PRODUCING COMPANY
CYPRESS "34" FEDERAL # 5
UNIT "C" SECTION 34
T23S-R29E EDDY CO. NM

9. WELL SITE LAYOUT:

- A. Exhibit "D" shows the proposed well site layout.
- B. This Exhibit shows the location of reserve pit, sump pits, and living facilities.
- C. Mud pits in the active circulating system will be steel pits and the reserve pits will be unlined unless subsurface conditions encontered during pit construction indicate that a plastic liner is required to contain lateral migration.
- D. If needed the reserve pits will be lined with polyethelene. The pit liner will be no less than 12 mils thick and the liner will be extended at least 3 feet over the top of the dikes and secured in place to keep edge of liner in place.
- E. The reserve pit will be fenced on three sides and fenced with four strands of barbed wire during drilling and completionphases. The 4th side will be fenced after drilling operations are complete and the drilling rig has moved out. If the well is a producer the mud pits will remain fenced in until the mud has dried up enough to break out the pits and reclaimed according to BLM requirements.

10. PLANS FOR RESTORATION OF SURFACE:

Rehabilitation of the location and reserve pits will be allowed to dry properly, fluids may be moved and disposed of in accordance with article 7-E as previously noted. The pit area will then be leveled and contoured to conform to the original and surrounding area. Drainage systems, if any will be reshaped to the original configuration with provisions made to alleviate furture erosiqu. In case of the well completed as a producer the drilling pad will be necessary to construct production facilities. After the area has been shaped and contoured top soil from the spoil pile will be placed over the disturbed area to the extent possible so that revegetation procedures can be accomplished to comply with the BLM specifications.

If the well is a dry hole the pad and road area will be contoured to match the existing terrain. Top soil will be spread to the extent possible and revegetation will be carried out according to the BLM specifications.

Should the well be a producer the previously noted procedures will apply to those areas which are not required for production facilities.

POGO PRODUCING COMPANY
CYPRESS "34" FEDERAL # 5
UNIT "C" SECTION 34
T23S-R29E EDDY CO. NM

11. OTHER INFORMATION:

- A. Topography consists of a series of ridge/hill slopes at the head of a major drainage trending in a West/Northwest direction. Vegetation consists of yucca, snakeweed, creosote, catclaw, and mesquite. Soils are tan/red loamy silty sands with caliche nodules and lag gravels.
- B. Surface is owned by the U.S. Department of Interior and is administered by the Bureau of Land Management. The surface is leased to ranchers for grazing of live stock.
- C. An archaeological survey will be conducted and the results will be filed with The Bureau of Land Management Carlsbad Field office in Carlsbad NM.
- D. There are no domestic dwellings near this location.

12. OPERATORS REPRESENTIVE:

Before construction:

TIERRA EXPLORATION, INC. P.O. BOX 2188 HOBBS, NEW MEXICO 88241 JOE T. JANICA OFFICE PHONE 505-391-8503

During and after construction:

POGO PRODUCING COMPANY P.O. BOX 10340 MIDLAND, TEXAS 79702-7340 RICHARD WRIGHT OFFICE PHONE 915-685-8140

13. CERTIFICATION: I hereby certify that I or persons under my direct supervision have inspected the proposed drill site and access route, that I am familiar with the conditions which currently exist, that the statements made in this plan are to the best of my knowledge, are true and correct, and that the work associated with the operations proposed herein will be performed by POGO PRODUCING COMPANY it's contractors/subcontractors is in the conformity with this plan and the terms and conditions under which it is approved. This statement is subject to the provision of U.S.C. 1001 for the filing of a false statement.

NAME :Joe T. Janica T. Musica

DATE : 04/22/07

TITLE : Agent

Conditions of Approval Cave and Karst

EA#: NM-080-07-0730 Lease #: NM-86024 Pogo Producing Company Cypress 34 Fed. #3H, #4H & #5H

Cave/Karst Surface Mitigation

The following stipulations will be applied to minimize impacts during construction, drilling and production.

Berming:

Any tank batteries will be constructed and bermed large enough to contain any spills that may occur.

Bermed areas will be lined with rip-stop padding to prevent tears or punctures in liners and lined with a permanent 20 mil plastic liner.

Cave/Karst Subsurface Mitigation

The following stipulations will be applied to protect cave/karst and ground water concerns:

Rotary Drilling with Fresh Water:

Rotary drilling techniques in cave or karst areas will include the use of fresh water as a circulating medium in zones where caves or karst features are expected. Use depth to the deepest expected fresh water as listed in the geologist report.

Directional Drilling:

Kick off for directional drilling will occur at least 100 feet below the bottom of the cave occurrence zone as identified in the geologic report.

Casing

All casing will meet or exceed National Association of Corrosion Engineers specifications pertaining to the geology of the location and be run to American Petroleum Institute and BLM standards.

Lost Circulation:

ALL lost circulation zones from the surface to the base of the cave occurrence zone will be logged and reported.

Regardless of the type of drilling machinery used, if a bit drops of four feet or more and circulation losses greater then 75 percent occur simultaneously while drilling in any cavebearing zone, drilling operations will immediately stop and the BLM will be notified by

the operator. The BLM will assess the consequences of the situation and work with operator on corrective actions to resolve the problem.

Record Keeping:

The Operator will track customary drilling activities, including the rate of penetration, pump pressure, weight on bit, bit drops, percent of mud returns, and presence of absence of cuttings returning to the surface. As part of customary record keeping, each detectable void or sudden increase in the rate of penetration not attributable to a change in the formation type should be documented and evaluated as it is encountered.

CONDITIONS OF APPROVAL - DRILLING

Operator's Name: Pogo Producing Company Well Name & No. 5H-Cypress "34" Federal

Location SHL: 0990 FNL, 1690 FWL, Sec. 34, T-23-S, R-29-E, Eddy County, NM Location BHL: 0330 FNL, 0330 FEL, Sec. 34, T-23-S, R-29-E, Eddy County, NM

Lease: NM-86024

I. DRILLING OPERATIONS REQUIREMENTS:

- A. The Bureau of Land Management (BLM) is to be notified a minimum of 4 hours in advance for a representative to witness:
 - 1. Spudding well
 - 2. Setting and/or Cementing of all casing strings
 - 3. BOPE tests
 - Eddy County call the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220, (505) 361-2822
- B. Although no Hydrogen Sulfide has been reported in the area, it is always a possible hazard.
- C. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
- **D.** Gamma-Ray/Neutron logs shall be run from the base of the Salado formation to the surface. The logs shall be run at a speed which allows the logs to be legible and no faster than manufactures of the logging tools recommended speed. (R-111-P area only)
- E. If floor controls are required, (3M or Greater) controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the dog house or stairway area.

II. CASING:

- A. The 13-3/8 inch surface casing shall be set at 25 feet above the salt, at approximately 550 feet and cemented to the surface.
 - 1. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with a surface log readout will be used or a cement bond log shall be run to verify the top of the cement.
 - 2. Wait on cement (WOC) time for a primary cement job will be a minimum of 12 hours for a non-water basin, 18 hours for a water basin, 24 hours in the potash area, or 500 pounds compression strength, whichever is greater. (This is to include the lead cement)
 - 3. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compression strength, whichever is greater.
 - 4. If cement falls back, remedial action will be done prior to drilling out that string.

Possible lost circulation in the Delaware and Bone Spring formations. High cave/karst area.

- B. The minimum required fill of cement behind the <u>9-5/8</u> inch intermediate casing is cement shall circulate to surface. If cement does not circulate see A.1 thru 4.
- C. The minimum required fill of cement behind the <u>5-1/2</u> inch production casing is cement shall circulate to surface.
- **D.** Whenever a casing string is cemented in the R-111-P potash area, the NMOCD requirements shall be followed.
- E. If hardband drill pipe is rotated inside casing; returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool I joints of the drill pipe will be installed prior to continuing drilling operations.

III. PRESSURE CONTROL: Diagrams are for 5M system, 3M system as described meets minimum requirements.

- A. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2 and API RP 53.
- **B.** Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be **2000 (2M)** PSI.
- C. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the <u>9-5/8</u> intermediate casing shoe shall be 3000 (3M) PSI.
- **D.** The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
 - 1. The tests shall be done by an independent service company.
 - 2. The results of the test shall be reported to the appropriate BLM office.
 - 3. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
 - 4. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi in accordance with API RP 53. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug.

Engineer on call phone: 505-706-2779

WWI 042707