Fo:m 3160-5 (August 1999)

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

FORM APPROVED
OMB NO. 1004-0135
Expires: November 30, 2000

Expires:	November	30,	2

OCD.	5. Lease Serial No.
OCD-A	AMME-\$03671
_	6. If Indian, Allottee or Tribe Name


SUBMIT IN TRIPLICATE -	Other instructions on reverse side	7. If Unit or CA/Agreement, Name and/or No.	
1 m cw u	<u> ქულ 1 0 2000</u>		
1. Type of Well		8. Well Name and No.	
Oil Well X Gas Well Other	OCD-ARTESIA	Highland 25	
2. Name of Operator	1000	Federal	
OXY USA Inc.	16696	9. API Well No.	
3a. Address	3b. Phone No. (include area code)	30-015-31944	
P.O. Box 50250, Midland, TX 79710-		10. Field and Pool, or Exploratory Area	
4. Location of Well (Footage, Sec., T., R., M., or Survey I	Bunting Ranch Atoka		
1900 FNL 1980 FEL SWNE(G) Sec 25 T1	9S R21E		
		11. County or Parish, State	
-		Eddy NM	
12. CHECK APPROPRIATE	BOX(ES) TO INDICATE NATURE OF NOTICE, R	EPORT, OR OTHER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION		
X Notice of Intent	Acıdize Deepen Produ	action (Start/Resume) Water Shut-Off	
	Alter Casing Fracture Treat Recla	mation Well Integrity	
Subsequent Report		mplete Other	
		•	
Final Abandonment Notice	Change Plans X Plug and Abandon Temp	orarily Abandon	
	Convert to Injection Plug Back Water	Disposal	
3/07-CIBP @ 7279' 9-5/8" 36# csg @ 1512' w/ 1140sx,	-7330-7478' SE 12-1/4" hole, TOC-Surf-Circ	EE ATTACHED FOR ONDITIONS OF APPROVAL	
5-1/2" 17# csg @ 8000' w/ 930sx. 1. RIH & tag CIBP @ 7279' M&P 25 2. M&P 25sx cmt @ 6300-6140' 50 3. Cut & Pull 5-1/2" csg @ +/- 4 4. M&P 50sx cmt @ 4900-4750' WOC	sx cmt to 7109' -95-5545 (covers Cisco To 850'	(a)	
M&P 60sx cmt @ 4400-4260' WOC	-Tag	ADDDOVED.	
6. M&P 55sx cmt @ 3400-3270' WOC		APPROVED	
7. M&P 45sx @ 1565-1460' WOC-Tag	Accorded for rocord		
8. M&P 85sx @ 200'-Surface	Accepted for record	10 0000	
10# MLF between plugs	NMOCD	JUL 1 0 2008	
14. I hereby certify that the foregoing is true and correct	Title	JAMES A. AMOS	
Name(Printed/Typed) David Stewart	Sr. Regulatory	SUPERVISOR-EPS	
Duvid Scenario		ruid 1330	
Wa's las	Date 6(24(08		
	SPACE FOR FEDERAL OR STATE OFFICE USE		
Approved by	Title	Date	

Office

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

OXY USA Inc. Highland 25 Federal #1 API No. 30-015-31944

85sx @ 200'-Surface

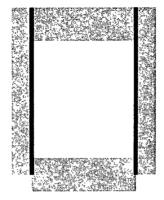

12-1/4" hole @ 1512' 9-5/8" csg @ 1512' w/ 1140sx-TOC-Surf-Circ

45sx @ 1565-1460' WOC-Tag

55sx @ 3400-3270' WOC-Tag

60sx @ 4400-4260' WOC-Tag

50sx @ 4900-4750' WOC-Tag


Cut & Pull 5-1/2" csg @ +/- 4850'

25sx @ 6300-6140'

25sx @ 7279-7109'

3/07-CIBP @ 7279'

8/02-CIBP @ 7750' w/ 35' cmt

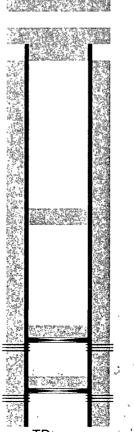

Accepted for record NMOCD

8-3/4" hole @ 8000' 5-1/2" csg @ 8000' w/ 930sx-TOC-4900'

Perfs @ 7330-7478'

Perfs @ 7761-7774'

OXY USA Inc. - Current Highland 25 Federal #1 API No. 30-015-31944

TD-

12-1/4" hole @ 1512' 9-5/8" csg @ 1512' w/ 1140sx-TOC-Surf-Circ

Accepted for record NMOCD

8-3/4" hole @ 8000' 5-1/2" csg @ 8000' w/ 930sx-TOC-4900'

Perfs @ 7330-7478'

Perfs @ 7761-7774'

3/07-CIBP @ 7279'

8/02-CIBP @ 7750' w/ 35' cmt

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>. Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in a cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration conditions of approval will be developed and furnished to you.

Accepted for record NMOCD