

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

OCD-ARTESIA
S

FORM APPROVED
OMB No. 1004-0137
Expires: July 31, 2010

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No.
NM-100524

6. If Indian, Allottee or Tribe Name

SUBMIT IN TRIPLICATE – Other instructions on page 2.

1. Type of Well

☐ Oil Well

☐ Gas Well

☒ Other

DEC 10 2008

2. Name of Operator
Nadel and Gussman Permain L.L.C.

OCD-ARTESIA

7. If Unit of CA/Agreement, Name and/or No.

8. Well Name and No.
Manco Federal #1

3a. Address
601 N. Marnefeld Suite 508
Midland Tx. 79701

3b. Phone No. (include area code)
432-682-4429

9. API Well No.
30-015-35553

10. Field and Pool or Exploratory Area
Little Box Canyon (Upper Penn)

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
UL D 660 FNI and 1240 FWL
S 26, T21S, R21E

11. Country or Parish, State
Eddy, NM

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
☐ Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	☐ Water Shut-Off
☒ Subsequent Report	☐ Alter Casing	☐ Fracture Treat	☐ Reclamation	☐ Well Integrity
☐ Final Abandonment Notice	☐ Casing Repair	☐ New Construction	☐ Recomplete	☐ Other _____
	☐ Change Plans	☒ Plug and Abandon	☐ Temporarily Abandon	
	☐ Convert to Injection	☐ Plug Back	☐ Water Disposal	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

11/14/08 MIRU Mayo Marrs

11/17/08 set cibp @ 4250, circ hole w 10# plugging mud, cap cibp w 25 sxs cmt

11/18/08 set cibp @ 3610, circ w 10# plugging mud, spot 25 sxs on cibp. Spor 25 sxs @ 1617'. WOC and tag @ 1470'. Perf csg @ 630'. Set pkr and pressure up on perfs to 1500 psi. Notify BLM. REI pkr and toh. Spot 25 sxs @ 633'. TOH.


11/19/08 Tag cmt @ 531'. Perf csg @ 60'. and circ 20 sxs to surf. Cut off wellhead and instll PA marker.

Approved as to plugging of the well bore.
Liability under bond is retained until
Surface restoration is completed.

ACCEPTED FOR RECORD

DEC 10 2008

Gerry Guye, Deputy Field Inspector
NMOCD-District II ARTESIA

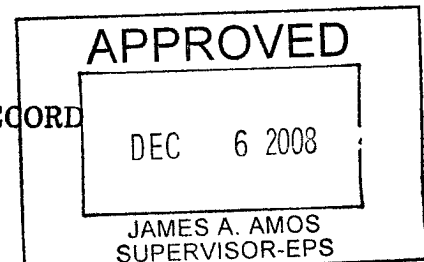

14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed)
Kem E. McCready

Title NM Operations Manager

Signature

Kem E. McCready

Date 11/21/2008

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Title

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

(Instructions on page 2)