
	· · · · · · · · · · · · · · · · · · ·			
Submit 3 Copies To Appropriate District	State of New Mexico		Form C-103	
Office District I 🧽	Energy, Minerals and Natural Ro	esources	June 19, 2008	
1625 N French Dr , Hobbs, NM 88240			WELL API NO.	
<u>District II</u> 1301 W. Grand Ave , Artesia, NM 88210	OIL CONSERVATION DIV	ISION	30-015-23906	
District III	1220 South St. Francis I		5. Indicate Type of Lease	
1000 Rio Brazos Rd, Aztec, NM 87410	Santa Fe, NM 87505	,	STATE FEE 6. State Oil & Gas Lease No.	
District IV 1220 S St Francis Dr., Santa Fe, NM	Santa 1 6, 1411 67565		o. State Off & Gas Lease No.	
87505	EC AND DEPORTS ON WELLS	-	7 Logge Name on Unit Agreement Name	
	ES AND REPORTS ON WELLS LS TO DRILL OR TO DEEPEN OR PLUG BA	CK TO A	7. Lease Name or Unit Agreement Name Platt PA	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH				
PROPOSALS.)	on Wall Co Other		8. Well Number	
	as Well Other		5 9. OGRID Number JAN 2 9 2010	
Name of Operator Yates Petroleum Corporation			005575	
			NMOCD ARTESIA	
3. Address of Operator	. 00210		10. Pool name or Wildcar	
105 South Fourth Street, Artesia, NM	1 88210		Atoka-Yeso	
4. Well Location Unit Letter K: 23	10 feet from the South li	ne and	1650 feet from the West line	
		_		
Section 26	Township 18S Range	26E	NMPM Eddy County	
All the second of the second o	11. Elevation (Show whether DR, RKB)	. RT, GR, etc		
	3313'GR			
10 01 1 4	' A DO A T. I' A NIA	CNT	D (01 D (
12. Check Ap	propriate Box to Indicate Nature	of Notice,	, Report or Other Data	
NOTICE OF INT	ENTION TO:	SUF	SSEQUENT REPORT OF:	
		MEDIAL WOR		
	_	MENCE DR	RILLING OPNS. P AND A	
		SING/CEMEN		
DOWNHOLE COMMINGLE	_		_	
	_		<u>_</u>	
OTHER: Requesting Extension	□ OTH			
			nd give pertinent dates, including estimated date attach wellbore diagram of proposed completion	
or recompletion.	d). SEE ROLE 1103. For Muniple Cor	upicuous. A	tuach wembore diagram of proposed completion	
	ting a 90 day extension for previously a	approved No	tice of Intent to plug and abandon this well	
hich is attached.	ting a 90 day extension for previously a	approved No	tice of Intent to plug and abandon this well	
hich is attached.	ting a 90 day extension for previously a	,		
hich is attached.	ting a 90 day extension for previously a	,		
hich is attached.	ting a 90 day extension for previously a		Notify OCD 24 hrs.	
hich is attached.	ting a 90 day extension for previously a		Notify OCD 24 hrs. ior to any work being	
hich is attached.	ting a 90 day extension for previously a		Notify OCD 24 hrs.	
hich is attached.	ting a 90 day extension for previously a		Notify OCD 24 hrs. ior to any work being	
hich is attached.	ting a 90 day extension for previously a		Notify OCD 24 hrs. ior to any work being done.	
hich is attached.	ting a 90 day extension for previously a		Notify OCD 24 hrs. ior to any work being	
hich is attached.	ting a 90 day extension for previously a	pr	Notify OCD 24 hrs. ior to any work being done. Approval Granted,	
hich is attached.	ting a 90 day extension for previously a	pr pro	Notify OCD 24 hrs. ior to any work being done. Approval Granted, oviding work is complete	
pud Date:	Rig Release Date:	pr pro	Notify OCD 24 hrs. ior to any work being done. Approval Granted,	
,		pr pro	Notify OCD 24 hrs. ior to any work being done. Approval Granted, oviding work is complete	
,		pr pro	Notify OCD 24 hrs. ior to any work being done. Approval Granted, oviding work is complete	
pud Date:	Rig Release Date:	pr pro	Notify OCD 24 hrs. ior to any work being done. Approval Granted, oviding work is complete by 5/4/2010	
pud Date:		pr pro	Notify OCD 24 hrs. ior to any work being done. Approval Granted, oviding work is complete by 5/4/2010	
pud Date: hereby certify that the information ab	Rig Release Date:	pro pro l	Notify OCD 24 hrs. Fior to any work being done. Approval Granted, oviding work is complete by 5/4/2010	
pud Date:	Rig Release Date:	pro pro l	Notify OCD 24 hrs. Fior to any work being done. Approval Granted, oviding work is complete by 5/4/2010	
pud Date: hereby certify that the information about the informati	Rig Release Date: ove is true and complete to the best of TITLE Regulatory Com	pro	Notify OCD 24 hrs. Fior to any work being done. Approval Granted, oviding work is complete by 5/4/2010 ge and belief. Bervisor DATE January 28, 2010	
pud Date: hereby certify that the information ab IGNATURE	Rig Release Date: ove is true and complete to the best of TITLE Regulatory Com	pro	Notify OCD 24 hrs. Fior to any work being done. Approval Granted, oviding work is complete by 5/4/2010 ge and belief. Bervisor DATE January 28, 2010	
pud Date: hereby certify that the information about the informati	Rig Release Date: ove is true and complete to the best of TITLE Regulatory Com E-mail address:tinah@yate	pro pro my knowledge	Notify OCD 24 hrs. For to any work being done. Approval Granted, Eviding work is complete by 5/4/2010 Ge and belief. Bervisor DATE January 28, 2010 Com PHONE: 575-748-4168	
pud Date: hereby certify that the information ab IGNATURE	Rig Release Date: ove is true and complete to the best of TITLE Regulatory Com E-mail address:tinah@yate	pro pro my knowledge	Notify OCD 24 hrs. Fior to any work being done. Approval Granted, oviding work is complete by 5/4/2010 ge and belief. Bervisor DATE January 28, 2010	

Submit 3 Copies To Appropriate District	State of New Mexico	SEP 1 8 2009 Form C-103
Office <u>District I</u>	Energy, Minerals and Natural Resources	
25 N. French Dr., Hobbs, NM 88240		WELL API NO.
District II 1301 W. Grand Ave., Artesia, NM 88210	OIL CONSERVATION DIVISION	30-015-23906
District III	1220 South St. Francis Dr.	5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410	Santa Fe, NM 87505	STATE FEE
District IV 1220 S St. Francis Dr., Santa Fe, NM	Santa re, ivivi 67303	6. State Oil & Gas Lease No.
SINDRY NOT	ICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPO DIFFERENT RESERVOIR. USE "APPLIE	SALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A CATION FOR PERMIT" (FORM C-101) FOR SUCH	Platt PA
PROPOSALS.) 1. Type of Well: Oil Well	Gas Well Other	8. Well Number 5
2. Name of Operator		9. OGRID Number
Yates Petroleum Corporation		025575
3. Address of Operator		10. Pool name or Wildcat
105 South Fourth Street, Artesia, N	TM 88210	Atoka-Yeso
4. Well Location	2210 for from the South line and	1650 foot 6 4. W 1
	2310 feet from the South line and	1650 feet from the West line
Section 26	Township 18S Range 26E	NMPM Eddy County
	11. Elevation (Show whether DR, RKB, RT, GR, 3313'GR	etc.)
Commission of the commission o		
12. Check A	Appropriate Box to Indicate Nature of Noti	ce, Report or Other Data
NOTICE OF IN	ITENTION TO:	UBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON ☑ REMEDIAL W	
TEMPORARILY ABANDON	•	DRILLING OPNS. P AND A
PULL OR ALTER CASING	MULTIPLE COMPL CASING/CEN	
DOWNHOLE COMMINGLE	MOETH EL GOINE GALLING/OLIN	
DOMANOEE COMMINAGEE		*
OTHER:	☐ OTHER:	
13. Describe proposed or comp	OTHER: eleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions.	
 Describe proposed or comp of starting any proposed we or recompletion. 	oleted operations. (Clearly state all pertinent details	
Describe proposed or comp of starting any proposed we or recompletion. Yates Petroleum Corporation plans	oleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows:	
 13. Describe proposed or composed of starting any proposed we or recompletion. Yates Petroleum Corporation plans 1. MIRU all safety equipment as ne 	oleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows:	Attach wellbore diagram of proposed completion
 13. Describe proposed or composed we of starting any proposed we or recompletion. Yates Petroleum Corporation plans 1. MIRU all safety equipment as ne 2. Set a 4-1/2" CIBP at 2661' and composed or composed we or recompletion. 	oleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows:	
 13. Describe proposed or composed we of starting any proposed we or recompletion. Yates Petroleum Corporation plans to the perforations. 	oleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a	Attach wellbore diagram of proposed completion plug from 2321'-2661' across the Glorieta top over
 Describe proposed or composed was or recompletion. Yates Petroleum Corporation plans MIRU all safety equipment as ne Set a 4-1/2" CIBP at 2661' and of the perforations. Circulate hole with salt gel mud. 	oleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows:	Attach wellbore diagram of proposed completion plug from 2321'-2661' across the Glorieta top over
 Describe proposed or composed starting any proposed we or recompletion. Yates Petroleum Corporation plans MIRU all safety equipment as ne Set a 4-1/2" CIBP at 2661' and of the perforations. Circulate hole with salt gel mud. reset if necessary. 	oleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a Spot 25 sx cement plug across the intermediate ca	Attach wellbore diagram of proposed completion plug from 2321'-2661' across the Glorieta top over sing shoe from 1000'-1340'. WOC and tag plug,
 Describe proposed or composed starting any proposed we or recompletion. Yates Petroleum Corporation plans of the perforations. Get a 4-1/2" CIBP at 2661' and of the perforations. Circulate hole with salt gel mudreset if necessary. Spot 25 sx cement plug across the 	oleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a	Attach wellbore diagram of proposed completion plug from 2321'-2661' across the Glorieta top over sing shoe from 1000'-1340'. WOC and tag plug,
 Describe proposed or composed watering any proposed watering and proposed watering. MIRU all safety equipment as not as a 4-1/2" CIBP at 2661' and a the perforations. Circulate hole with salt gel mudices if necessary. Spot 25 sx cement plug across the Cut off wellhead and install dry leading and composed to the perforation. 	oleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a spot 25 sx cement plug across the intermediate case surface casing shoe from 0-300'. WOC and tag proble marker and clean location as per regulated.	Attach wellbore diagram of proposed completion plug from 2321'-2661' across the Glorieta top over sing shoe from 1000'-1340'. WOC and tag plug, plug, reset if necessary.
 Describe proposed or composed watering any proposed watering and proposed watering. MIRU all safety equipment as not as a 4-1/2" CIBP at 2661' and a the perforations. Circulate hole with salt gel mudices if necessary. Spot 25 sx cement plug across the Cut off wellhead and install dry leading and composed to the perforation. 	oleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a Spot 25 sx cement plug across the intermediate care surface casing shoe from 0-300'. WOC and tag p	Attach wellbore diagram of proposed completion plug from 2321'-2661' across the Glorieta top over sing shoe from 1000'-1340'. WOC and tag plug, plug, reset if necessary.
 Describe proposed or composed watering any proposed watering and proposed watering. MIRU all safety equipment as not as a 4-1/2" CIBP at 2661' and a the perforations. Circulate hole with salt gel mudices if necessary. Spot 25 sx cement plug across the Cut off wellhead and install dry leading and composed to the perforation. 	oleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a spot 25 sx cement plug across the intermediate case surface casing shoe from 0-300'. WOC and tag proble marker and clean location as per regulated.	Attach wellbore diagram of proposed completion plug from 2321'-2661' across the Glorieta top over sing shoe from 1000'-1340'. WOC and tag plug, olug, reset if necessary.
 Describe proposed or composed watering any proposed watering and proposed watering. MIRU all safety equipment as not as a 4-1/2" CIBP at 2661' and a the perforations. Circulate hole with salt gel mudices if necessary. Spot 25 sx cement plug across the Cut off wellhead and install dry leading and composed to the perforation. 	oleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a spot 25 sx cement plug across the intermediate case surface casing shoe from 0-300'. WOC and tag proble marker and clean location as per regulated.	Attach wellbore diagram of proposed completion plug from 2321'-2661' across the Glorieta top over sing shoe from 1000'-1340'. WOC and tag plug,
 Describe proposed or composed watering any proposed watering and proposed watering. MIRU all safety equipment as not as a 4-1/2" CIBP at 2661' and a the perforations. Circulate hole with salt gel mudices if necessary. Spot 25 sx cement plug across the Cut off wellhead and install dry leading and composed to the perforation. 	oleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a spot 25 sx cement plug across the intermediate case surface casing shoe from 0-300'. WOC and tag proble marker and clean location as per regulated.	Attach wellbore diagram of proposed completion plug from 2321'-2661' across the Glorieta top over sing shoe from 1000'-1340'. WOC and tag plug, plug, reset if necessary.
13. Describe proposed or composed was or recompletion. Yates Petroleum Corporation plans of the perforations. 1. MIRU all safety equipment as not the perforations. 3. Circulate hole with salt gel mud. reset if necessary. 4. Spot 25 sx cement plug across the cut off wellhead and install dry be not the perforation.	obleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a Spot 25 sx cement plug across the intermediate care surface casing shoe from 0-300'. WOC and tag proble marker and clean location as per regulated. on will use steel pits and no earth pits	Attach wellbore diagram of proposed completion plug from 2321'-2661' across the Glorieta top over sing shoe from 1000'-1340'. WOC and tag plug, plug, reset if necessary.
13. Describe proposed or composed was or recompletion. Yates Petroleum Corporation plans of the perforations. 1. MIRU all safety equipment as not the perforations. 3. Circulate hole with salt gel mud. reset if necessary. 4. Spot 25 sx cement plug across the cut off wellhead and install dry be not the perforation.	obleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a Spot 25 sx cement plug across the intermediate care surface casing shoe from 0-300'. WOC and tag proble marker and clean location as per regulated. on will use steel pits and no earth pits	Attach wellbore diagram of proposed completion plug from 2321'-2661' across the Glorieta top over sing shoe from 1000'-1340'. WOC and tag plug, plug, reset if necessary.
13. Describe proposed or composed we or recompletion. Yates Petroleum Corporation plans to the perforations. 3. Circulate hole with salt gel mud. reset if necessary. 4. Spot 25 sx cement plug across the confidence of the wellhead and install dry to the perforations. NOTE: Yates Petroleum Corporation Spud Date:	soleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a second system of the sys	plug from 2321'-2661' across the Glorieta top over sing shoe from 1000'-1340'. WOC and tag plug, plug, reset if necessary. Moffly OCD 24 hrs. prior work done.
13. Describe proposed or composed we or recompletion. Yates Petroleum Corporation plans to the perforations. 3. Circulate hole with salt gel mud. reset if necessary. 4. Spot 25 sx cement plug across the confidence of the wellhead and install dry to the perforations. NOTE: Yates Petroleum Corporation Spud Date:	obleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a Spot 25 sx cement plug across the intermediate care surface casing shoe from 0-300'. WOC and tag proble marker and clean location as per regulated. on will use steel pits and no earth pits	plug from 2321'-2661' across the Glorieta top over sing shoe from 1000'-1340'. WOC and tag plug, plug, reset if necessary. Moffly OCD 24 hrs. prior work done.
13. Describe proposed or composed we or recompletion. Yates Petroleum Corporation plans to the perforations. 3. Circulate hole with salt gel mud. reset if necessary. 4. Spot 25 sx cement plug across the confidence of the wellhead and install dry to the perforations. NOTE: Yates Petroleum Corporation Spud Date:	soleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a second system of the sys	plug from 2321'-2661' across the Glorieta top over sing shoe from 1000'-1340'. WOC and tag plug, plug, reset if necessary. NOTE OCD 24 hrs. prior work done.
13. Describe proposed or composed starting any proposed we or recompletion. Yates Petroleum Corporation plans of the perforations. Set a 4-1/2" CIBP at 2661' and of the perforations. Circulate hole with salt gel mud. reset if necessary. Spot 25 sx cement plug across the cut off wellhead and install dry leads to the perforation. NOTE: Yates Petroleum Corporation Spud Date:	soleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a Spot 25 sx cement plug across the intermediate care surface casing shoe from 0-300'. WOC and tag proof marker and clean location as per regulated. on will use steel pits and no earth pits Rig Release Date: Rig Release Date: Rig Release Date:	Plug from 2321'-2661' across the Glorieta top over sing shoe from 1000'-1340'. WOC and tag plug, blug, reset if necessary. **Cony work done.** Repervisor DATE September 17, 2009
13. Describe proposed or composed starting any proposed we or recompletion. Yates Petroleum Corporation plans of the perforations. Set a 4-1/2" CIBP at 2661' and of the perforations. Circulate hole with salt gel mud. reset if necessary. Spot 25 sx cement plug across the cut off wellhead and install dry leads to the perforation. NOTE: Yates Petroleum Corporation Spud Date: I hereby certify that the information SIGNATURE Type or print name Tina Hue	soleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a Spot 25 sx cement plug across the intermediate care surface casing shoe from 0-300'. WOC and tag proof marker and clean location as per regulated. on will use steel pits and no earth pits Rig Release Date: Rig Release Date: TITLE Regulatory Compliance Secretary States and States are surface completed.	Plug from 2321'-2661' across the Glorieta top over sing shoe from 1000'-1340'. WOC and tag plug, blug, reset if necessary. **ROMAN OCD 24 hrs. Prior To any work done.** Repervisor DATE September 17, 2009
13. Describe proposed or composed starting any proposed we or recompletion. Yates Petroleum Corporation plans of the perforations. Set a 4-1/2" CIBP at 2661' and of the perforations. Circulate hole with salt gel mud. reset if necessary. Spot 25 sx cement plug across the cut off wellhead and install dry leads to the perforation. NOTE: Yates Petroleum Corporation Spud Date:	soleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a Spot 25 sx cement plug across the intermediate care surface casing shoe from 0-300'. WOC and tag proof marker and clean location as per regulated. In will use steel pits and no earth pits Rig Release Date: TITLE Regulatory Compliance State TITLE Regulatory Compliance State TITLE Regulatory Compliance State Tinah@yatespetroleurons Tita E-mail address: tinah@yatespetroleurons	Plug from 2321'-2661' across the Glorieta top over sing shoe from 1000'-1340'. WOC and tag plug, blug, reset if necessary. **Cony work done.** Cony work
13. Describe proposed or composed starting any proposed we or recompletion. Yates Petroleum Corporation plans of the perforations. Set a 4-1/2" CIBP at 2661' and of the perforations. Circulate hole with salt gel mud. reset if necessary. Spot 25 sx cement plug across the cut off wellhead and install dry leads to the perforation. NOTE: Yates Petroleum Corporation Spud Date: I hereby certify that the information SIGNATURE Type or print name Tina Hue	soleted operations. (Clearly state all pertinent details ork). SEE RULE 1103. For Multiple Completions to plug and abandon this well as follows: eded. ap with 25 sx Class "C" cement. This will place a Spot 25 sx cement plug across the intermediate care surface casing shoe from 0-300'. WOC and tag proof marker and clean location as per regulated. on will use steel pits and no earth pits Rig Release Date: Rig Release Date: Rig Release Date:	Attach wellbore diagram of proposed completion plug from 2321'-2661' across the Glorieta top over sing shoe from 1000'-1340'. WOC and tag plug, blug, reset if necessary. **College Ans. Prior To any work done.** College and belief. September 17, 2009

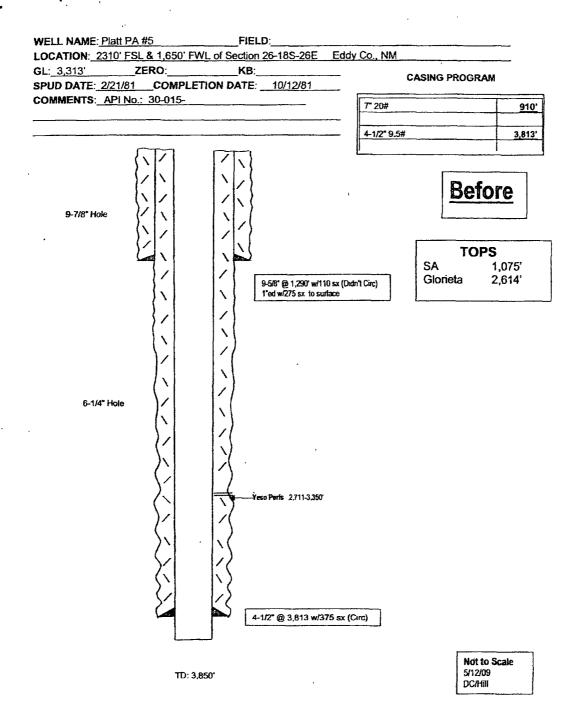

WELL NAME: Platt P	'A #5	FIELD:		
LOCATION: 2310' F	SL & 1,650' FWL o	of Section 26-18S-26E Eddy	Co., NM	
	_ZERO:	KB:	CASING PE	ROGRAM
		N DATE: 10/12/81	GADINO 1 1	
COMMENTS: APIN	lo.: 30-015-	····	7" 20#	910'
		······································	4-1/2" 9.5#	3,813'
		Cmt Plug 0-300		After
9-7/8" Hole		9-5/8" @ 1,290" w/110 sx (Dxdn' 1"ed w/275 sx to surface	t Circ)	TOPS 1,075'
	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	Cmt Plug 1000-1,340' acros cso shoe w/25 sx cmt		
				,
6-1/4° Hole		/		
		CIBP @ 2,661' w/cmt plug fr 2.321-2.661' across Glorieta		
	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	\ \{ \{		
		4-1/2" @ 3,813 w/375 sx (Ci	rc)	
	TD: 3,850°			Not to Scale 5/12/09 DC/Hill