## OCD-ARTESIA



Form 3160-3 (February 2005)				FORM APP OMB No 10	04-0137	ng.	
UNITED STATES DEPARTMENT OF THE I BUREAU OF LAND MAN	5 Lease Serial No. NM 108951	5 Lease Serial No.					
APPLICATION FOR PERMIT TO	6 If Indian, Allotee or	Tribe Na	ime				
la. Type of work.	7 If Unit or CA Agreeme	ent, Nam	e and No				
lb. Type of Well: ☐Oil Well ☐Gas Well ☐Other	Ib. Type of Well: Oil Well Gas Well Other Single Zone Multiple Zone						
2. Name of Operator EOG Resources, Inc.				9. API Well No. 30-015- 377	04		
3a. Address P.O. Box 2267 Midland, TX 79702		o. (mclude area code) 6-3642		10. Field and Pool, or Exp Cottonwood Cree	-	camp West	
4. Location of Well (Report location clearly and in accordance with an At surface 460' FEL & 1760' FSL (U/L I)	y State (reguiren	FERODOX		11 Sec., T R M. or Blk a	nd Surve	ey or Area	
At surface 460' FEL & 1760' FSL (U/L I)  At proposed prod. zone 660' FWL & 1880' FSL (U/L L)	LOC	ATION		Section 26, T16S-	R24E, 1	N.M.P.M.	
14. Distance in miles and direction from nearest town or post office*  Approx 10.0 miles NW of Artesia, NM				12 County or Parish  Eddy	1	3 State NM	
15. Distance from proposed* location to nearest property or lease line, ft.	16. No. of a	acres in lease	ng Unit dedicated to this well sec 26, T16S-R24E, N.M.P.M.				
(Also to nearest drig. unit line, if any)  18. Distance from proposed location* to nearest well, drilling, completed, applied for, on this lease, ft  1140'	19. Propose	Proposed Depth 20. BLM/BIA Bond No. on file NM2308					
21. Elevations (Show whether DF, KDB, RT, GL, etc.) GL 3645'	22. Approxi	mate date work will star	rt*	23 Estimated duration 14			
	24. Atta						
<ol> <li>The following, completed in accordance with the requirements of Onshord</li> <li>Well plat certified by a registered surveyor.</li> <li>A Drilling Plan.</li> <li>A Surface Use Plan (if the location is on National Forest System SUPO must be filed with the appropriate Forest Service Office)</li> </ol>		4 Bond to cover the litem 20 above). 5 Operator certification	he operatio	ns unless covered by an exi		·	
25. Signature J. Ith	Name	(Printed/Typed)  Donny G. Glanton		Da		5/2010	
Title Sr. Lease Operations ROW Representative							
Approved by (Signature) /s/ James Stovall	Name	(Printed/Typed)		M	AR 1	1 5 2010	
FIELD MANAGER	Office	CAR	LSB/	D FIELD OF	FIC	E	
Application approval does not warrant or certify that the applicant hold conduct operations thereon. Conditions of approval, if any, are attached.	ds legal or equ	itable title to those righ		oject lease which would entit PPROVAL FOR		•	
Title 18 U.S.C Section 1001 and Title 43 U.S.C. Section 1212, make it a c States any false, fictitious or fraudulent statements or representations as	rime for any p to any matter	person knowingly and within its jurisdiction.	willfully to r	nake to any department or a	gency of	f the United	
*(Instructions on page 2) 121 harrange of	Ala ada	(D) 11751	MD				

**Roswell Controlled Water Basin** 

SEE ATTACHED FOR CONDITIONS OF APPROVAL **APPROVAL SUBJECT TO** GENERAL REQUIREMENTS, AND SPECIAL STIPULATIONS **ATTACHED** 

District (

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

320

1220 S. St. Francis Dr., Santa Fe, NM 87505

API Number

State of New Mexico

Energy, Minerals & Natural Resources Department

OIL CONSERVATION DIVISION 1220 South St. Francis Dr.

Santa Fe, NM 87505

Form C-102

Revised October 12, 2005

Submit to Appropriate District Office

Pool Name

State Lease 4 Copies


Fee Lease-3 Copies

☐ AMENDED REPORT


WELL LOCATION AND ACREAGE DEDICATION PLAT

		Hamber		ouc	f oor name							
30-015-3704 75aloO Cottonwood (reck Wolfeman uset )						/						
Pro	erty Coe	6		Pro	perty N	lame				Well Number		
37	907	8		PANUC	0 2	6 FED.				ЗН		
00	RID No.			Оре	erator N	Name				Elevation		
737	7		E	OG RESC	OUR	CES, INC	<i>7.</i>			3644.9'		
	Surface Location											
UL or lot no.	Section	Township	Range	L	ot Idn	Feet from the	North/South line	Feet from the	East/West line	County		
I	26	16 SOUTH	24 EAST, N.	М. Р. М.		1760	SOUTH	460	EAST	EDDY		
			Bottom H				t From Sur					
UL or lot no.	Section	Township	Range	L	ot Idn	Feet from the	North/South line	Feet from the	East/West line	County		
$\boldsymbol{L}$	26	16 SOUTH	24 EAST, N.	М. Р. М.		1880	SOUTH	660	WEST	EDDY		
Dedicated	Dedicated Acres Joint or Infill Consolidation Code Order No.											

No allowable will be assigned to this completion until all interests have been consolidated or a non-standard unit has been approved by the division.

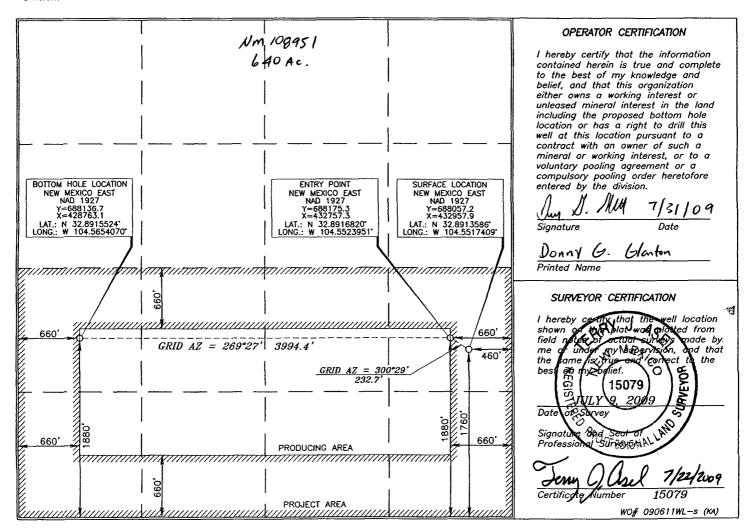

## VICINITY MAP

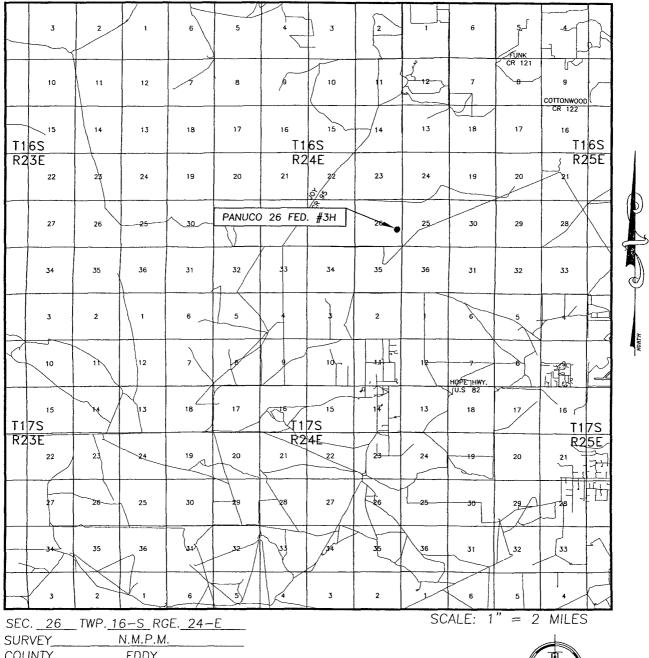

SURVEY N.M.P.M.

COUNTY EDDY

DESCRIPTION 1760' FSL & 460' FEL

ELEVATION 3644.9'


OPERATOR EOG RESOURCES INC.


LEASE PANUCO 26 FED. #3H


Asel Surveying

P.O. BOX 393 - 310 W. TAYLOR HOBBS, NEW MEXICO - 575-393-9146


DIRECTIONS BEGINNING IN ARTESIA AT THE INTERSECTION OF U.S. HWY. #285 AND U.S. HWY. #82, GO WEST ON U.S. HWY. #82 FOR 11.4 MILES, TURN RIGHT ON COUNTY ROAD #95 (JOY ROAD) AND GO NORTH FOR 4.2 MILES, TURN RIGHT AND GO EAST ON CALICHE ROAD FOR 1.8 MILES, TURN RIGHT AND GO SOUTH FOR 0.6 MILES, TURN RIGHT ON PROPOSED NEW ROAD AND GO WEST FOR 110 FEET TO LOCATION.

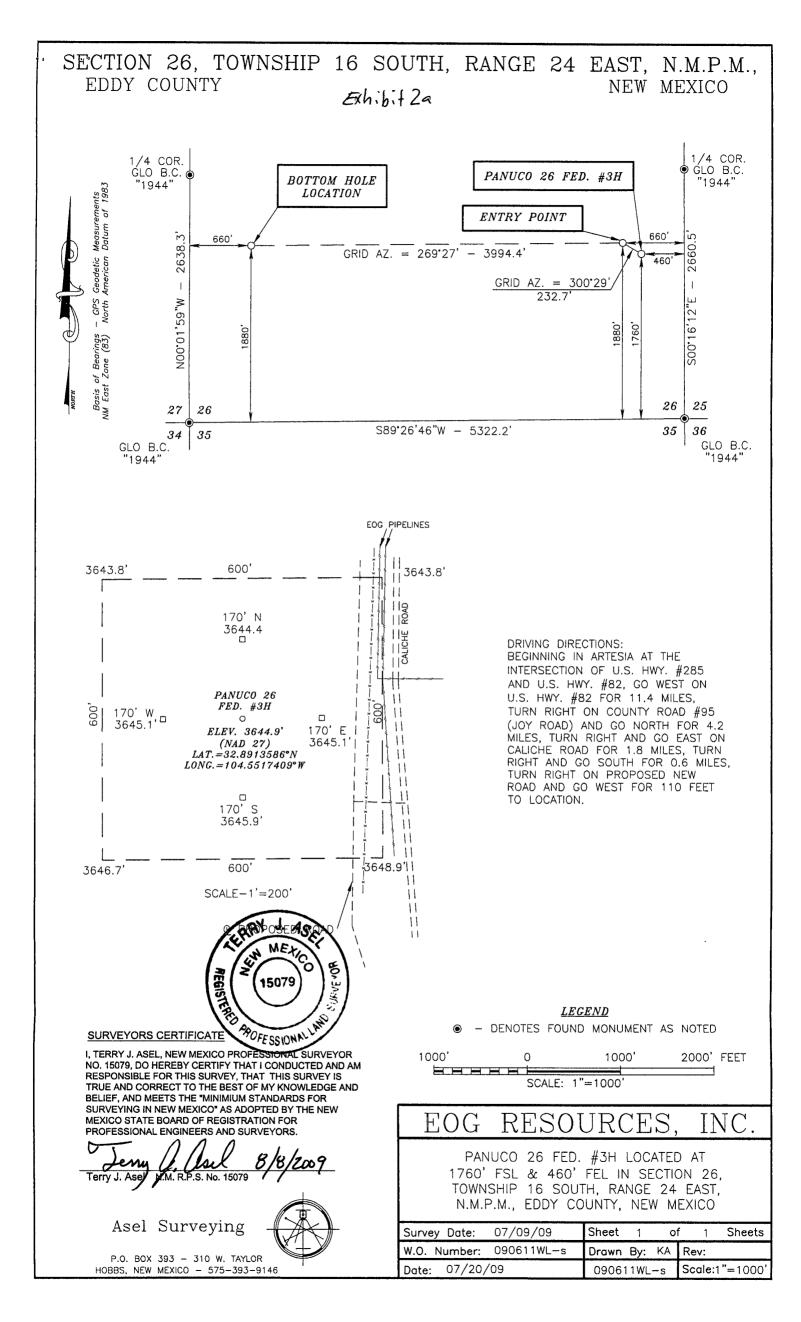

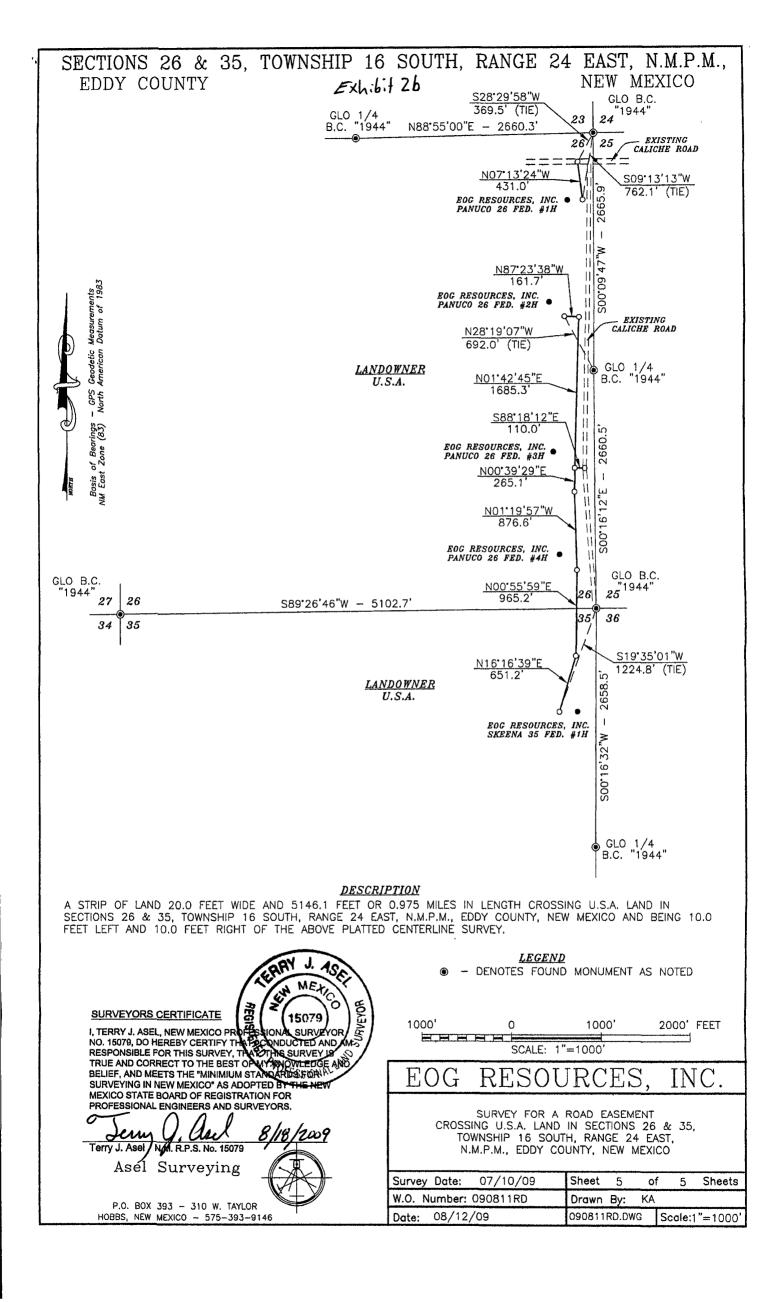

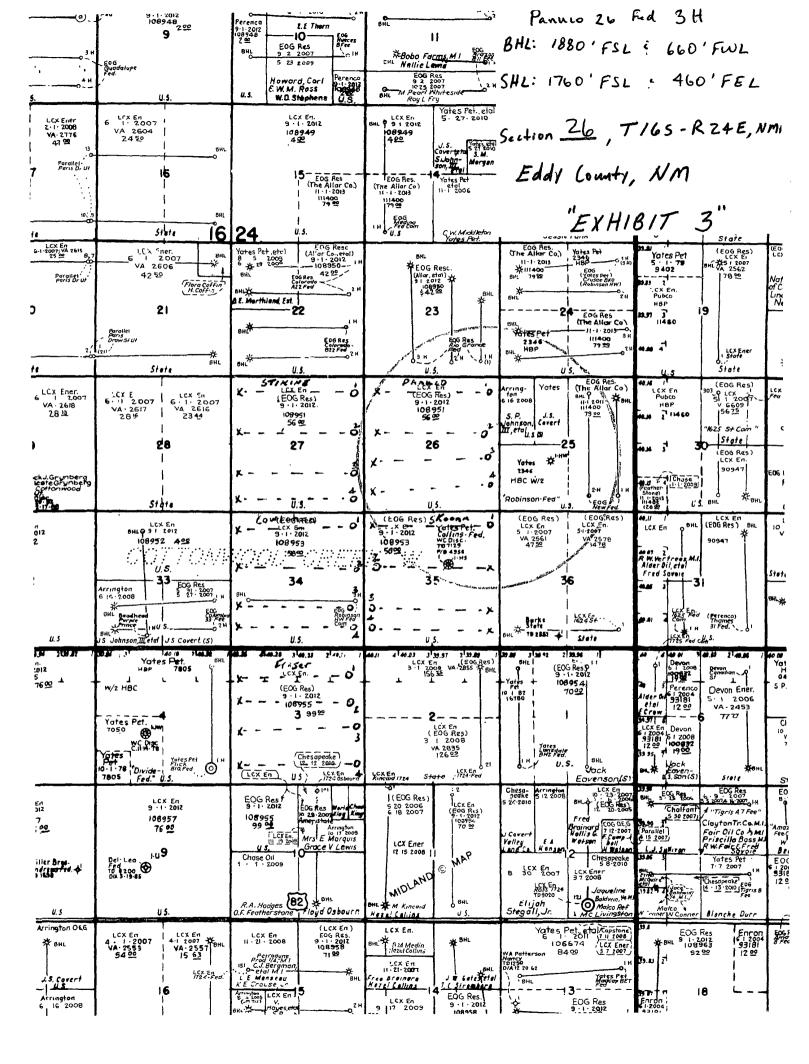

## LOCATION VERIFICATION MAP

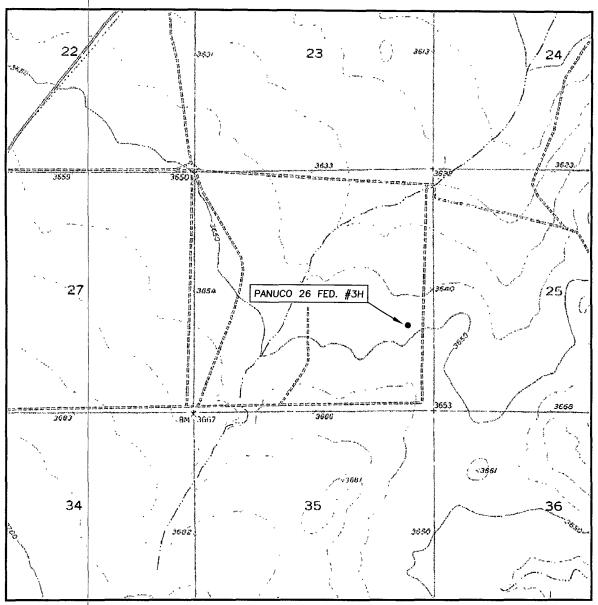

SCALE: 1"  $\frac{1}{7}$  2000'

CONTOUR INTERVAL: 10'

SEC. 26 TV	VP. <u>16-S</u> RGE. <u>24-E</u>
SURVEY	N.M.P.M.
COUNTY	EDDY
DESCRIPTION_	1760' FSL & 460' FEL
ELEVATION	3644.9'
	EOG RESOURCES INC.
LEASEP	NUCO 26 FED. #3H
U.S.G.S. TOPO	DGRAPHIC MAP M.

Asel Surveying

P.O. BOX 393 - 310 W. TAYLOR
HOBBS, NEW MEXICO - 575-393-9146


# Panuco 26 Fed #3H Thames Field Eddy County, New Mexico

1760' FSL 460' FEL Section 26 T-16-S, R-24-E

## **Proposed Wellbore**

API: 30-015-

KB: 3,663.9' GL: 3,644.9'

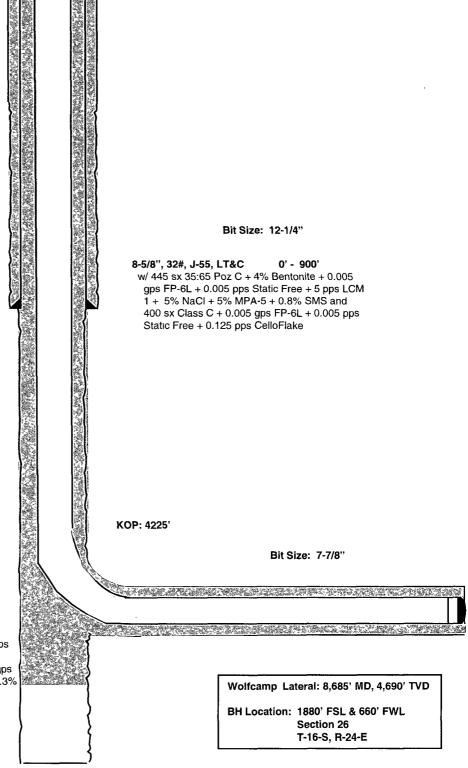

Bit Size: 7-7/8"

5-1/2", 17# , N-80, LT&C @ 8,685'

w 630 sx 50.50 Poz C + 10% Bentonite + 0.005 gps FP-6L + 0.005 pps Static Free +0.125 pps CelloFlake

745 sx 50:50 Poz C + 2% Bentonite + 0.005 gps FP-6L + 0.005 pps Static Free + 5% NaCl + 0.3% FL-52A + 0.2% CD-32 + 0.05% R-3

TVD Vertical Well: 5100'

## **Permit Information:**

Well Name: Panuco 26 Fed #3H

Location:

SL

1760' FSL & 460' FEL, Section 26, T-16-S, R-24-E, Eddy Co., N.M.

BHL

1880' FSL & 660' FWL, Section 26, T-16-S, R-24-E, Eddy Co., N.M.

## **Casing Program:**

Casing	Setting Depth	Hole Size	Casing Size	Casing Weight	Casing Grade	Desired TOC
Surface	900'	12-1/4"	8-5/8"	32#	J-55	Surface
Production	8,685'	7-7/8"	5 1/2"	17#	N-80	Surface

## **Cement Program:**

Depth	No.	Slurries:
	Sacks	
900'	345	Lead: 35:65 Poz C + 4% Bentonite+ 0.005 gps FP-6L + 0.005 pps Static Free + 5 pps LCM-1 + 5% NaCl + 5% MPA-5 + 0.8% SMS
	400	Tail: Class C + 0.005 gps FP-6L + 0.005 pps Static Free + 0.125 pps CelloFlake
8,685'	630	Lead: 50:50 Poz:Class C + 0.005 gps FP-6L + 10% Bentonite + 0.005 pps Static Free + 0.125 pps CelloFlake
	745	Tail: 50:50 Poz:Class C + 2% Bentonite + 0.005 gps FP-6L + 0.005 pps Static Free + 5% NaCl + 0.3% FL-2A + 0.2% CD-32 + 0.05% R-3

**Mud Program:** 

Depth	Туре	Weight (ppg)	Viscosity	Water Loss
0 – 900'	Fresh - Gel	8.6-8.8	28-34	N/c
900' - 4,400'	Cut Brine	8.8-9.2	28-34	N/c
4,400' - 5,100'	Cut Brine	8.6-9.2	28-34	10-15
4,225' - 8,685'	Polymer (Lateral)	8.8-9.4	35-45	10-20

## EOG RESOURCES, INC. PANUCO 26 FED 3H

### 1. GEOLOGIC NAME OF SURFACE FORMATION:

Quaternary Alluvium

0-200

## 2. ESTIMATED TOPS OF IMPORTANT GEOLOGICAL MARKERS:

San Andres	455'
Glorieta	1,745
Tubb ,	3,040°
Abo Shale	3,715'
Wolfcamp Pay	4,640'

## 3. ESTIMATED DEPTHS OF ANTICIPATED FRESH WATER, OIL OR GAS:

Quaternary Alluvium 0- 200'	Fresh Water
San Andres 455'	Oil
Glorieta 1,745'	Oil/Gas
Tubb 3,040'	Oil/Gas
Abo/Wolfcamp Pay 4,640'	Gas

No other Formations are expected to give up oil, gas or fresh water in measurable quantities. Surface fresh water sands will be protected by setting 8.625" casing at 1,200' and circulating cement back to surface.

### 4. CASING PROGRAM - NEW

						Collapse	<u>Burst</u>	<u>Tension</u>		
						<u>Design</u>	Design	<b>Design</b>		
<u>Hole</u>	<u>Interval</u>	OD Csg	Weight	Grade	Conn.	<u>Factor</u>	Factor	<u>Factor</u>		
12.250"	0-900'	8.625"	24# 32	J-55	LT&C	4.76	2.62	7.40		
7.875"	0-8,685	5.5"	17#	N <sub>7</sub> 80	LT&C	3.07	1.29	2.36		
	Per Operator									
			3/8/10	o CRW						

## Cementing Program:

8.625" Surface Casing: Cer

Cement to surface, Lead: 345 sx 35:65 Poz C + 0.005 pps Static Free + 5% NaCl + 5 pps LCM-1 + 0.005 gps FP-6L + 4% Bentonite + 5% MPA-5 + 0.8% SMS,

12.7 ppg, 2.02 yield

Tail: 400 sx Prem Plus C + 0.125 pps CelloFlake + 0.005 FP-6L + 0.005 pps Static Free, 14.8 ppg, 1.33

yield

## EOG RESOURCES, INC. PANUCO 26 FED 3H

5.50" Production Casing: Cement to surface, Lead: 630 sx 50:50 Poz C + 0.005

pps Static Free + 0.125 pps CelloFlake + 0.005 gps FP-

6L + 10% Bentonite, 11.8 ppg, 2.29 yield

Tail: 745 sx 50:50 Poz C + 2% Bentonite + 0.005 gps FP-6L + 0.005 pps Static Free + 5% NaCl + 0.05% R-3 + 0.2% CD-32 + 0.3% FL-52A, 14.2 ppg, 1.30 yield

#### 5. MINIMUM SPECIFICATIONS FOR PRESSURE CONTROL:

(SEE EXHIBIT #1)

The blowout preventer equipment (BOP) shown in Exhibit #1 will consist of a double ram-type (5000 psi WP) preventer and an annular preventer (5000-psi WP). Units will be hydraulically operated and the ram-type will be equipped with blind rams on bottom and drill pipe rams on top. All BOP's and accessory equipment will be tested in accordance with Onshore Oil & Gas order No. 2. for a 3M system

Pipe rams will be operationally checked each 24-hour period. Blind rams will be operationally checked on each trip out of the hole. These checks will be noted on the daily tour sheets.



EOG Resources requests a variance to eliminate the stipulation requiring a BOPE test within 500' of the Wolfcamp. The Wolfcamp is not expected to be abnormally pressured (approx 1,800 lbs.) and the BOPE will be tested to the appropriate pressure requirements as per Onshore Order No. 2 prior to drilling out of the surface casing.

#### 6. TYPES AND CHARACTERISTICS OF THE PROPOSED MUD SYSTEM:

The well will be drilled to TD with a combination of brine, cut brine, and polymer mud system. The applicable depths and properties of this system are as follows:

		Wt	Viscosity	Waterloss
<u>Depth</u>	Type	(PPG)	(sec)	<u>(cc)</u>
0-900'	Fresh – Gel	8.6-8.8	28-34	N/c
900'-4,400'	Cut Brine	8.8-9.2	28-34	N/c
4,400'-5,100'	Cut Brine	8.6-9.2	28-34	10-15
4.225'-8,685'	Polymer (Lateral)	8.8-9.4	35-45	10-20

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept at the wellsite at all times.

## EOG RESOURCES, INC. PANUCO 26 FED 3H

### 7. AUXILIARY WELL CONTROL AND MONITORING EQUIPMENT:

- (A) A kelly cock will be kept in the drill string at all times.
- (B) A full opening drill pipe-stabbing valve (inside BOP) with proper drill pipe connections will be on the rig floor at all times.



### 8. LOGGING, TESTING AND CORING PROGRAM:

Open-hole logging is anticipated in the 7-7/8" production hole. The logging suites for this hole section are listed below:

Electric logging will consist of GR-Dual Laterlog and GR-Compensated Density-Neutron from +/-1,200' to TVD.

Possible sidewall cores based on shows. Possible FMI.

## 9. ABNORMAL CONDITIONS, PRESSURES, TEMPERATURES AND POTENTIAL HAZARDS:

The estimated bottom hole temperature (BHT) at TD is 125 degrees F with an estimated maximum bottom-hole pressure (BHP) at TD of 2000 psig. No hydrogen sulfide or other hazardous gases or fluids have been encountered, reported or are known to exist at this depth in this area. No major loss circulation zones have been reported in offsetting wells.

## 10. ANTICIPATED STARTING DATE AND DURATION OF OPERATIONS:

The drilling operation should be finished in approximately one month. If the well is productive, an additional 30-60 days will be required for completion and testing before a decision is made to install permanent facilities.



## **EOG** Resources, Inc.


Eddy County Panuco 26 Fed #3H OH

Plan: Plan #1

## Pathfinder X & Y Planning Report

11 January, 2010





Pathfinder X & Y Planning Report



Company: EOG Resources: Inc. Project: Eddy County Site:

Panuco 26 Fed Well: #3H Wellbore: ОН Design: Plan #1

Local Co-ordinate Reference

TVD Reference: MD Reference:

North Reference: Survey Calculation Method: Database:

Well #3H

WELL @ 3663,90ft (19' KB) WELL @ 3663.90ft (19 KB)

Grid

Minimum Curvature Midland Database

Eddy County

Map System: US State Plane 1927 (Exact solution) NAD 1927 (NADCON CONUS) Geo Datum:

Map Zone:

New Mexico East 3001

System Datum:

Mean Sea Level

Site Position: From:

Мар

Northing: Easting:

690,872 500 ft 433.129.100 ft Latitude: Lonaitude:

32° 53' 56.753 N 104° 33' 4.327 W

**Position Uncertainty:** 

Well Position

0.00 ft

Slot Radius:

**Grid Convergence:** 

-0.12°

+N/-S 0 00 ft +E/-W

0.00 ft

Northing: Easting:

688.057.200 ft 432,957.900 ft

Latitude: Longitude:

32° 53' 28.891 N 104° 33' 6 267 W 3,644.90 ft

**Ground Level: Position Uncertainty** 0.00 ft Wellhead Elevation:

IGRF2010

Declination (°) 01/11/2010

8.26

60.66

Field Strength

49.045

**Audit Notes:** Version:

Phase:

PLAN

Tie On Depth:

0.00

Vertical Section Depth From (TVD) +E/-W Direction (ft) 0 00 271.09 0.00 0.00

der anticon de como como como como en como en como de c Survey Tool Program Date: 01/11/2010

From To

0.00

Survey (Wellbore) 8,684.79 Plan #1 (OH)

Tool Name

MWD

Description

MWD - Standard



Plan #1

## **Pathfinder Energy Services**

Pathfinder X & Y Planning Report



Design:

Company: EOG Resources, Inc.
Project: Eddy County
Site: Panuco 26 Fed
Well: #3H
Wellbore: OH

Local Co-ordinate Reference:

TVD Reference: MD Reference:

North Reference: Grid Survey Calculation Method: Database:

Well#3H WELL @ 3663.90ft (19' KB) WELL @ 3663:90ft (19' KB)

Planned Survey										
MD (ft)	lnc (°)	Azi (°)	TVD (ft)	TVDSS (ft)	N/S (ft)			DLeg /100ft)	Northing (ft)	Easting (ft)
0.00	0 00	0.00	0 00	-3,663 90	0.00	0 00	0 00	0 00	688,057.20	432,957.90
100 00	0.00	0 00	100 00	-3,563 90	0.00	0.00	0 00	0.00	688,057.20	432,957.90
200 00	0.00	0 00	200 00	-3,463 90	0.00	0.00	0 00	0.00	688,057.20	432,957.90
300.00	0 00	0.00	300.00	-3,363.90	0.00	0.00	0.00	0 00	688,057.20	432,957.90
400.00	0.00	0 00	400.00	-3,263.90	0.00	0 00	0 00	0 00	688,057 20	432,957.90
500 00	0.00	0.00	500 00	-3,163 90	0.00	0.00	0.00	0 00	688,057.20	432,957.90
600 00	0.00	0.00	600.00	-3,063.90	0.00	0.00	0 00	0 00	688,057 20	432,957.90
700.00	0 00	0.00	700 00	-2,963 90	0 00	0.00	0 00	0.00	688,057.20	432,957.90
800.00	0 00	0.00	800 00	-2,863 90	0 00	0.00	0 00	0.00	688,057.20	432,957.90
900 00	0.00	0.00	900.00	-2,763.90	0.00	0.00	0.00	0 00	688,057.20	432,957.90
1,000 00	0.00	0 00	1,000.00	-2,663 90	0 00	0 00	0.00	0.00	688,057 20	432,957.90
1,100 00	0 00	0.00	1,100.00	-2,563.90	0.00	0 00	0.00	0.00	688,057.20	432,957 90
1,200.00	0.00	0.00	1,200.00	-2,463 90	0 00	0 00	0.00	0.00	688,057.20	432,957 90
1,300.00	0 00	0 00	1,300.00	-2,363.90	0.00	0 00	0 00	0.00	688,057.20	432,957 90
1,400.00	0 00	0.00	1,400.00	-2,263.90	0.00	0.00	0 00	0.00	688,057.20	432,957 90
1,500.00	0.00	0 00	1,500 00	-2,163.90	0 00	0.00	0.00	0 00	688,057.20	432,957 90
1,600.00	0.00	0 00	1,600 00	-2,063.90	0 00	0 00	0.00	0.00	688,057.20	432,957 90
1,700.00	0.00	0.00	1,700 00	-1,963.90	0.00	0.00	0 00	0 00	688,057.20	432,957 90
1,800.00	0.00	0.00	1,800 00	-1,863.90	0.00	0 00	, 0 00	0.00	688,057.20	432,957.90
1,900 00	0.00	0.00	1,900 00	-1,763.90	0.00	0.00	0 00	0.00	688,057.20	432,957 90
2,000.00	0 00	0.00	2,000 00	-1,663.90	0 00	0.00	0 00	0.00	688,057.20	432,957 90
2,100.00	0 00	0.00	2,100 00	-1,563.90	0 00	0.00	0 00	0.00	688,057 20	432,957 90
2,200.00	0 00	0.00	2,200 00	-1,463.90	0.00	0.00	0 00	0.00	688,057 20	432,957 90
2,300.00	0.00	0.00	2,300 00	-1,363.90	0 00	0.00	0.00	0.00	688,057 20	432,957.90
2,400.00	0 00	0 00	2,400.00	-1,263.90	0 00	0.00	0.00	0.00	688,057 20	432,957.90
2,500 00	0.00	0.00	2,500.00	-1,163 90	0 00	0.00	0.00	0 00	688,057.20	432,957 90
2,600.00	0 00	0 00	2,600.00	-1,063.90	0 00	0.00	0 00	0.00	688,057.20	432,957 90



Pathfinder X & Y Planning Report



Company: EOG Resources, Inc.
Project: Eddy County
Site: Panuco 26 Fed
Well: #3H
Wellbore: OH
Design: Plan #1:

Local Co-ordinate Reference:

TVD Reference: MD Reference: North Reference: Survey Calculation Method:

Database:

Well#3H

WELL @ 3663.90ft (19' KB) WELL @ 3663.90ft (19' KB)

Grid

Planned Survey										
MD	Inc	Azi	TVD	TVDSS	N/S	E/W	V. Sec	DLeg .	Northing	Easting
(ft)	(°)	(°)	(ft)		(ft)	(ft)	(ft) (°	/100ft)	(ft)	(ft)
2,700 00	0 00	0.00	2,700.00	-963.90	0.00	0.00	0.00	0.00	688,057.20	432,957.90
2,800 00	0 00	0.00	2,800.00	-863.90	0.00	0.00	0.00	0.00	688,057.20	432,957 90
2,900.00	0 00	0.00	2,900.00	-763.90	0 00	0.00	0.00	0.00	688,057 20	432,957.90
3,000.00	0.00	0 00	3,000.00	-663.90	0.00	0.00	0.00	0.00	688,057.20	432,957 90
3,100 00	0.00	0 00	3,100.00	-563.90	0.00	0 00	0.00	0.00	688,057.20	432,957 90
3,200 00	0.00	0 00	3,200 00	-463.90	0.00	0.00	0.00	0.00	688,057.20	432,957 90
3,300.00	0.00	0.00	3,300.00	-363.90	0.00	0.00	0.00	0.00	688,057 20	432,957.90
3,400 00	0 00	0.00	3,400 00	-263 90	0.00	0.00	0.00	0.00	688,057.20	432,957 90
3,500 00	0.00	0.00	3,500 00	-163 90	0.00	0.00	0.00	0.00	688,057.20	432,957 90
3,600.00	0.00	0.00	3,600 00	-63 90	, 0.00	0.00	0.00	0.00	688,057.20	432,957.90
3,700.00	0.00	0.00	3,700 00	36 10	0 00	0.00	0.00	0.00	688,057.20	432,957.90
3,800.00	0.00	0 00	3,800.00	136.10	0 00	0 00	0.00	0.00	688,057.20	432,957 90
3,900 00	0.00	0.00	3,900.00	236.10	0 00	0 00	0 00	0 00	688,057.20	432,957 90
4,000.00	0 00	0 00	4,000.00	336 10	0.00	0.00	0.00	0.00	688,057.20	432,957 90
4,100 00	0.00	0.00	4,100.00	436 10	0.00	0.00	0.00	0.00	688,057.20	432,957.90
4,200.00	0.00	0 00	4,200.00	536.10	0.00	0 00	0.00	0.00	688,057.20	432,957.90
4,212.50	0 00	0.00	4,212.50	548 60	0 00	0 00	0.00	0.00	688,057.20	432,957.90
4,225.00	1 50	277.60	4,225 00	561.10	0.02	-0.16	0.16	12.00	688,057.22	432,957.74
4,250.00	4 50	277.60	4,249 96	586.06	0.19	-1.46	1.46	12.00	688,057.39	432,956.44
4,275 00	7.50	277.60	4,274 82	610.92	0.54	-4.05	4.06	12.00	688,057 74	432,953.85
4,300.00	10.50	277 60	4,299 51	635.61	1.06	-7.92	7 94	12.00	688,058.26	432,949 98
4,325.00	13.50	277.60	4,323 96	660.06	1.74	-13 08	13.11	12.00	688,058.94	432,944.82
4,350 00	16 50	277 60	4,348 11	684.21	2.60	-19.49	19.53	12.00	688,059.80	432,938.41
4,375.00	19.50	277 60	4,371.88	707.98	3.62	-27 14	27 21	12.00	688,060.82	432,930.76
4,400.00	22 50	277 60	4,395 22	731.32	4 81	-36 02	36.11	12.00	688,062 01	432,921 88
4,425.00	25.50	277.60	4,418 05	754.15	6 15	-46 10	46 21	12.00	688,063 35	432,911.80
4,450.00	28.50	277.60	4,440 33	776.43	7.65	-57 35	57 48	12.00	688,064.85	432,900.55



Pathfinder X & Y Planning Report



Company:

EOG Resources, Inc.

Project: Eddy County
Site: Panuco 26 Fed.
Well: #3H
Wellbore: OH
Design: Plan #1

Local Co-ordinate Reference:

TVD Reference: MD Reference:

North Reference: Survey Calculation Method: Database:

Well #3H WELL @ 3663 90ft (19' KB) WELL @ 3663 90ft (19' KB)

Grid\*

The state of the s	ridanskovi in propinskovi diskovi. Dia 7 ridanskovi. A Arani Al-Fadalia	ar francisco africatores como de esperan. Alta Lando esperante esta a ser la como de esperan.						nakur kukrusus (kikuluksi). Oron konskur (kikulo) konsen (kiri	inerija jero podalica praktika. Podalica proposalica	BOX STATEMENT COLORS CONTROL (S)
Planned Survey										
. MD	Inc	Azi	TVD	TVDSS	N/S	E/W	V. Sec	DLeg .	Northing	Easting
(ft)	(°)	(°)	(ft)	(ft)	(ft)	(ft)		/100ft)	(ft)	(ft)
4,475.00	31.50	277.60	4,461 98	798.08	9.30	-69 74	69.90	12 00	688,066 50	432,888.16
4 500 00	34.50	077.00	4.400.04	040.04	44.44	-83 23	83 43	12.00	688,068,31	432,874.67
4,500.00		277 60	4,482.94	819.04	11.11 13.05		98 02	12.00	688,070 25	432,860.11
4,525.00	37.50	277 60	4,503.17	839 27		-97 79				432,860.11
4,550 00	40 50	277 60	4,522 59	858.69	15.13	-113.39	113 65	12 00	688,072.33	,
4,575 00	43 50	277 60	4,541 17	877 27	17.34	-129.96	130 27	12 00	688,074 54	432,827.94
4,600.00	46 50	277.60	4,558 85	894.95	19.68	-147 48	147 83	12 00	688,076 88	432,810 42
4,625.00	49 50	277 60	4,575 57	911 67	22.14	-165.90	166.28	12.00	688,079.34	432,792.00
4,650 00	52.50	277 60	4,591.31	927 41	24.70	-185 15	185 58	12.00	688,081 90	432,772.75
4,675 00	55.50	277.60	4,606.00	942.10	27.38	-205 19	205 68	12 00	688,084 58	432,752.71
4,700 00	58.50	277 60	4,619 62	955.72	30.15	-225.97	226 50	12.00	688,087.35	432,731.93
4,725 00	61.50	· 277 60	4,632.12	968 22	33.01	-247.43	248.01	12.00	688,090 21	432,710.47
4,750.00	64 50	277 60	4,643 47	979 57	35.96	-269 51	270 14	12.00	688,093.16	432,688 39
4,775.00	67 50	277 60	4,653.64	989 74	38.98	-292 14	292 83	12.00	688,096.18	432,665.76
4,800 00	70 49	277.60	4,662 60	998 70	42.07	-315.27	316 01	12.00	688,099 27	432,642 63
4,825 00	73 49	277.60	4,670 32	1,006 42	45 21	-338 84	339.63	12.00	688,102 41	432,619.06
4,850.00	76.49	277.60	4,676 80	1,012.90	48.40	-362.77	363 62	12.00	688,105.60	432,595 13
4,875.00	79.49	277.60	4,682.00	1,018.10	51.64	-387 00	387 91	12.00	688,108.84	432,570.90
4,900.00	82.49	277.60	4,685 91	1,022 01	54.90	-411 48	412.44	12.00	688,112.10	432,546 42
4,925.00	85.49	277.60	4,688.52	1,024 62	58.19	-436 12	437.14	12.00	688,115.39	432,521 78
4,950.00	88.49	277.60	4,689.83	1,025.93	61.49	-460 86	461 94	12.00	688,118 69	432,497.04
4,962 56	90 00	277.60	4,690 00	1,026.10	63.15	-473 31	474.42	12.00	688,120.35	432,484.59
5,000 00	90.00	276.48	4,690.00	1,026.10	67.74	-510.47	511 66	3.00	688,124 94	432,447 43
5,100 00	90.00	273.48	4,690 00	1,026 10	76.41	-610 08	611 42	3 00	688,133 61	432,347 82
5,200.00	90 00	270.48	4,690 00	1,026.10	79.86	-710.01	711.39	3 00	688,137 06	432,247.89
5,216.13	90.00	269.99	4,690 00	1,026.10	79 93	-726.13	727.52	3.00	688,137.13	432,231 77
5,300.00	90 00	269 99	4,690 00	1,026.10	79.92	-810 01	811 38	0 00	688,137 12	432,147 89
5,400 00	90.00	269.99	4,690 00	1,026 10	79 91	-910 01	911 36	0.00	688,137 11	432,047.89



Pathfinder X & Y Planning Report



Company: Project: Site:

EOG Resources, Inc.

Site: Panuco 26 Fed Well: #3H Wellbore: OH Design: Plan #1 Local Co-ordinate Reference:

TVD Reference: MD Reference:

MD Reference: North Reference: Survey Calculation Method: Database: Well #3H

WELL @ 3663.90ft (19' KB) WELL @ 3663.90ft (19' KB)

Grid

Planned Survey										38270.7
MD				100	Nic	EDAL	V	DLeg	Northing	Easting
(ft)	Inc (°)	Azi (°)	·· TVD (ft)	TVDSS (ft)	N/S (ft)	E/W (ft)	V. Sec (ft)	(°/100ft)		(ft)
5,500.00	90.00	269.99	4,690.00	1,026.10	79 89	-1,010 01	1,011.34	0.00	688,137.09	431,947.89
5,600.00	90.00	269.99	4,690.00	1,026 10	79.88	-1,110 01	1,111.32	0 00	688,137 08	431,847 89
5,700.00	90 00	269.99	4,690.00	1,026.10	79.87	-1,210 01	1,211.30	0.00	688,137 07	431,747 89
5,800 00	90.00	269 99	4,690.00	1,026.10	79 86	-1,310.01	1,311 29	0 00	688,137.06	431,647.89
5,900 00	90.00	269 99	4,690.00	1,026.10	79.84	-1,410.01	1,411 27	0.00	688,137 04	431,547.89
6,000 00	90.00	269 99	4,690.00	1,026.10	79.83	-1,510.01	1,511.25	0.00	688,137 03	431,447.89
6,100.00	90 00	269.99 .	4,690.00	1,026.10	79.82	-1,610 01	1,611 23	0.00	688,137 02	431,347.89
6,200.00	90.00	269 99	4,690.00	1,026.10	79.81	-1,710 01	1,711 21	0.00	688,137.01	431,247.89
6,300 00	90.00	269.99	4,690.00	1,026.10	79.80	-1,810 01	1,811.19	0.00	688,137.00	431,147.89
6,400.00	90 00	269.99	4,690.00	1,026 10	79.78	-1,910 01	1,911 18	0.00	688,136 98	431,047.89
6,500.00	90 00	269.99	4,690.00	1,026 10	, 79 77	-2,010.01	2,011 16	0.00	688,136 97	430,947.89
6,600.00	90.00	269 99	4,690.00	1,026 10	79.76	-2,110 01	2,111.14	0 00	688,136 96	430,847 89
6,700.00	90 00	269.99	4,690.00	1,026 10	79.75	-2,210 01	2,211 12	0.00	688,136 95	430,747.89
6,800.00	90.00	269 99	4,690 00	1,026 10	79 73	-2,310.01	2,311 10	0.00	688,136.93	430,647.89
6,900.00	90.00	269.99	4,690 00	1,026 10	79 72	-2,410.01	2,411.09	0 00	688,136 92	430,547.89
7,000 00	90.00	269.99	4,690.00	1,026 10	79.71	-2,510.01	2,511.07	0 00	688,136.91	430,447.89
7,100.00	90 00	269.99	4,690 00	1,026 10	79.70	-2,610.01	2,611.05	0 00	688,136.90	430,347.89
7,200.00	90 00	269.99	4,690.00	1,026.10	79 68	-2,710 01	2,711 03	0.00	688,136 88	430,247 89
7,300.00	90 00	269.99	4,690.00	1,026.10	79.67	-2,810.01	2,811.01	0 00	688,136 87	430,147.89
7,400.00	90 00	269 99	4,690.00	1,026.10	79 66	-2,910.01	2,910 99	0 00	688,136 86	430,047.89
7,500 00	90 00	269.99	4,690.00	1,026.10	79.65	-3,010.01	3,010.98	0 00	688,136 85	429,947.89
7,600.00	90 00	269.99	4,690 00	1,026 10	79 63	-3,110.01	3,110 96	0.00	688,136.83	429,847.89
7,700.00	90 00	269 99	4,690 00	1,026 10	79 62	-3,210.01	3,210.94	0.00	688,136.82	429,747.89
7,800.00	90.00	269.99	4,690.00	1,026.10	79 61	-3,310.01	3,310 92	0.00	688,136 81	429,647.89
7,900.00	90.00	269 99	4,690 00	1,026.10	79 60	-3,410.01	3,410.90	0.00	688,136.80	429,547.89
8,000.00	90.00	269.99	4,690.00	1,026.10	79 58	-3,510.01	3,510 89	0.00	688,136 78	429,447.89
8,100.00	90.00	269 99	4,690.00	1,026.10	79.57	-3,610.01	3,610 87	0.00	688,136 77	429,347.89



Pathfinder X & Y Planning Report



Company: Project:

EOG Resources, Inc. Eddy County

Site: Panuco 26 Fed Well: #3H Wellbore: OH Design: Plan #1

Local Co-ordinate Reference:

TVD Reference: MD Reference:

North Reference: Survey Calculation Method:

Database:

Well #3H WELL @ 3663 90ft (19' KB) WELL @ 3663.90ft (19' KB)

Grid

Minimum Curvature

Midland Database

MD	Inc	Azi	TVD	TVDSS	N/S	E/W	V. Sec	DLeg	Northing	Easting
(11)	·(°)	(')	/ (π)	(ft)	· , (ft):	(π)	(ft).	(°/100ft)	(ft)	
8,200.00	90.00	269.99	4,690.00	1,026 10	79 56	-3,710.01	3,710 85	0.00	688,136.76	429,247.89
8,300.00	90 00	269.99	4,690 00	1,026 10	. 79 55	-3,810 01	3,810.83	0.00	688,136.75	429,147.89
8,400.00	90 00	269.99	4,690 00	1,026 10	79 54	-3,910 01	3,910.81	0.00	688,136.74	429,047.89
8,500 00	90 00	269 99	4,690.00	1,026 10	79 52	-4,010 01	4,010 79	0 00	688,136 72	428,947.89
8,600.00	90.00	269 99	4,690.00	1,026 10	79 51	-4,110 01	4,110.78	0 00	688,136.71	428,847.89
8,684.79	90.00	269.99	4,690.00	1,026 10	79.50	-4,194 80	4,195 55	0 00	688,136.70	428,763 10
PBHE(PAN#3H),		Stanier			了到1883 AND	and the second	and will be the	Part of State and the	4.500	• • • • •

Tärget: Tärget:Name ":hit/miss:target: Dip/ ::Shape (	Angle	Dip Dir. (2)	TVD (ft)	+N/-S (ft)	+E/-W (fi)	Northing (ft)	Easting '(ft)'	Latitude	Longitude
PBHL(PAN#3H) - plan hits target center - Point	0 00	360 00	4,690.00	79.50	-4,194 80	688,136.700	428,763.100	32° 53′ 29.589 N	104° 33' 55.465 W

<del></del>		 	
Checked By:	Approved By:	 Date:	





Azimuths to Grid North True North: 0.12° Magnetic North: 8.38°

Magnetic Field Strength: 49045.4snT Dip Angle: 60.66° Date: 01/11/2010 Model: IGRF2010



#### West(-)/East(+) (200 ft/in)

Project: Eddy County Site: Panuco 26 Fed Well: #3H Wellbore: OH Plan: Plan #1 (#3H/OH)

-5200 -5000 -4800 -4	600 -4400 -4200 -4000 -3	800 -3600 -3400 -3200 -3000	-2800 -2600 -2400 -2200 -2000		0 200 400
		£1 H:::\#:#-#::-#h	<u> </u>		
				Start 3468.67 hotel at 5216.13 MD	
	TD at 8684.79				ville "
				Start DLS.3.00 FO -90.00 Start Build	12.00
2.04(25/25/25/25/25/25/25/25/25/25/25/25/25/2					
					1
	But the state of state				345 245 346 3

	SECTION DETAILS										
Sec	MD	Inc	Azı	TVD	+N/-S	+E/-W	DLea	TFace	VSec	Target	
1	0.00	0.00	0.00	0 00	0 00	0.00	0.00	0.00	0.00		
2	4212 50	0 00	0 00	4212 50	0.00	0.00	0.00	0.00	0 00		
3	4962.56	90.00	277.60	4690.00	63.15	-473.31	12.00	277.60	474.42		
4	5216 13	90 00	269 99	4690 00	79 93	-726 13	3 00	-90 00	727.52		
5	8684 79		269.99	4690.00		-4194.80	0 00			PBHL(PAN#3H)	


Ground Elevation 3644 90
RKB Elevation WELL @ 3663 90ft (19' KB)
Rig Name 19' KB

+N/-S +E/-W Northing Easting Latitude Longitude Siot
0 00 0 00 688057 200 432957 900 32\* 53' 28 891 N 104" 33' 6 267 W

 WELLBORE TARGET DETAILS (MAP CO-ORDINATES)

 Name
 TVD
 +N/-S
 +E/-W
 Northing
 Easting
 Shape

 PBHL(PAN#3H)
 4890 00
 79 50
 -4194 80
 688136 700
 428763 100
 Point

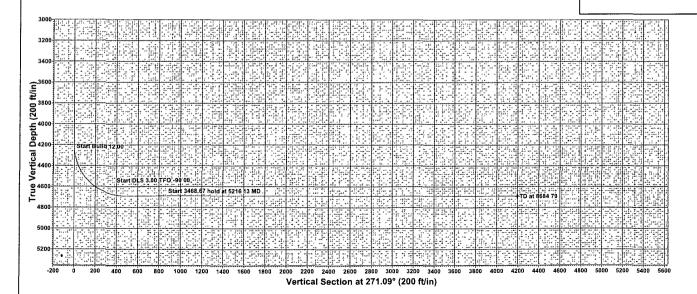


LEGEND

◆ Plan #1

Local North: Grid

PROJECT DETAILS: Eddy County Geodetic System: US State Plane 1927 (Exact solution) Datum: NAD 1927 (NADCON CONUS) Ellipsoid: Clarke 1866 Zone: New Mexico East 3001 System Datum: Mean Sea Level


Plan Plan #1 (#3H/OH)										
Created By	Nate Bingham	Date	15.37, January 11 2010							
Checked		Date								
	•	Created By Nate Bingham	Created By Nate Bingham Date	Created By Nate Bingham Date 15.37, January 11 2010						

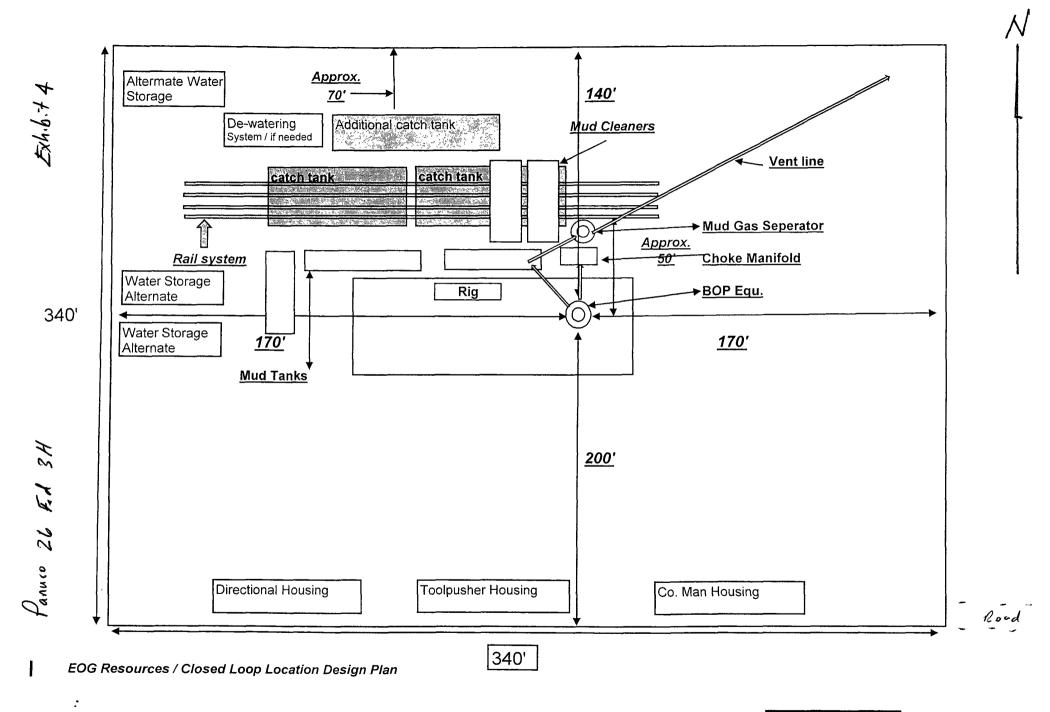

Not to scale

6/30/2008

### **Production Facility Layout**

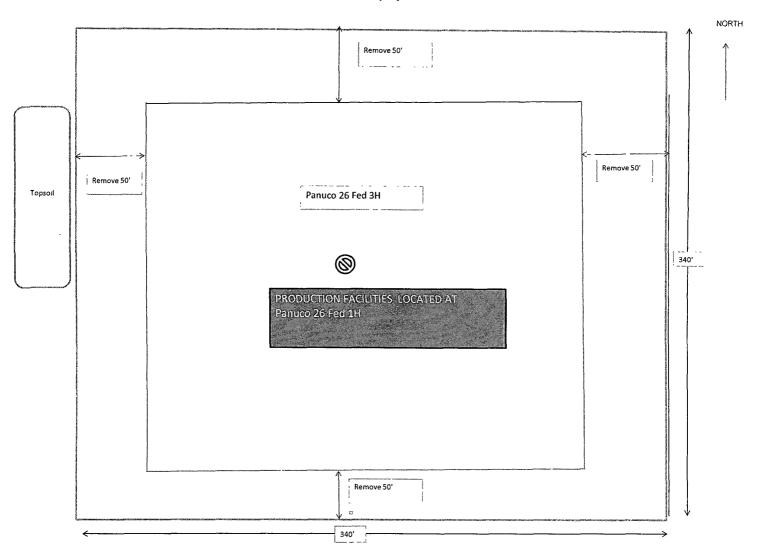

NOT TO SCALE

## EOG RESOURCES, INC. PANUCO 26 FED 3H


#### **ATTACHMENT TO EXHIBIT #1**


- 1. Wear ring to be properly installed in head.
- 2. Blow out preventer and all fittings must be in good condition, 5000 psi W.P. minimum. Exhibit #1.
- 3. All fittings to be flanged
- 4. Safety valve must be available on rig floor at all times with proper connections, valve to be full bore 5000 psi W.P. minimum.
- 5. All choke and fill lines to be securely anchored especially ends of choke lines.
- 6. Equipment through which bit must pass shall be at least as large as the diameter of the casing being drilled through.
- 7. Kelly cock on kelly.
- 8. Extension wrenches and hand wheels to be properly installed.
- 9. Blow out preventer control to be located as close to driller's position as feasible.
- 10. Blow out preventer closing equipment to include minimum 40-gallon accumulator, two independent sources of pump power on each closing unit installation, and meet all API specifications.

9.

EOG Resources, Inc.

Pannes 26 F. d 341

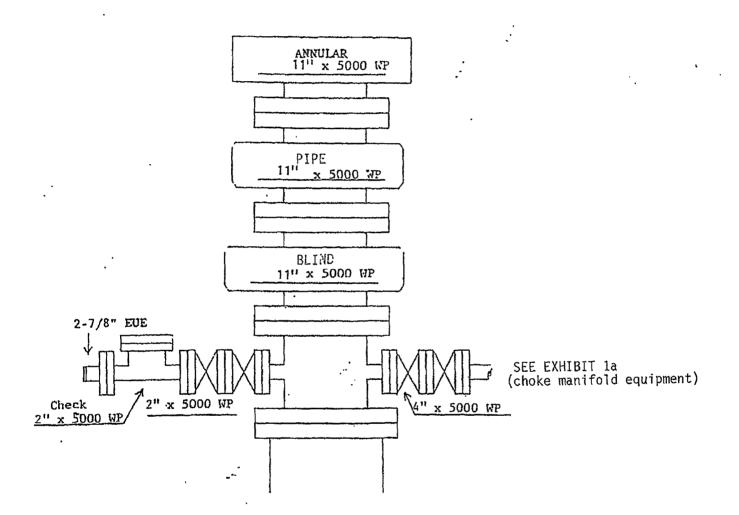


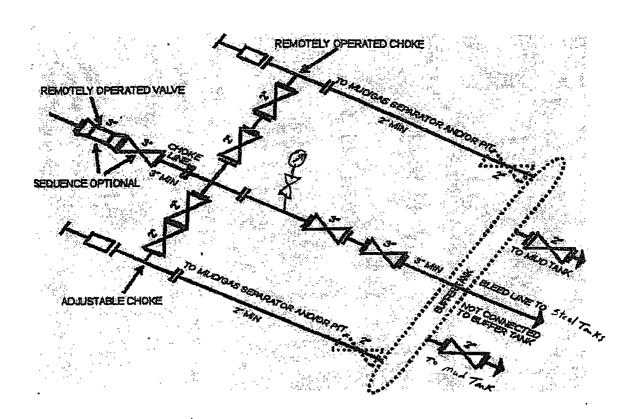



### 5M CHOKE MANIFOLD EQUIPMENT - CONFIGURATION OF CHOKES MAY VARY

Although not required for any of the choke manifold systems, buffer tanks are sometimes installed downstream of the choke assemblies for the purpose of manifolding the bleed lines together. When buffer tanks are employed, valves shall be installed upstream to isolate a failure or malfunction without interrupting flow comfol. Though not shown on 2M, 3M, 10M, OR 15M drawings, it would also be applicable to those situations.

[54 FR 39528, Sept 27, 1989]

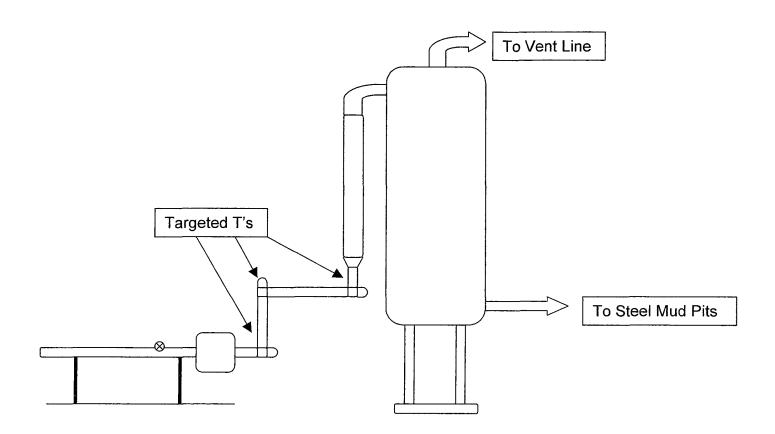



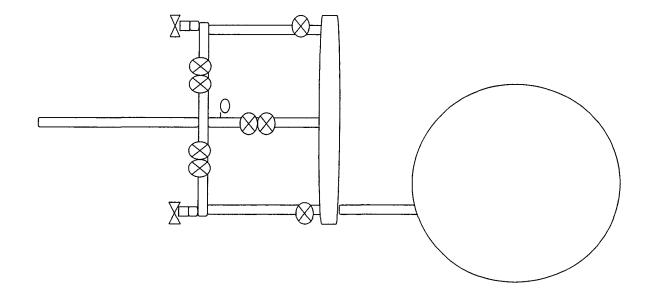


## **EOG** Resources, Inc.

Legal's:

Panuco 26 Fed. Wells

Eddy Co. New Mexico

# H₂S "Contingency Plan"

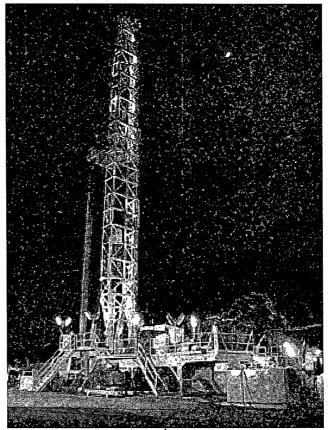



Safety Solutions, LLC 3222 Commercial Dr.

(432) 686-8555 Midland, TX 79701

### Legal's:

### Panuco 26 Fed. #2H

Eddy Co. New Mexico

1880' FNL & 500' FEL Surface Location

1880' FNL & 660' FWL Bottom Hole Location

Section 26

Section 26

T-16-S, R-24-E Lat: N 32.8959785

T-16-S, R-24-E Lat: N 32.8957382

Long: W 104.5654210

Long: W 104.5518893

#### Legal's:

## Panuco 26 Fed. #3H

Eddy Co. New Mexico

1760' FSL & 460' FEL Surface Location

1880' FSL & 660' FWL Bottom Hole Location

Section 26

Section 26

T-16-S, R-24-E

T-16-S, R-24-E Lat: N 32.8915524

Lat: N 32.8913586

Long: W 104.5517409

Long: W 104.5654070

## Legal's:

### Panuco 26 Fed. #4H

Eddy Co. New Mexico

620' FSL & 400' FEL Surface Location

760' FSL & 660' FWL Bottom Hole Location

Section 26 T-16-S, R-24-E

Section 26 T-16-S, R-24-E

Lat: N 32.8959785

Lat: N 32.8957382

Long: W 104.5518893

Long: W 104.5654210

#### **Table of Contents**

## I. H₂S Contingency Plan

'.

- a. Scope
- b. Objective
- c. Discussion of Plan

#### **II.** Emergency Procedures

- a. Emergency Procedures
- b. Emergency Reaction Steps
- c. Simulated Blowout Control Drills

### **III.** Ignition Procedures

- a. Responsibility
- b. Instructions

## **IV. Training Requirements**

#### V. Emergency Equipment

#### VI. Check Lists

- a. Status Check List
- b. Procedural Check List

### **VII. Briefing Procedures**

#### VIII. Evacuation Plan

- a. General Plan
- b. Emergency Phone Lists

### IX. Maps and Plats

- a. Location Plat
- b. Map to Location
- c. Radius of Exposure

#### X. General Information

- a. Drilling/Re-entry Permits
- b. H-9 Permit
- c. H<sub>2</sub>S Permissible Limits
- d. Toxicity Table
- e. Physical Properties
- f. Respirator Use
- g. Emergency Rescue

#### H<sub>2</sub>S CONTINGENCY PLAN SECTION

#### Scope:

This contingency plan provides an organized plan of action for alerting and protecting the public within an area of exposure prior to an intentional release, or following the accidental release of a potentially hazardous volume of hydrogen sulfide. The plan establishes guidelines for all personnel whose work activity may involve exposure to Hydrogen Sulfide Gas ( $H_2S$ ).

#### Objective:

Prevent any and all accidents, and prevent the uncontrolled release of H<sub>2</sub>S into the atmosphere.

Provide proper evacuation procedures to cope with emergencies.

Provide immediate and adequate medical attention should an injury occur.

#### Discussion of Plan:

#### **Suspected Problem Zones:**

*Implementation:* This plan, with all details, is to be fully implemented 1000' before drilling into the first sour zone.

**Emergency Response Procedure:** This section outlines the conditions and denotes steps to be taken in the event of an emergency.

**Emergency Equipment and Procedure:** This section outlines the safety and emergency equipment that will be required for the drilling of this well.

**Training Provisions:** This section outlines the training provisions that must be adhered to 1000' before drilling into the first sour zone.

*Emergency call list:* Included are the telephone numbers of all persons that would need to be contacted, should an H<sub>2</sub>S emergency occur.

Briefing: This section deals with the briefing of all persons involved with the drilling of this well.

Public Safety: Public Safety Personnel will be made aware of the drilling of this well.

**Check Lists:** Status check lists and procedural check lists have been included to ensure adherence to the plan.

General Information: A general information section has been included to supply support information.

#### **EMERGENCY PROCEDURES SECTION**

- I. In the event of any evidence of H<sub>2</sub>S level above 10ppm, take the following steps immediately:
  - a. Secure breathing apparatus.
  - b. Order non-essential personnel out of the danger zone.
  - c. Take steps to determine if the H<sub>2</sub>S level can be corrected or suppressed, and if so, proceed with normal operations.
- II. If uncontrollable conditions occur, proceed with the following:
  - a. Take steps to protect and/or remove any public downwind of the rig, including partial evacuation or isolation. Notify necessary public safety personnel and the New Mexico Oil Conservation Division of the situation.
  - b. Remove all personnel to the Safe Briefing Area.
  - c. Notify public safety personnel for help with maintaining roadblocks and implementing evacuation.
  - d. Determine and proceed with the best possible plan to regain control of the well. Maintain tight security and safety measures.

#### III. Responsibility:

- a. The Company Approved Supervisor shall be responsible for the total implementation of the plan.
- b. The Company Approved Supervisor shall be in complete command during any emergency.
- c. The Company Approved Supervisor shall designate a back up Supervisor in the event that he/she is not available.

#### **EMERGENCY PROCEDURE IMPLEMENTATION**

#### I. Drilling or Tripping

#### a. All Personnel

- i. When alarm sounds, don escape unit and report to upwind Safe Briefing Area.
- ii. Check status of other personnel (buddy system).
- iii. Secure breathing apparatus.
- iv. Wait for orders from supervisor.

### **b.** Drilling Foreman

- i. Report to the upwind Safe Briefing Area.
- ii. Don Breathing Apparatus and return to the point of release with the Tool Pusher or Driller (buddy system).
- iii. Determine the concentration of H<sub>2</sub>S.
- iv. Assess the situation and take appropriate control measures.

#### c. Tool Pusher

- i. Report to the upwind Safe Briefing Area.
- **ii.** Don Breathing Apparatus and return to the point of release with the Drilling Foreman or the Driller (buddy system).
- iii. Determine the concentration of H<sub>2</sub>S.
- iv. Assess the situation and take appropriate control measures.

### d. Driller

- i. Check the status of other personnel (in a rescue attempt, always use the buddy system).
- **ii.** Assign the least essential person to notify the Drilling Foreman and Tool Pusher, in the event of their absence.
- **iii.** Assume the responsibility of the Drilling Foreman and the Tool Pusher until they arrive, in the event of their absence.

### e. Derrick Man and Floor Hands

i. Remain in the upwind Safe Briefing Area until otherwise instructed by a supervisor.

### f. Mud Engineer

- i. Report to the upwind Safe Briefing Area.
- ii. When instructed, begin check of mud for pH level and H<sub>2</sub>S level.

#### g. Safety Personnel

- i. Don Breathing Apparatus.
- ii. Check status of personnel.
- iii. Wait for instructions from Drilling Foreman or Tool Pusher.

### II. Taking a Kick

- a. All Personnel report to the upwind Safe Briefing Area.
- **b.** Follow standard BOP procedures.

### III. Open Hole Logging

- **a.** All unnecessary personnel should leave the rig floor.
- **b.** Drilling Foreman and Safety Personnel should monitor the conditions and make necessary safety equipment recommendations.

## IV. Running Casing or Plugging

- a. Follow "Drilling or Tripping" procedures.
- **b.** Assure that all personnel have access to protective equipment.

#### SIMULATED BLOWOUT CONTROL DRILLS

All drills will be initiated by activating alarm devices (air horn). One long blast, on the air horn, for ACTUAL and SIMULATED Blowout Control Drills. This operation will be performed by the Drilling Foreman or Tool Pusher at least one time per week for each of the following conditions, with each crew:

Drill #1 Bottom Drilling

Drill #2 Tripping Drill Pipe

In each of these drills, the initial reaction time to shutting in the well shall be timed as well as the total time for the crew to complete its entire pit drill assignment. The times must be recorded on the IADC Driller's Log as "Blowout Control Drill".

Drill No.:

Reaction Time to Shut-In: minutes, seconds.

Total Time to Complete Assignment: minutes, seconds.

#### I. Drill Overviews

- a. Drill No. 1 Bottom Drilling
  - i. Sound the alarm immediately.
  - ii. Stop the rotary and hoist Kelly joint above the rotary table.
  - iii. Stop the circulatory pump.
  - iv. Close the drill pipe rams.
  - v. Record casing and drill pipe shut-in pressures and pit volume increases.
- b. Drill No. 2 Tripping Drill Pipe
  - i. Sound the alarm immediately.
  - ii. Position the upper tool joint just above the rotary table and set the slips.
  - iii. Install a full opening valve or inside blowout preventer tool in order to close the drill pipe.
  - iv. Close the drill pipe rams.
  - v. Record the shut-in annular pressure.

#### II. Crew Assignments

#### a. Drill No. 1 - Bottom Drilling

#### i. Driller

- 1. Stop the rotary and hoist Kelly joint above the rotary table.
- 2. Stop the circulatory pump.
- 3. Check Flow.
- 4. If flowing, sound the alarm immediately
- 5. Record the shit-in drill pipe pressure
- 6. Determine the mud weight increase needed or other courses of action.

#### ii. Derrickman

- 1. Open choke line valve at BOP.
- 2. Signal Floor Man #1 at accumulator that choke line is open.
- 3. Close choke and upstream valve after pipe tam have been closed.
- 4. Read the shut-in annular pressure and report readings to Driller.

#### iii. Floor Man #1

- 1. Close the pipe rams after receiving the signal from the Derrickman.
- 2. Report to Driller for further instructions.

### iv. Floor Man #2

- 1. Notify the Tool Pusher and Operator representative of the H<sub>2</sub>S alarms.
- 2. Check for open fires and, if safe to do so, extinguish them.
- 3. Stop all welding operations.
- 4. Turn-off all non-explosions proof lights and instruments.
- 5. Report to Driller for further instructions.

#### v. Tool Pusher

- 1. Report to the rig floor.
- 2. Have a meeting with all crews.

- 3. Compile and summarize all information.
- 4. Calculate the proper kill weight.
- 5. Ensure that proper well procedures are put into action.

#### vi. Operator Representative

- 1. Notify the Drilling Superintendent.
- 2. Determine if an emergency exists and if so, activate the contingency plan.

#### b. Drill No. 2 - Tripping Pipe

#### i. Driller

- 1. Sound the alarm immediately when mud volume increase has been detected.
- 2. Position the upper tool joint just above the rotary table and set slips.
- 3. Install a full opening valve or inside blowout preventer tool to close the drill pipe.
- 4. Check flow.
- 5. Record all data reported by the crew.
- 6. Determine the course of action.

#### ii. Derrickman

- 1. Come down out of derrick.
- 2. Notify Tool Pusher and Operator Representative.
- 3. Check for open fires and, if safe to do so, extinguish them.
- 4. Stop all welding operations.
- 5. Report to Driller for further instructions.

#### iii. Floor Man #1

- 1. Pick up full opening valve or inside blowout preventer tool and stab into tool joint above rotary table (with Floor Man #2).
- 2. Tighten valve with back-up tongs.

- 3. Close pipe rams after signal from Floor Man #2.
- 4. Read accumulator pressure and check for possible high pressure fluid leaks in valves or piping.
- 5. Report to Driller for further instructions.

#### iv. Floor Man #2

٠,

- 1. Pick-up full opening valve or inside blowout preventer tool and stab into tool joint above rotary table (with Floor Man #1).
- 2. Position back-up tongs on drill pipe.
- 3. Open choke line valve at BOP.
- 4. Signal Floor Man #1 at accumulator that choke line is open.
- 5. Close choke and upstream valve after pipe rams have been closed.
- 6. Check for leaks on BOP stack and choke manifold.
- 7. Read annular pressure.
- 8. Report readings to the Driller.

#### v. Tool Pusher

- 1. Report to the rig floor.
- 2. Have a meeting with all of the crews.
- 3. Compile and summarize all information.
- 4. See that proper well kill procedures are put into action.

#### vi. Operator Representative

- 1. Notify Drilling Superintendent
- 2. Determine if an emergency exists, and if so, activate the contingency plan.

#### **IGNITION PROCEDURES**

#### Responsibility:

The decision to ignite the well is the responsibility of the DRILLING FOREMAN in concurrence with the STATE POLICE. In the event the Drilling Foreman is incapacitated, it becomes the responsibility of the RIG TOOL PUSHER. This decision should be made only as a last resort and in a situation where it is clear that:

- 1. Human life and property are endangered.
- 2. There is no hope of controlling the blowout under the prevailing conditions.

If time permits, notify the main office, but do not delay if human life is in danger. Initiate the first phase of the evacuation plan.

Instructions for Igniting the Well:

- 1. Two people are required for the actual igniting operation. Both men must wear self-contained breathing apparatus and must use a full body harness and attach a retrievable safety line to the D-Ring in the back. One man must monitor the atmosphere for explosive gases with the LEL monitor, while the Drilling Foreman is responsible for igniting the well.
- 2. The primary method to ignite is a 25mm flare gun with a range of approximately 500 feet.
- 3. Ignite from upwind and do not approach any closer than is warranted.
- 4. Select the ignition site best suited for protection and which offers an easy escape route.
- 5. Before igniting, check for the presence of combustible gases.
- 6. After igniting, continue emergency actions and procedures as before.
- 7. All unassigned personnel will limit their actions to those directed by the Drilling Foreman.

Note: After the well is ignited, burning Hydrogen Sulfide will convert to Sulfur Dioxide, which is also highly toxic. Do not assume the area is safe after the well is ignited.

#### TRAINING PROGRAM

When working in an area where Hydrogen Sulfide ( $H_2S$ ) might be encountered, definite training requirements must be carried out. The Company Supervisor will ensure that all personnel, at the well site, have had adequate training in the following:

- 1. Hazards and characteristics of Hydrogen Sulfide.
- 2. Physicals effects of Hydrogen Sulfide on the human body.
- 3. Toxicity of Hydrogen Sulfide and Sulfur Dioxide.
- 4. H<sub>2</sub>S detection, Emergency alarm and sensor location.
- 5. Emergency rescue.
- 6. Resuscitators.
- 7. First aid and artificial resuscitation.
- 8. The effects of Hydrogen Sulfide on metals.
- 9. Location safety.

Service company personnel and visiting personnel must be notified if the zone contains H<sub>2</sub>S, and each service company must provide adequate training and equipment for their employees before they arrive at the well site.

#### **EMERGENCY EQUIPMENT REQUIREMENTS**

#### **Lease Entrance Sign:**

Should be located at the lease entrance with the following information:

# CAUTION – POTENTIAL POISON GAS HYDROGEN SULFIDE NO ADMITTANCE WITHOUT AUTHORIZATION

#### **Respiratory Equipment:**

- Fresh air breathing equipment should be placed at the safe briefing areas and should include the following:
- Two SCBA's at each briefing area.
- Enough air line units to operate safely, anytime the H<sub>2</sub>S concentration reaches the IDLH level (100 ppm).
- Cascade system with enough breathing air hose and manifolds to reach the rig floor, the derrickman and the other operation areas.

#### Windsocks or Wind Streamers:

- A minimum of two 10" windsocks located at strategic locations so that they may be seen from any point on location.
- Wind streamers (if preferred) should be placed at various locations on the well site to ensure wind consciousness at all times. (Corners of location).

#### **Hydrogen Sulfide Detector and Alarms:**

- 1 Four channel H<sub>2</sub>S monitor with alarms.
- Four (4) sensors located as follows: #1 Rig Floor, #2 Bell Nipple, #3 Shale Shaker, #4 Mud Pits.
- Gastec or Draeger pump with tubes.
- Sensor test gas.

#### **Well Condition Sign and Flags:**

The Well Condition Sign w/flags should be placed a minimum of 150' before you enter the location. It should have three (3) color coded flags (green, yellow and red) that will be used to denote the following location conditions:

GREEN – Normal Operating Conditions YELLOW – Potential Danger RED – Danger, H₂S Gas Present

#### **Auxiliary Rescue Equipment:**

- Stretcher
- 2 100' Rescue lines.
- First Aid Kit properly stocked.

#### **Mud Inspection Equipment:**

Garret Gas Train or Hach Tester for inspection of Hydrogen Sulfide in the drilling mud system.

#### **Fire Extinguishers:**

Adequate fire extinguishers shall be located at strategic locations.

#### **Blowout Preventer:**

- The well shall have hydraulic BOP equipment for the anticipated BHP.
- The BOP should be tested upon installation.
- BOP, Choke Line and Kill Line will be tested as specified by Operator.

#### **Confined Space Monitor:**

There should be a portable multi-gas monitor with at least 3 sensors ( $O_2$ , LEL  $H_2S$ ). This instrument should be used to test the atmosphere of any confined space before entering. It should also be used for atmospheric testing for LEL gas before beginning any type of Hot Work. Proper calibration documentation will need to be provided.

#### **Communication Equipment:**

- Proper communication equipment such as cell phones or 2-way radios should be available at the rig.
- Radio communication shall be available for communication between the company man's trailer, rig floor and the tool pusher's trailer.

Communication equipment shall be available on the vehicles.

#### **Special Control Equipment:**

- Hydraulic BOP equipment with remote control on the ground.
- Rotating head at the surface casing point.

#### **Evacuation Plan:**

- Evacuation routes should be established prior to spudding the well.
- Should be discussed with all rig personnel.

#### **Designated Areas:**

#### Parking and Visitor area:

- All vehicles are to be parked at a pre-determined safe distance from the wellhead.
- Designated smoking area.

#### Safe Briefing Areas:

- Two Safe Briefing Areas shall be designated on either side of the location at the maximum allowable distance from the well bore so they offset prevailing winds or they are at a 180 degree angle if wind directions tend to shift in the area.
- Personal protective equipment should be stored at both briefing areas or if a moveable cascade trailer is used, it should be kept upwind of existing winds. When wind is from the prevailing direction, both briefing areas should be accessible.

#### Note:

- Additional equipment will be available at the Safety Solutions, LLC office.
- Additional personal H<sub>2</sub>S monitors are available for all employees on location.
- Automatic Flare Igniters are recommended for installation on the rig.

# **CHECK LISTS**

# **Status Check List**

Note: Date each item as they are implemented.

1.	Sign at location entrance.
2.	Two (2) wind socks (in required locations).
3.	Wind Streamers (if required).
4.	SCBA's on location for all rig personnel and mud loggers.
5.	Air packs, inspected and ready for use.
6.	Spare bottles for each air pack (if required).
7.	Cascade system for refilling air bottles.
8.	Cascade system and hose line hook up.
9.	Choke manifold hooked-up and tested. (before drilling out surface casing.)
10.	Remote Hydraulic BOP control (hooked-up and tested before drilling out surface casing).
11.	BOP tested (before drilling out surface casing).
12.	Mud engineer on location with equipment to test mud for H <sub>2</sub> S.
13.	Safe Briefing Areas set-up
14.	Well Condition sign and flags on location and ready.
15.	Hydrogen Sulfide detection system hooked -up & tested.
16.	Hydrogen Sulfide alarm system hooked-up & tested.
17.	Stretcher on location at Safe Briefing Area.
18.	2 – 100' Life Lines on location.
19.	1 – 20# Fire Extinguisher in safety trailer.
20.	Confined Space Monitor on location and tested.
21	All rig crews and supervisor trained (as required)

22. Access restricted for unauthorized personnel.	
23. Drills on H <sub>2</sub> S and well control procedures.	
24. All outside service contractors advised of potential H <sub>2</sub> S on the well.	
25. NO SMOKNG sign posted.	
26. H <sub>2</sub> S Detector Pump w/tubes on location.	
27. 25mm Flare Gun on location w/flares.	,
28. Automatic Flare Igniter installed on rig.	

#### **Procedural Check List**

#### Perform the following on each tour:

- 1. Check fire extinguishers to see that they have the proper charge.
- 2. Check breathing equipment to insure that they have not been tampered with.
- 3. Check pressure on the supply air bottles to make sure they are capable of recharging.
- 4. Make sure all of the Hydrogen Sulfide detection systems are operative.

#### Perform the following each week:

- 1. Check each piece of breathing equipment to make sure that they are fully charged and operational. This requires that the air cylinder be opened and the mask assembly be put on and tested to make sure that the regulators and masks are properly working. Negative and Positive pressure should be conducted on all masks.
- 2. BOP skills.
- 3. Check supply pressure on BOP accumulator stand-by source.
- 4. Check all breathing air mask assemblies to see that straps are loosened and turned back, ready for use.
- 5. Check pressure on cascade air cylinders to make sure they are fully charged and ready to use for refill purposes if necessary.
- 6. Check all cascade system regulators to make sure they work properly.
- 7. Perform breathing drills with on-site personnel.
- 8. Check the following supplies for availability:
  - Stretcher
  - Safety Belts and Ropes
  - Spare air Bottles
  - Spare Oxygen Bottles (if resuscitator required)
  - Gas Detector Pump and Tubes
  - Emergency telephone lists
- 9. Test the Confined Space Monitor to verify the batteries are good

#### **BRIEFING PROCEDURES**

The following scheduled briefings will be held to ensure the effective drilling and operation of this project:

**Pre-Spud Meeting** 

Date: Prior to spudding the well.

Attendance: Drilling Supervisor

Drilling Engineer
Drilling Foreman
Rig Tool Pushers
Rig Drillers
Mud Engineer
All Safety Personnel

**Key Service Company Personnel** 

Purpose: Review and discuss the well program, step-by-step, to insure complete understanding of

assignments and responsibilities.

#### **EVACUATION PLAN**

#### **General Plan**

The direct lines of action prepared by SAFETY SOLUTIONS, LLC to protect the public from hazardous gas situations are as follows:

- 1. When the company approved supervisor (Drilling Foreman, Tool Pusher or Driller) determine that Hydrogen Sulfide gas cannot be limited to the well location, and the public will be involved, he will activate the evacuation plan. Escape routes are noted on the area map.
- 2. Company safety personnel or designee will notify the appropriate local government agency that a hazardous condition exists and evacuation needs to be implemented.
- 3. Company approved safety personnel that have been trained in the use of the proper emergency equipment will be utilized.
- 4. Law enforcement personnel (State Police, Local Police Department, Fire Department, and the Sheriff's Department) will be called to aid in setting up and maintaining road blocks. Also, they will aid in evacuation of the public if necessary.
- NOTE: Law enforcement personnel will not be asked to come into a contaminated area. Their assistance will be limited to uncontaminated areas. Constant radio contact will be maintained with them.
  - 5. After the discharge of gas has been controlled, "Company" safety personnel will determine when the area is safe for re-entry.

**See Emergency Action Plan** 

# **Emergency Assistance Telephone List**

PUBLIC SAFETY:		911 or
Eddy County Sheriff's Department		(575) 887-7551
Kent Waller		
Fire Department:		
Carlsbad		(575) 885-3125
Artesia		(575) 746-5050
Hospitals:		
Carlsbad		(575) 887-4121
Artesia		(575) 748-3333
Hobbs		(575) 392-1979
Dept. of Public Safety/Carlsbad		(575) 748-9718
Highway Department		(575) 885-3281
New Mexico Oil Conservation		(575) 476-3440
U.S. Dept. of Labor		(575) 887-1174
EOG Resources, Inc.		
EOG / Midland	Office	(432) 686-3600
Company Drilling Consultants:	0,0	(102) 000 000
Danny Kiser	Cell	(281) 833-2749
Drilling Engineer		
Steve Munsell		(432) 686-3609
	Cell	(432) 894-1256
Operations Manager	0.00	/422\ 606 2705
Joel Pettit		(432) 686-3705
Duilling Compaintendent	Cell	(432)894-1226
Drilling Superintendent	Office	/422\ COC 2679
Barney Thompson		(432) 686-3678
Field Drilling Congrintendent	Cell	(432) 254-9056
Field Drilling Superintendent Ron Welch	Cell	(432) 386-0592
ROH Welch	Cell	(432) 300-0332
McVay Drilling		
McVay Drilling / Hobbs	Office	(575) 397-3311
McVay Drilling Rig #4	Rig	(575) 370-5598
Tool Pusher:		
Terry Johnson	Cell	(575) 370-5620
Safety Consultants		
Safety Solutions, LLC	Office	(432) 686-8555
Cliff Strasner	Cell	(432) 894-9789
Craig Strasner	Cell	(432) 894-0341
		, ,

# MAPS AND PLATS (Maps & Plats Attached)

#### **Affected Notification List**

(within a 65' radius of exposure @100ppm)

The geologic zones that will be encountered during drilling are known to contain hazardous quantities of  $H_2S$ . The accompanying map illustrates the affected areas of the community. The residents within this radius will be notified via a hand delivered written notice describing the activities, potential hazards, conditions of evacuation, evacuation drill siren alarms and other precautionary measures.

**Evacuee Description:** 

Residents: THERE ARE NO RESIDENTS WITHIN 3000' ROE.

**Notification Process:** 

A continuous siren audible to all residence will be activated, signaling evacuation of previously notified and informed residents.

**Evacuation Plan:** 

All evacuees will migrate lateral to the wind direction.

The Oil Company will identify all home bound or highly susceptible individuals and make special evacuation preparations, interfacing with the local and emergency medical service as necessary.

**GENERAL INFORMATION** 

#### Toxic Effects of H<sub>2</sub>S Poisoning

Hydrogen Sulfide is extremely toxic. The acceptable ceiling concentration for eight-hour exposure is 10 PPM, which is .001% by volume. Hydrogen Sulfide is heavier than air (specific gravity - 1.192) and is colorless and transparent. Hydrogen Sulfide is almost as toxic as Hydrogen Cyanide and is 5-6 times more toxic than Carbon Monoxide. Occupational exposure limits for Hydrogen Sulfide and other gases are compared below in Table 1. Toxicity table for  $H_2S$  and physical effects are shown in Table 2.

Table 1
Permissible Exposure Limits of Various Gases

Common Name	Symbol	Sp. Gravity	TLV	STEL	IDLH
Hydrogen Cyanide	HCN	.94	4.7 ppm	С	
Hydrogen Sulfide	H <sub>2</sub> S	1.192	10 ppm	15 ppm	100 ppm
Sulfide Dioxide	SO <sub>2</sub>	2.21	2 ppm	5 ppm	
Chlorine	CL	2.45	.5 ppm	1 ppm	
Carbon Monoxide	со	.97	25 ppm	200 ppm	
Carbon Dioxide	CO <sub>2</sub>	1.52	5000 ppm	30,000 ppm	
Methane	CH₄	.55	4.7% LEL	14% UEL	

#### **Definitions**

- A. TLV Threshold Limit Value is the concentration employees may be exposed based on a TWA (time weighted average) for eight (8) hours in one day for 40 hours in one (1) week. This is set by ACGIH (American Conference of Governmental Hygienists) and regulated by OSHA.
- B. STEL Short Term Exposure Limit is the 15 minute average concentration an employee may be exposed to providing that the highest exposure never exceeds the OEL (Occupational Exposure Limit). The OEL for H<sub>2</sub>S is 19 PPM.
- C. IDLH Immediately Dangerous to Life and Health is the concentration that has been determined by the ACGIH to cause serious health problems or death if exposed to this level. The IDLH for  $H_2S$  is 100 PPM.
- D. TWA Time Weighted Average is the average concentration of any chemical or gas for an eight (8) hour period. This is the concentration that any employee may be exposed based on an TWA.

# TABLE 2

		Toxicity Table of H <sub>2</sub> S
Percent %	PPM	Physical Effects
.0001	1	Can smell less than 1 ppm.
.001	10	TLV for 8 hours of exposure.
.0015	15	STEL for 15 minutes of exposure.
.01	100	Immediately Dangerous to Life & Health. Kills sense of smell in 3 to 5 minutes.
.02	200	Kills sense of smell quickly, may burn eyes and throat.
.05	500	Dizziness, cessation of breathing begins in a few minutes.
.07	700	Unconscious quickly, death will result if not rescued promptly.
.10	1000	Death will result unless rescued promptly. Artificial resuscitation may be necessary.

#### PHYSICAL PROPERTIES OF H<sub>2</sub>S

The properties of all gases are usually described in the context of seven major categories:

COLOR

**ODOR** 

**VAPOR DENSITY** 

**EXPLOSIVE LIMITS** 

**FLAMMABILITY** 

**SOLUBILITY (IN WATER)** 

**BOILING POINT** 

Hydrogen Sulfide is no exception. Information from these categories should be considered in order to provide a fairly complete picture of the properties of the gas.

#### COLOR - TRANSPARENT

Hydrogen Sulfide is colorless so it is invisible. This fact simply means that you can't rely on your eyes to detect its presence. In fact that makes this gas extremely dangerous to be around.

#### **ODOR - ROTTEN EGGS**

Hydrogen Sulfide has a distinctive offensive smell, similar to "rotten eggs". For this reason it earned its common name "sour gas". However, H₂S, even in low concentrations, is so toxic that it attacks and quickly impairs a victim's sense of smell, so it could be fatal to rely on your nose as a detection device.

#### **VAPOR DENSITY - SPECIFIC GRAVITY OF 1.192**

Hydrogen Sulfide is heavier than air so it tends to settle in low-lying areas like pits, cellars or tanks. If you find yourself in a location where  $H_2S$  is known to exist, protect yourself. Whenever possible, work in an area upwind and keep to higher ground.

#### **EXPLOSIVE LIMITS - 4.3% TO 46%**

Mixed with the right proportion of air or oxygen, H<sub>2</sub>S will ignite and burn or explode, producing another alarming element of danger besides poisoning.

#### **FLAMMABILITY**

Hydrogen Sulfide will burn readily with a distinctive clear blue flame, producing Sulfur Dioxide (SO<sub>2</sub>), another hazardous gas that irritates the eyes and lungs.

#### **SOLUBILITY - 4 TO 1 RATIO WITH WATER**

Hydrogen Sulfide can be dissolved in liquids, which means that it can be present in any container or vessel used to carry or hold well fluids including oil, water, emulsion and sludge. The solubility of  $H_2S$  is dependent on temperature and pressure, but if conditions are right, simply agitating a fluid containing  $H_2S$  may release the gas into the air.

### **BOILING POINT – (-76 degrees Fahrenheit)**

Liquefied Hydrogen Sulfide boils at a very low temperature, so it is usually found as a gas.

#### **RESPIRATOR USE**

The Occupational Safety and Health Administration (OSHA) regulate the use of respiratory protection to protect the health of employees. OSHA's requirements are written in the Code of Federal Regulations, Title 29, Part 1910, Section 134, Respiratory Protection. This regulation requires that all employees who might be required to wear respirators, shall complete a OSHA mandated medical evaluation questionnaire. The employee then should be fit tested prior to wearing any respirator while being exposed to hazardous gases.

Written procedures shall be prepared covering safe use of respirators in dangerous atmospheric situations, which might be encountered in normal operations or in emergencies. Personnel shall be familiar with these procedures and the available respirators.

Respirators shall be inspected prior to and after each use to make sure that the respirator has been properly cleaned, disinfected and that the respirator works properly. The unit should be fully charged prior to being used.

Anyone who may use respirators shall be properly trained in how to properly seal the face piece. They shall wear respirators in normal air and then in a test atmosphere. (Note: Such items as facial hair (beard or sideburns) and eyeglass temple pieces will not allow a proper seal.) Anyone that may be expected to wear respirators should have these items removed before entering a toxic atmosphere. A special mask must be obtained for anyone who must wear eyeglasses. Contact lenses should not be allowed.

Respirators shall be worn during the following conditions:

- A. Any employee who works near the top or on the top of any tank unless tests reveal less than 20 ppm of  $H_2S$ .
- B. When breaking out any line where H<sub>2</sub>S can reasonably be expected.
- C. When sampling air in areas where H<sub>2</sub>S may be present.
- D. When working in areas where the concentration of  $H_2S$  exceeds the Threshold Limit Value for  $H_2S$  (10 ppm).
- E. At any time where there is a doubt as to the H<sub>2</sub>S level in the area to be entered.

#### **EMERGENCY RESCUE PROCEDURES**

#### DO NOT PANIC!!!

#### Remain Calm - Think

- 1. Before attempting any rescue you must first get out of the hazardous area yourself. Go to a safe briefing area.
- 2. Sound alarm and activate the 911 system.
- 3. Put on breathing apparatus. At least two persons should do this, when available use the buddy system.
- 4. Rescue the victim and return them to a safe briefing area.
- 5. Perform an initial assessment and begin proper First Aid/CPR procedures.
- 6. Keep victim lying down with a blanket or coat, etc.., under the shoulders to keep airway open. Conserve body heat and do not leave unattended.
- 7. If the eyes are affected by H<sub>2</sub>S, wash them thoroughly with potable water. For slight irritation, cold compresses are helpful.
- 8. In case a person has only minor exposure and does not lose consciousness totally, it's best if he doesn't return to work until the following day.
- 9. Any personnel overcome by H<sub>2</sub>S should always be examined by medical personnel. They should always be transported to a hospital or doctor.

# EOG RESOURCES, INC. PANUCO 26 FED 3H

# **SURFACE USE PLAN OF OPERATION**

SHL: 1760' FSL & 460' FEL, Unit I, Section 26, T16S-R24E, N.M.P.M., Eddy, NM BHL: 1880' FSL & 660' FWL, Unit L, Section 26, T16S-R24E, N.M.P.M., Eddy, NM

#### 1. EXISTING ROADS:

14

- a. The well site and elevation plat for the proposed well are reflected on the well site layout; Form C-102. The well was staked by Terry Asel, RPL 15079.
- b. All roads into the location are depicted on Exhibit 2, 2a & 2b.
- c. <u>Directions to Locations:</u> From the Intersection of U.S. Hwy 82 & U.S. Hwy 285, Go west on Hwy 82 for 11.4 miles; turn right, go north on County Road No. 95 (Joy Road) for 4.2 miles; turn right, go east on County Road No. 75 for 1.8 miles; turn right, go south for 0.6 miles, turn right on proposed new road and go 110 feet to location.

#### 2. NEW OR RECONSTRUCTED ACCESS ROAD:

- a. The well site layout, Exhibit 2a shows the layout. A new access road will be constructed of compact caliche a distance of 110 feet (See Exhibit 2b).
- b. The maximum width of the road will be 15'. It will be crowned and made of 6" of rolled and compacted caliche. Water will be deflected, as necessary, to avoid accumulation and prevent soil erosion.
- **c.** Surface material will be native caliche. This material will be obtained from a BLM approved pit nearest in proximity to the location. The average grade will be approximately 1%. No cattleguards, gates or fence cuts will be required. No turnouts are planned.

#### 3. LOCATION OF EXISTING WELLS:

Exhibit #3 shows all existing wells within a one-mile radius of this well.

#### 4. LOCATION OF EXISTING AND/OR PROPOSED PRODUCTION FACILITIES:

- a. In the event the well is found to be productive, the necessary production equipment will be installed at the Panuco 26 Fed 1H CTB. No Production Facilities on location. See diagram.
- b. As a proposed gas well, no electric power is required.
- c. All flow lines will adhere to API standards.
- d. Refer to b above.
- e. If the well is productive, rehabilitation plans are as follows:
  - i. The location shall be reduced on Four (4) sides as depicted by the Production Facilities Layout. The interim reclamation will be performed when optimal

# EOG RESOURCES, INC. PANUCO 26 FED 3H

- conditions exist during the growing season as per the interim reclamation guidelines of the BLM.
- ii. The original topsoil from the well site will be returned to the location. The location will be contoured as close as possible to match the original topography.

#### 5. LOCATION AND TYPE OF WATER SUPPLY:

This location will be drilled using a combination of water mud systems (outlined in the drilling program). The water will be obtained from commercial water stations in the area and hauled to location by transport truck using existing and proposed roads shown in Exhibit 2, 2a and 2b. On occasion, water will be obtained from existing water wells. In these cases where a poly pipeline is used to transport water for drilling purposes, proper authorizations will be secured. If poly pipeline is used to transport fresh water to the location, proper authorization will be secured by the contractor.

#### 6. CONSTRUCTION MATERIALS

All caliche utilized for the drilling pad and proposed access road will be obtained from an existing BLM approved pit or from prevailing deposits found under the location. All roads will be constructed of rolled and compacted caliche. Will use BLM recommended use of extra caliche from other locations close by roads, if available.

#### 7. METHODS OF HANDLING WASTE MATERIALS

- a. Drill cuttings shall be disposed of in a steel cuttings bin (catch tanks) on the drilling pad (behind the steel mud tanks). The bin and cuttings shall be hauled to an approved cuttings dumpsite.
  - At the site, the cuttings shall be removed from the bin & the bin shall be returned to the drilling site for reuse.
- b. All trash, junk, and other waste material shall be contained in trash cages or trash bins to prevent scattering. When a job is completed, all contents shall be removed and disposed of in an approved landfill.
- c. The supplier, including broken sacks, shall pick up salts remaining after completion of well.
- d. If necessary, a porto-john shall be provided for the rig crews. This equipment shall be properly maintained during the drilling and completion operations and shall be removed when all operations are complete.
- e. Remaining drilling fluids shall be hauled off by transports to a state approved disposal site. Water produced during completion shall be put in storage tanks and disposed of in a state approved disposal. Oil and condensate produced shall be put in a storage tank and sold.
- f. Disposal of fluids to be transported by the following companies:

### EOG RESOURCES, INC. PANUCO 26 FED 3H

- i. RGB TRUCKING
- ii. LOBO TRUCKING
- iii. I & W TRUCKING
- iv. CRANE HOT OIL & TRANSPORT
- v. JWS
- vi. QUALITY TRUCKING

#### 8. ANCILLARY FACILITIES:

a. No airstrip, campsite, or other facilities will be built.

#### 9. WELL SITE LAYOUT:

- a. Exhibit 4 shows the proposed location of reserve and sump pits, living facilities and well site layout with dimensions of the pad layout.
- b. Mud pits in the active circulating system shall be steel pits and the catch tanks shall be steel tanks set in shallow sumps behind the steel circulating tanks and sumps.
- c. The area where the catch tanks are placed shall be reclaimed and the surface vegetation restored to as or near the same condition that existed prior to operations.

#### 10. PLANS FOR SURFACE RECLAMATION:

- a. After concluding the drilling and/or completion operations, if the well is found non-commercial, the caliche shall be removed from the pad and transported to the original caliche pit or used for other drilling locations and roads. The road shall be reclaimed and the surface vegetation restored to as or near the same condition that existed prior to operations. The catch tank area shall be broken out and leveled after drying to a condition where these are feasible. The original topsoil shall again be returned to the pad and contoured, as close as possible, to the original topography.
- b. After the well is plugged and abandoned, the location and road shall be reclaimed and the surface vegetation restored to as or near the same condition that existed prior to operations.
- c. If the well is deemed commercially productive, the catch tank area shall be restored as described in 4(e)(i). Caliche from areas of the pad site not required for operations shall be reclaimed. The original topsoil shall be returned to the area of the drill pad not necessary to operate the well. These unused areas of the drill pad shall be contoured, as close as possible, to match the original topography.

### EOG RESOURCES, INC. PANUCO 26 FED 3H

#### 11. SURFACE OWNERSHIP

The surface is owned by the Bureau of Land Management. The surface is multiple use with the primary uses of the region for the grazing of livestock and the production of oil and gas.

#### 12. OTHER INFORMATION:

- a. The area surrounding the well is cactus and tar brush. The topsoil is sandy in nature. The vegetation is moderately sparse with native prairie grass, cactus and shinnery oak. No wildlife was observed but it is likely that deer, rabbits, coyotes, birds and rodents transverse the area.
- b. There are not dwellings within 2 miles of location.
- c. There is no permanent or live water within 1.2 miles of the location.
- d. Cultural Resources Examination will be conducted by Danny Boone and registered with the CFO.

#### 13. BOND COVERAGE:

a. Bond Coverage is Nationwide; Bond No. NM 2308

# EOG RESOURCES, INC. PANUCO 26 FED 3H

#### **COMPANY REPRESENTATIVES:**

Representatives responsible for ensuring compliance of the surface use plan are listed below:

# Permitting & Land

Mr. Donny G. Glanton Senior Lease Operations ROW Representative EOG Resources, Inc. P.O. Box 2267 Midland, TX 79702 (432) 686-3642 Office (432) 770-0602 Cell

# <u>Drilling</u> <u>Operations</u>

Mr. Steve Munsell	Mr. Howard Kemp
Drilling Engineer	Production Manager
EOG Resources, Inc.	EOG Resources, Inc
P.O. Box 2267	P.O. Box 2267
Midland, TX 79702	Midland, TX 79702
(432) 686-3609 Office	(432) 686-3704 Office
(432) 894-1256 Cell	(432) 634-1001 Cell

# **OPERATOR CERTIFICATION**

I certify that I, or someone under my direct supervision, have inspected the drill site and access route proposed herein; that I am familiar with the conditions that presently exist; that I have full knowledge of State and Federal Laws applicable to this operation; that the statements made in this APD package are, to the best of my knowledge, true, and correct; and that the work associated with the operations proposed herein will be performed in conformity with this APD package and the terms and conditions under which it is approved. I also certify that I, or the company I represent, am responsible for the operations conducted under this application. These statements are subject to the provisions of 18 U.S.C. 1001 for the filing of false statements. Executed this 5<sup>th</sup> day of February 2010.

Name: Donny G. Glanton

Position: Sr. Lease Operations ROW Representative

Address: P.O. Box 2267 Midland, TX 79705

Telephone: <u>432-686-3642</u>

Email: donny glanton@eogresources.com

Signed: Jan J. Mily

# PECOS DISTRICT CONDITIONS OF APPROVAL

OPERATOR'S NAME: LEASE NO.: LEASE NO.: NM108951

WELL NAME & NO.: 3H-PANUCO 26 FED

SURFACE HOLE FOOTAGE: 1760' FSL & 460' FEL

BOTTOM HOLE FOOTAGE 1880' FsL & 660' FWL

LOCATION: Section 26, T. 16 S., R 24 E., NMPM

COUNTY: Eddy County, New Mexico

# TABLE OF CONTENTS

Standard Conditions of Approval (COA) apply to this APD. If any deviations to these standards exist or special COAs are required, the section with the deviation or requirement will be checked below.

General Provisions
Permit Expiration
Archaeology, Paleontology, and Historical Sites
Noxious Weeds
Special Requirements
Aplomado Falcon
Range Improvement Projects
Access Road Requirement
<b>⊠</b> Construction
Notification
Topsoil
Closed Loop System
Federal Mineral Material Pits
Well Pads
Roads
Road Section Diagram
Drilling
Logging Requirements
Production (Post Drilling)
Well Structures & Facilities
☐ Interim Reclamation
Final Abandonment & Reclamation

#### I. GENERAL PROVISIONS

The approval of the Application For Permit To Drill (APD) is in compliance with all applicable laws and regulations: 43 Code of Federal Regulations 3160, the lease terms, Onshore Oil and Gas Orders, Notices To Lessees, New Mexico Oil Conservation Division (NMOCD) Rules, National Historical Preservation Act As Amended, and instructions and orders of the Authorized Officer. Any request for a variance shall be submitted to the Authorized Officer on Form 3160-5, Sundry Notices and Report on Wells.

#### II. PERMIT EXPIRATION

If the permit terminates prior to drilling and drilling cannot be commenced within 60 days after expiration, an operator is required to submit Form 3160-5, Sundry Notices and Reports on Wells, requesting surface reclamation requirements for any surface disturbance. However, if the operator will be able to initiate drilling within 60 days after the expiration of the permit, the operator must have set the conductor pipe in order to allow for an extension of 60 days beyond the expiration date of the APD. (Filing of a Sundry Notice is required for this 60 day extension.)

# III. ARCHAEOLOGICAL, PALEONTOLOGY & HISTORICAL SITES

Any cultural and/or paleontological resource discovered by the operator or by any person working on the operator's behalf shall immediately report such findings to the Authorized Officer. The operator is fully accountable for the actions of their contractors and subcontractors. The operator shall suspend all operations in the immediate area of such discovery until written authorization to proceed is issued by the Authorized Officer. An evaluation of the discovery shall be made by the Authorized Officer to determine the appropriate actions that shall be required to prevent the loss of significant cultural or scientific values of the discovery. The operator shall be held responsible for the cost of the proper mitigation measures that the Authorized Officer assesses after consultation with the operator on the evaluation and decisions of the discovery. Any unauthorized collection or disturbance of cultural or paleontological resources may result in a shutdown order by the Authorized Officer.

#### IV. NOXIOUS WEEDS

The operator shall be held responsible if noxious weeds become established within the areas of operations. Weed control shall be required on the disturbed land where noxious weeds exist, which includes the roads, pads, associated pipeline corridor, and adjacent land affected by the establishment of weeds due to this action. The operator shall consult with the Authorized Officer for acceptable weed control methods, which include following EPA and BLM requirements and policies.

# V. SPECIAL REQUIREMENT(S)

#### Aplomado Falcon:

In order to minimize impacts to aplomado falcon, the following Conditions of Approval will apply:

- No yuccas or trees over 5 feet in height will be damaged, to protect nesting structures.
- All active raptor nests will be avoided by a minimum of 400 meters by all activities or curtail activities until fledging is complete. All inactive raptor nests will be avoided by a minimum of 200 meters by all activities.
- Well pad size will not exceed 300 ft. x 390 ft.
- All roads associated with well development will not exceed 30 ft in width
- Reserve pits for drilling and disposal are not allowed unless the pit can be effectively netted to the satisfaction of the BLM. Steel tank circulation system must be used if the reserve pit is not netted.
- All unused portions of the well pad associated with producing wells will be reclaimed following the abandoned well protocol below
- Final abandonment protocol: Remove all caliche from well pads and roads that are plugged and abandoned. Reclamation will consist of disking, mulching, seeding with a drill (See seed mixture below), and application of water to encourage seed germination.

#### Range Improvement Projects:

#### Fence Requirement

Where entry is required across a fence line, the fence shall be braced and tied off on both sides of the passageway prior to cutting. Once the work is completed, the fence will be restored to its prior condition, or better. The operator shall notify the grazing allotment holder prior to crossing any fence(s).

#### Cattleguard(s)

Appropriately sized cattleguards sufficient to carry out the project shall be installed and maintained at fence crossings. Any existing cattleguard(s) on the access road shall be repaired or replaced if they are damaged or have deteriorated beyond practical use. The operator shall be responsible for the condition of the cattleguard(s) that are in place and are utilized during lease operations. A gate shall be constructed on one side of the cattleguard and fastened securely to H-braces.

#### **Access Road Requirement:**

The access road will be placed upon the existing two-track road wherever present.

#### VI. CONSTRUCTION

#### A. NOTIFICATION

The BLM shall administer compliance and monitor construction of the access road and well pad. Notify the Carlsbad Field Office at (575) 234-5972 at least 3 working days prior to commencing construction of the access road and/or well pad.

When construction operations are being conducted on this well, the operator shall have the approved APD and Conditions of Approval (COA) on the well site and they shall be made available upon request by the Authorized Officer.

#### B. TOPSOIL

The operator shall stockpile the topsoil in a low profile manner in order to prevent wind/water erosion of the topsoil. The topsoil will be used for interim and final reclamation.

#### C. CLOSED LOOP SYSTEM

Tanks are required for drilling operations: No Pits.

The operator shall properly dispose of drilling contents at an authorized disposal site.

#### D. FEDERAL MINERAL MATERIALS PIT

Payment shall be made to the BLM prior to removal of any federal mineral materials. Call the Carlsbad Field Office at (575) 234-5972.

#### E. WELL PAD SURFACING

Surfacing of the well pad is not required.

If the operator elects to surface the well pad, the surfacing material may be required to be removed at the time of reclamation.

The well pad shall be constructed in a manner which creates the smallest possible surface disturbance, consistent with safety and operational needs.

#### F. ON LEASE ACCESS ROADS

#### Road Width

The access road shall have a driving surface that creates the smallest possible surface disturbance and does not exceed fourteen (14) feet in width. The maximum width of surface disturbance, when constructing the access road, shall not exceed thirty (30) feet.

#### Surfacing

Surfacing material is not required on the new access road driving surface. If the operator elects to surface the new access road or pad, the surfacing material may be required to be removed at the time of reclamation.

Where possible, no improvements should be made on the unsurfaced access road other than to remove vegetation as necessary, road irregularities, safety issues, or to fill low areas that may sustain standing water.

The Authorized Officer reserves the right to require surfacing of any portion of the access road at any time deemed necessary. Surfacing may be required in the event the road deteriorates, erodes, road traffic increases, or it is determined to be beneficial for future field development. The surfacing depth and type of material will be determined at the time of notification.

#### Crowning


Crowning shall be done on the access road driving surface. The road crown shall have a grade of approximately 2% (i.e., a 1" crown on a 14' wide road). The road shall conform to Figure 1; cross section and plans for typical road construction.

#### Ditching

Ditching shall be required on both sides of the road.

#### **Turnouts**

Vehicle turnouts shall be constructed on the road. Turnouts shall be intervisible with interval spacing distance less than 1000 feet. Turnouts shall be constructed on all blind curves. Turnouts shall conform to the following diagram:

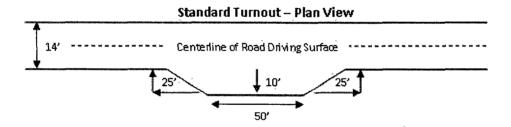


#### **Drainage**

Drainage control systems shall be constructed on the entire length of road (e.g. ditches, sidehill outsloping and insloping, lead-off ditches, culvert installation, and low water crossings).

A typical lead-off ditch has a minimum depth of 1 foot below and a berm of 6 inches above natural ground level. The berm shall be on the down-slope side of the lead-off ditch.

Cross Section of a Typical Lead-off Ditch



All lead-off ditches shall be graded to drain water with a 1 percent minimum to 3 percent maximum ditch slope. The spacing interval are variable for lead-off ditches and shall be determined according to the formula for spacing intervals of lead-off ditches, but may be amended depending upon existing soil types and centerline road slope (in %);

#### Formula for Spacing Interval of Lead-off Ditches

Example - On a 4% road slope that is 400 feet long, the water flow shall drain water into a lead-off ditch. Spacing interval shall be determined by the following formula:

400 foot road with 4% road slope: 
$$\frac{400'}{4\%} + 100' = 200'$$
 lead-off ditch interval

#### **Culvert Installations**

Appropriately sized culvert(s) shall be installed at the deep waterway channel flow crossing.

#### Cattleguards

An appropriately sized cattleguard(s) sufficient to carry out the project shall be installed and maintained at fence crossing(s).

Any existing cattleguard(s) on the access road shall be repaired or replaced if they are damaged or have deteriorated beyond practical use. The operator shall be responsible for the condition of the existing cattleguard(s) that are in place and are utilized during lease operations.

A gate shall be constructed and fastened securely to H-braces.

#### Fence Requirement


Where entry is required across a fence line, the fence shall be braced and tied off on both sides of the passageway prior to cutting.

The operator shall notify the private surface landowner or the grazing allotment holder prior to crossing any fence(s).

#### **Public Access**

Public access on this road shall not be restricted by the operator without specific written approval granted by the Authorized Officer.

Figure 1 - Cross Sections and Plans For Typical Road Sections

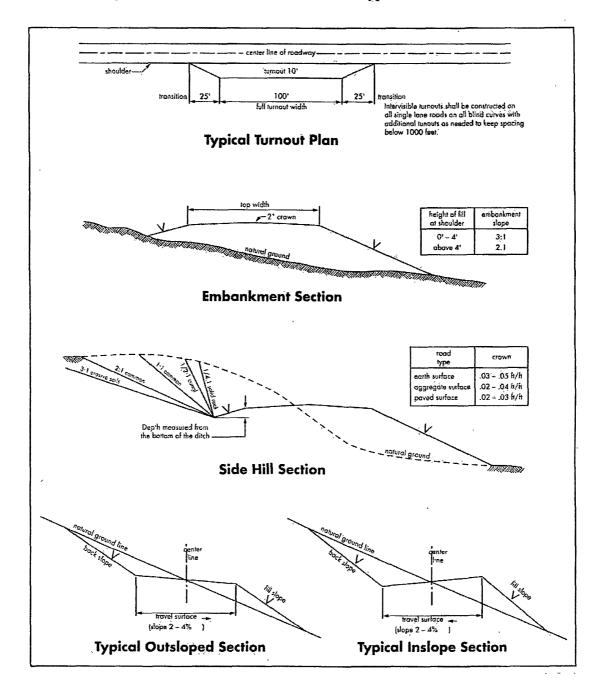

#### VII. DRILLING

# A. DRILLING OPERATIONS REQUIREMENTS

The BLM is to be notified a minimum of 4 hours in advance for a representative to witness:

- a. Spudding well
- b. Setting and/or Cementing of all casing strings
- c. BOPE tests

# **Eddy County**

Call the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220, (575) 361-2822

- 1. Although Hydrogen Sulfide has not been reported in this section, it is always a possible hazard. It has been reported in the Township to the east. If Hydrogen Sulfide is encountered, please report measured amounts and formations to the BLM.
- 2. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
- 3. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the dog house or stairway area.
- 4. The record of the drilling rate along with the CAL/GR/N well log run from TD to surface will be submitted to the BLM office as well as all other logs run on the borehole 30 days from completion. If available, a digital copy of the logs is to be submitted in addition to the paper copies.

#### B. CASING

Changes to the approved APD casing and cement program require submitting a sundry and receiving approval prior to work. Failure to obtain approval prior to work will result in an Incident of Non-Compliance being issued.

Centralizers required on surface casing per Onshore Order 2.III.B.1.f.

Wait on cement (WOC) time for a primary cement job will be a minimum 18 hours for a water basin, 24 hours in the potash area, or 500 pounds compressive strength, whichever is greater for all casing strings. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. See individual casing strings for details regarding lead cement slurry requirements.

No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.

Possible lost circulation in the Grayburg and San Andres Formations.

- 1. The 8-5/8 inch surface casing shall be set at approximately 900 feet and cemented to the surface.
  - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with a surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.
  - b. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry.
  - c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
  - d. If cement falls back, remedial cementing will be done prior to drilling out that string.

Pilot hole is required to have a plug at the bottom of the hole. If two plugs are set, the BLM is to be contacted (575-361-2822) prior to tag of bottom plug, which must be a minimum of 150' in length. Operator can set one plug from bottom of pilot hole to kick-off point and save the WOC time for tagging the first plug.

Centralizers required on horizontal leg, must be type for horizontal service and minimum of one every other joint.

	If cement does not circulate,	contact the appropriate BLM
office.		

2. The minimum required fill of cement behind the 5-1/2 inch production casing is:

3. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.

#### C. PRESSURE CONTROL

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2 and API RP 53 Sec. 17.
- 2. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 3000 (3M) psi. Operator installing a 5M system but testing as a 3M.
- 3. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
  - a. Casing cut-off and BOP installation will not be initiated until the cement has had a minimum of 8 hours setup time for a water basin. The casing shall remain stationary and under pressure for at least eight hours after the operator places the cement. In the potash area, the minimum time is 12 hours and the casing shall remain stationary and under pressure during this time period. Casing shall be under pressure if the operator uses some acceptable means of holding pressure or if the operator employs one or more float valves to hold the cement in place. Testing the BOP/BOPE against a plug can commence after meeting the above conditions plus the BOP installation time.
  - b. The tests shall be done by an independent service company utilizing a test plug.
  - c. The results of the test shall be reported to the appropriate BLM office.
  - d. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
  - e. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug.

f. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the **Wolfcamp** formation if the time between the setting of the surface casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per Onshore Order No. 2.

#### D. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the **Wolfcamp** formation, and shall be used until production casing is run and cemented.

#### E. DRILL STEM TEST

If drill stem tests are performed, Onshore Order 2.III.D shall be followed.

CRW 030910

# VIII. PRODUCTION (POST DRILLING)

#### A. WELL STRUCTURES & FACILITIES

#### **Placement of Production Facilities**

Production facilities should be placed on the well pad to allow for maximum interim recontouring and revegetation of the well location.

#### **Containment Structures**

The containment structure shall be constructed to hold the capacity of the entire contents of the largest tank, plus 24 hour production, unless more stringent protective requirements are deemed necessary by the Authorized Officer.

#### **Painting Requirement**

All above-ground structures including meter housing that are not subject to safety requirements shall be painted a flat non-reflective paint color Shale Green, Munsell Soil Color Chart # 5Y 4/2

#### IX. INTERIM RECLAMATION

During the life of the development, all disturbed areas not needed for active support of production operations should undergo interim reclamation in order to minimize the environmental impacts of development on other resources and uses.

Within six (6) months of well completion, operators should work with BLM surface management specialists (Jim Amos: 575-234-5909) to devise the best strategies to reduce the size of the location. Interim reclamation should allow for remedial well operations, as well as safe and efficient removal of oil and gas.

During reclamation, the removal of caliche is important to increasing the success of revegetating the site. Removed caliche that is free of contaminants may be used for road repairs, fire walls or for building other roads and locations. In order to operate the well or complete workover operations, it may be necessary to drive, park and operate on restored interim vegetation within the previously disturbed area. Disturbing revegetated areas for production or workover operations will be allowed. If there is significant disturbance and loss of vegetation, the area will need to be revegetated. Communicate with the appropriate BLM office for any exceptions/exemptions if needed.

All disturbed areas after they have been satisfactorily prepared need to be reseeded with the seed mixture provided below.

Upon completion of interim reclamation, the operator shall submit a Sundry Notices and Reports on Wells, Subsequent Report of Reclamation (Form 3160-5).

# X. FINAL ABANDONMENT & RECLAMATION

At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land are restored.

Earthwork for final reclamation must be completed within six (6) months of well plugging. All pads, pits, facility locations and roads must be reclaimed to a satisfactory revegetated, safe, and stable condition, unless an agreement is made with the landowner or BLM to keep the road and/or pad intact.

After all disturbed areas have been satisfactorily prepared; these areas need to be revegetated with the seed mixture provided below. Seeding should be accomplished by drilling on the contour whenever practical or by other approved methods. Seeding may need to be repeated until revegetation is successful, as determined by the BLM.

Operators shall contact a BLM surface protection specialist prior to surface abandonment operations for site specific objectives (Jim Amos: 575-234-5909).

#### Northern Aplomado Falcon Seed Mixture

Buffalograss (Buchloe dactyloides)	4 lbs/acre
Blue grama (Bouteloua gracilis)	1 lbs/acre
Cane bluestem (Bothriochloa barbinodis)	5 lbs/acre
Sideoats grama (Boutelou curtipendula)	5 lbs/acre