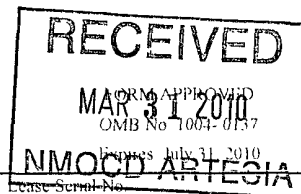


UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE - Other Instructions on page 2

1	Type of Well <input type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other SWD	5	Lease Serial No. NMNM101108
2	Name of Operator Marbob Energy Corporation	6	If Indian, Allottee, or Tribe Name
3a	Address PO Box 227 Artesia, NM 88211-0227	7	If Unit or CA Agreement Name and/or No
3b	Phone No. (include area code) (575) 748-3303	8	Well Name and No West Brushy 8 Federal SWD #1
4	Location of Well (Footage, Sec., T., R., M., or Survey Description) 660 FNL 330 FEL, Sec. 8-T26S-R29E, Unit A	9	API Well No 30-015-31675
		10	Field and Pool, or Exploratory Area
		11	County or Parish, State Eddy Co., NM

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Altering Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input checked="" type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other Repairs
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13 Describe Proposed or Completed Operation (clearly state all pertinent details including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompletable horizontally, give subsurface locations and measured and true vertical depths or pertinent markers and sands. Attach the Bond under which the work will be performed or provide the Bond No. on file with the BLM/ BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletable in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notice shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

1/27/10 - Pressure tested tubing/casing annulus to 500# for 30 minutes Held OK. Test witness and chart retained by Darold Gray with OCD - Artesia.

(See detailed procedure attached)

*Subject to like approval from State

14 I hereby certify that the foregoing is true and correct Name (Printed Typed) Diana J. Briggs		Title	Production Manager
Signature		Date	March 8, 2010
THIS SPACE FOR FEDERAL OR STATE OFFICE USE			
Approved by		Title	Day
Conditions of approval, if any are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.		Office	MAR 28 2010
Title 18 U.S.C. Section 1001 AND Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.			
BUREAU OF LAND MANAGEMENT CARLSBAD FIELD OFFICE			

288 4-6-10

MARBOB ENERGY CORPORATION
WEST BRUSHY 8 FEDERAL SWD #1 (Re-entry)
660 FNL 330 FEL, SEC. 8-T26S-R29E, UNIT A
30-015-31675, SWD; DELAWARE
EDDY COUNTY, NM

01/22/10 RPL TOP JT TBG, CUT & RPL 8 5/8" & 5 1/2" CSG. 7 00 A.M. SAFETY MTG RU. TP 400#. BLOW WELL DN TO GAS BUSTER W/O WELDER & KILL TRUCK 9 00 A.M. RU WATSON HOT OILER TO TBG. PMP 15 BBLS WTR. RD WATSON. WELDER TRIED HEATING UP BENT JT WHILE TRYING TO STRAIGHTEN W/ UT. BROKE @ BEND ND LARKEN HEAD WELDED ON COLLAR W/ 8' SUB PULLED OFF SLIPS. GOT OFF ON/OFF TOOL LD BAD JT. NU BOP SWI. DUG OUT AROUND W/H. TRIED STRAIGHTENING 5 1/2" CSG WOULDN'T STRAIGHTEN OUT DUG 8' DEEP AROUND 8 5/8" CSG. READY FOR CUT & WELD ON MONDAY. SDFTD.

01/25/10 7 00 A.M. SAFETY MTG. POOH W/ 132 JTS IN DERRICK. PU & MU 5 1/2" 10-K AS-V RBP. RIH W/ 10 JTS. SET RBP @ 324'. GOT OFF ON/OFF TOOL. POOH. RU MUSCLE KILL TRUCK. PMPD 3 BBLS FRESH ON RBP. ND BOP. RU WELDER. CUT 8 5/8". PULLED SLIPS. CUT 5 1/2" CSG. WELDED ON NEW 5 1/2" CSG & NEW 8 5/8" CSG. DROP SLIPS. USED SAME 8 5/8" W/H. NU LARKEN HEAD. NU BOP. RIH W/ ON/OFF RTNR TOOL. LATCHED ONTO RBP RLS & POOH. W/O NP ON/OFF TOOL. REDRESSED. 4:00 P.M. PU & MU 5 1/2" NP ON/OFF TOOL. RIH W/ 132 JTS. PU 2 7/8" PLASTIC I.D. REPLACEMENT JT. TAGGED VERSASET PKR. PULLED OFF 8'. RU MUSCLE WHITE KILL TRUCK & CIRC 118 BBLS PKR FL W/ FRESH. ND KILL TRUCK. ND BOP. LATCHED ONTO PKR. SET PKR W/ 12 POINTS IN COMP. NU LARKEN HEAD. TEST TO 500# TEST OK. HELD FOR 10 MINS. RD & RLS KILL TRUCK SWI SDFTD

01/27/10 RU KILL TRUCK TO BACKSIDE OF WELL. PRESS UP TO 500# & CHART FOR 30 MINS. HAVE DAROLD GRAY FR/ OCD WITNESS CHART. HELD PSI GOOD. RD KILL TRUCK. SWI.