

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☒ gas well ☐ other ☐

2. NAME OF OPERATOR

Texaco Inc.

3. ADDRESS OF OPERATOR

P.O. Box 728, Hobbs, New Mexico 88240

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

AT SURFACE: 660' FNL & 330' FEL  
AT TOP PROD. INTERVAL: (Unit Letter 'A')  
AT TOTAL DEPTH:


16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐  
FRACTURE TREAT ☐  
SHOOT OR ACIDIZE ☒  
REPAIR WELL ☐  
PULL OR ALTER CASING ☐  
MULTIPLE COMPLETE ☐  
CHANGE ZONES ☐  
ABANDON\* ☐  
(other) ☐

SUBSEQUENT REPORT OF:

☐  
☐  
☐  
☐  
☐  
☐  
☐  
☐  
☐  
☐

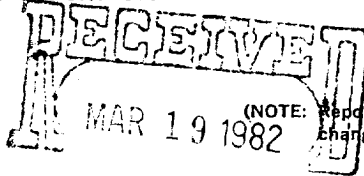

OIL & GAS  
U.S. GEOLOGICAL SURVEY  
ROSWELL, NEW MEXICO

5. LEASE

LC-028978-B

APR 1 1982

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

O. C. D.

7. UNIT AGREEMENT NAME

ARTESIA, OFFICE

North Benson Queen Unit

8. FARM OR LEASE NAME

North Benson Queen Unit

9. WELL NO.

34

10. FIELD OR WILDCAT NAME

Benson Queen Grayburg North

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 33, T-18-S, R-30-E

12. COUNTY OR PARISH

Eddy

13. STATE

New Mexico

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)

3442' (DF)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

1. Rig up. Pull rods & pump. Install BOP. Pull tubing.
2. Clean Out.
3. Set RBP @ 3325' & pkr. @ 3000'. Acidize 4½" Csg. perfs. 3308' - 3313' w/500 gal. 15% NEFE Acid. Flush w/2% KCI Water.
4. Reset RBP @ 3000' & pkr. @ 2900'. Acidize 4½" Csg. perfs. 2980' - 2988' w/500 gals. 15% NEFE Acid. Flush w/2% KCI Water.
5. Reset RBP @ 2900' & pkr. @ 2850'. Acidize 4½" Csg. perfs. 2892' - 2898' w/500 gals. 15% NEFE Acid. Flush w/2% KCI Water.

Subsurface Safety Valve: Manu. and Type \_\_\_\_\_ Set @ \_\_\_\_\_ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE Asst. Dist. Mgr DATE 3-18-82

APPROVED BY

(Orig. Sgd.) PETER W. CHESTER

(This space for Federal or State office use)

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

MAR 31 1982

FOR

JAMES A. GILLHAM  
DISTRICT SUPERVISOR

\*See Instructions on Reverse Side

Lease: LC-028978-B

Lease Name: North Benson Queen Unit

Well No.: 34

17. Describe proposed or completed operations continued:

6. Reset RBP @ 2850' & pkr. @ 2750'. Acidize 4½" Csg. perfs. 2784' - 2796' w/500 gals. 15% NEFE Acid. Flush w/2% KCI Water.
7. Pull pkr. & RBP. Install pumping equipment. Test & return to production.