

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.

LC-029388-A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

RECEIVED

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Shugart "A"

9. WELL NO.

2

10. FIELD AND POOL, OR WILDCAT

Shugart

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 10-18S-31E

12. COUNTY OR PARISH 13. STATE

Eddy

N.M.

1. OIL WELL ☐ GAS WELL ☐ OTHER ☒ Water Injection
2. NAME OF OPERATOR William A. & Edward R. Hudson ✓
3. ADDRESS OF OPERATOR P.O. Box 9, Maljamar, New Mexico 88264 C. C. D.
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.)
At surface
1980' from south and west lines,
Sec. 10-18S-31E

14. PERMIT NO. 15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3724 DF

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☒

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

We propose to permanently plug and abandon this well as follows:

Set a cast iron bridge plug at 3200', place 35' cement on top of plug, fill hole with salt gel mud, spot 100' cement from 1995' to 1895', perf. 5-1/2" casing at 780', set cement retainer at 710', circulate cement to the surface, fill hole with fresh water, place 150' cement on top of retainer, place 60' cement at the surface, install 4" x 8' dry hole marker with well data, clean location of all debris, restore surface to BLM regulations.

Notify BLM at 887-6544 and NMOCD at 748-1283 prior to commencing P & A operations.

RECEIVED

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Prod. Supt.

DATE 8/8/89

(This space for Federal or State office use)

APPROVED BY

TITLE

PETROLEUM ENGINEER

DATE


8-25-89

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

WILLIAM A. & EDWARD R. HUDSON
Shugart A # 2

SKETCH

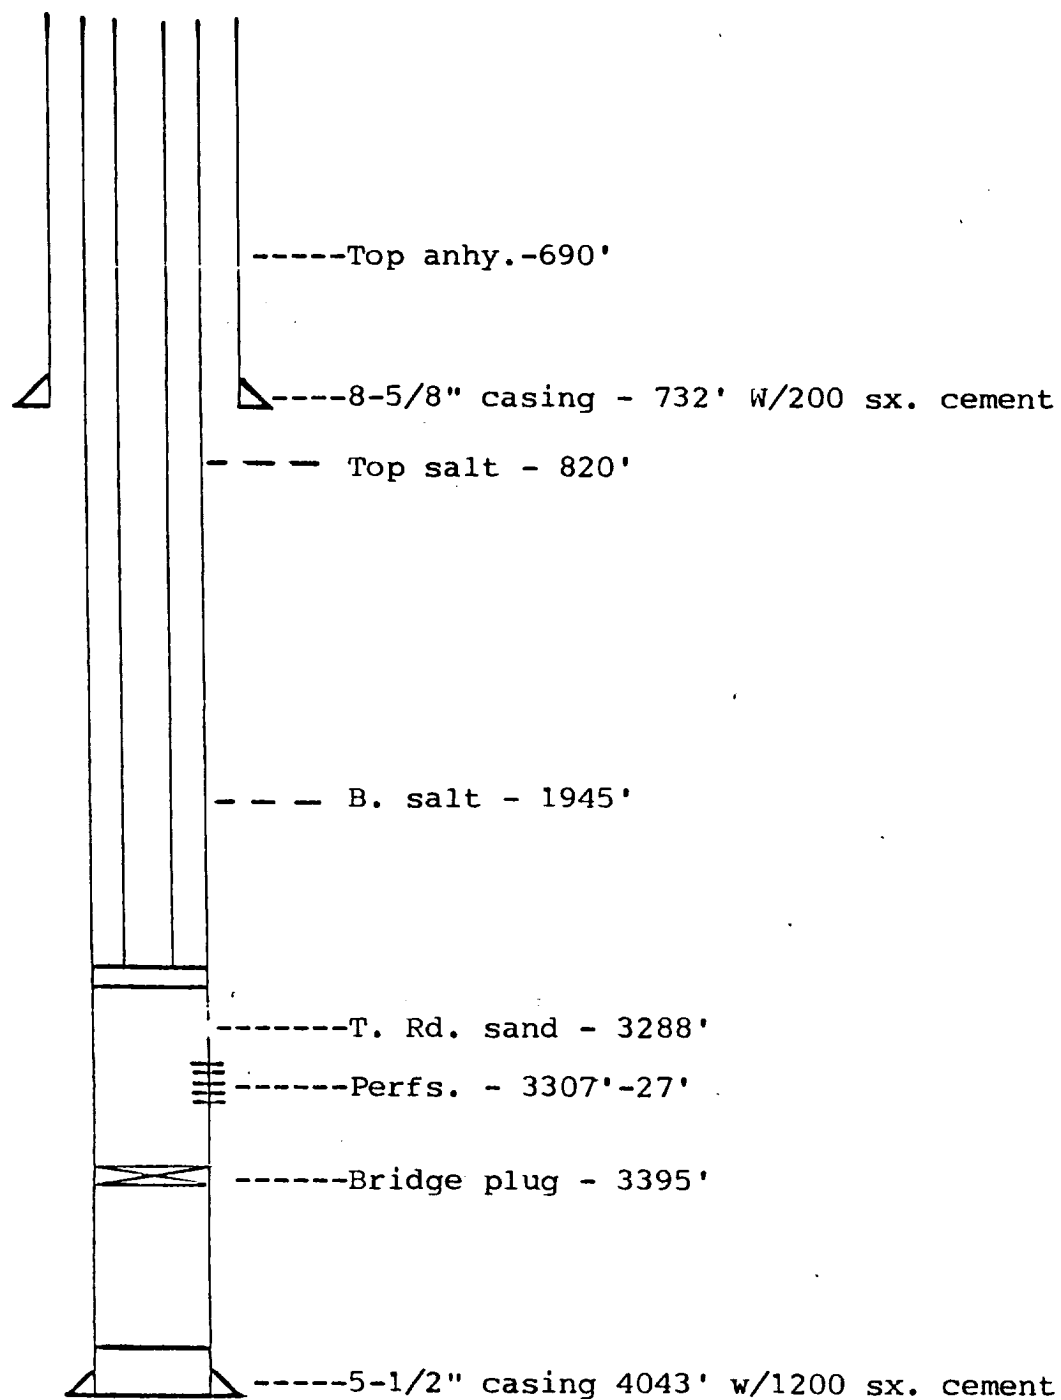

Total Depth - 4056'