ار مر Form 3160-5 August 2007)	UNITED STATES OCD Artesia DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT			Artesia	FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010				
	SUNDRY	NOTICES AND REPO s form for proposals to I. Use form 3160-3 (AP	RTS ON	WELLS		 Lease Serial No. NMNM027994D If Indian, Allottee or Tribe Name 			
							reement, Name and/or No		
SUBMIT IN TRIPLICATE - Other instructions on revers				n reverse side.			, , ,		
1. Type of Well	Gas Well 🔲 Oth	er				8. Well Name and N FEDERAL LL 1	0.		
2. Name of Operator COG OPERAT	FING LLC	Contact: E-Mail: bmaiorino	BRIAN M @concho.c	AIORINO		9. API Well No. 30-015-20855			
3a. Address 3b. Phone No				ne No. (include area code) 2-221-0467			10. Field and Pool, or Exploratory YARROW;BONE SPRING,SOUTH		
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)						11. County or Parish, and State			
Sec 13 T23S F	R26E SESW 66	OFSL 1980FWL				EDDY COUN	ΓΥ, NM		
12.	CHECK APPF	ROPRIATE BOX(ES) TO) INDIC.	ATE NATURE OF N	OTICE, R	L EPORT, OR OTH	ER DATA		
TYPE OF SUE	BMISSION			TYPE OF	ACTION	······			
🔀 Notice of Inte	Notice of Intent		-		Product	tion (Start/Resume) ation	□ Water Shut-Of		
🗖 Subsequent R	Report	Casing Repair		New Construction	🖾 Recom	plete	☐ Other		
🗖 Final Abando				Plug and Abandon Plug Back					
following completesting has been conducted to the following determined that the following determined that the following determined that the following completesting determined the following completesting determined that the following completesting determined the following determined the follow	tion of the involved ompleted. Final Ab he site is ready for fi	k will be performed or provide operations. If the operation re andonment Notices shall be fil nal inspection.) equest to abandon the We	sults in a m ed only afte	ultiple completion or recor er all requirements, includir and recomplete the Fe	npletion in a 1g reclamatio deral LL #	new interval, a Form 3 n, have been completed 1 in the	160-4 shall be filed once		
Test anchors i MIRU	f necessary			RECEIVE	ע	APPI	ROVAL BY ST.		
Kill well if nece				SEP 04 2013	1				
Remove wellh	ead & install BC	P. tool. (If cannot release, p	unch hol	e indubina and Mar	A AN	SEE ATTA	CHED FOR		
	d visually inspec	t. If necessary, utilize wo		12 Declo Accepted			INS OF APPR		
14. I hereby certify t	hat the foregoing is	Electronic Submission #	217398 ve PERATIN	erified by the BLM Well IG LLC, sent to the Car	Information Isbad	n System			
	ped) BRIAN MA	Committed to AFMSS f	or proces	sing by KURT SIMMON	IS on 08/19/	/ 2013 () PRESENTATIVE			
Name(Printed/Ty)									
				Date 08/19/20	13 –				
Name(Printed/Ty) Signature	(Electronic S		DR FEDI			SE APPR	oved +		
	(Electronic S		DR FEDI	ERAL OR STATE C		se <u>APPR</u>	OVED		
Signature			<u> </u>	ERAL OR STATE C		SE APPR	OVED 9-2013-91		

** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED **

r

Additional data for EC transaction #217398 that would not fit on the form


32. Additional remarks, continued

۰.

Þ

Set a CIBP @ 9900? **W** TIH with tubing open ended *SLCCOA* Spot Class H cement mixed at 16.4# gal from 8700? 8900 (Wolfcamp top @ 8722? but bottom Bone Spring perf @ 8564? or deeper) Circulate well clean & TOH Pressure test casing to 5000 psi Run CBL to determine top of cement Perforate 3rd Bone Spring @ 8552? (40 holes) w/6 spf, 600 phasing utilizing Schlumberger openhole log dated 7/22/73. TIH w/tubing & packer. Spot acid across perfs. Set packer at 7250? Acidize zone with 2000 gallons 15% HCI at 3 ? 5 BPM while dropping balls Shut-in 1 hour & flow back Pull tubing and packer Set frac valve & prepare for frac. Frac 3rd Bone Spring. Set flow through composit plug at 7100? Perforate 2nd Bone Spring @ 6870? (40 holes) w/6 spf, 600 phasing utilizing Schlumberger openhole log dated 7/22/73. Set flow through composit plug at 6600? Perforate 1st Bone Spring. Set flow through composit plug at 6600? Perforate 1st Bone Spring. Shut-in well for 24 hours Flow well back until dead. TIH with tubing a drill out plugs. TOH TIH with tubing & artificial lift equipment. Place well on test

*Closed-loop system will be used durring operatings.

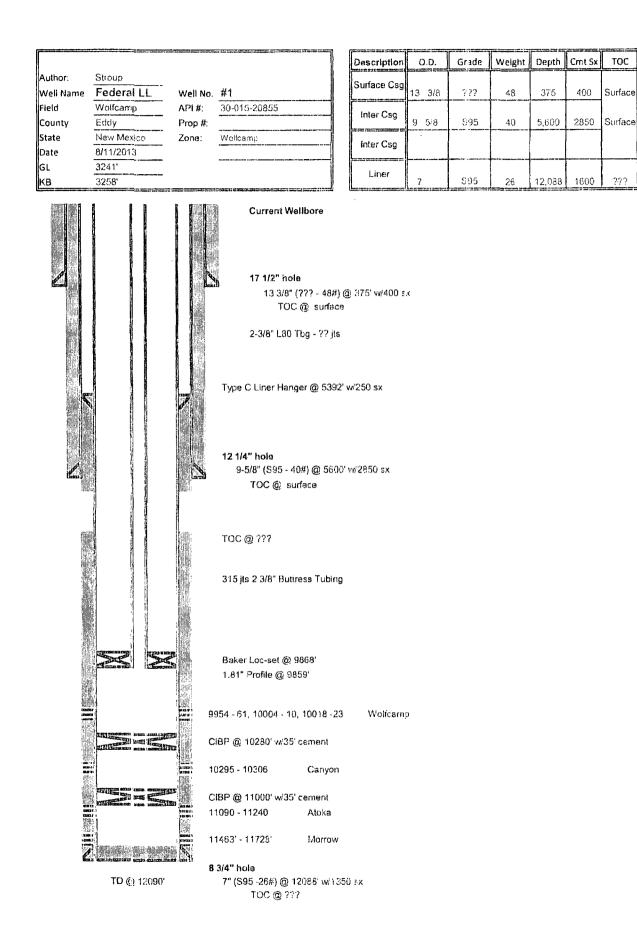

		ller entrette billerindet gibt			
					Description
Author: '	Stroup				Surface Csg
Well Name	Federal LL V	Vell No.	#1		
Field	Wolfcamp A	APL#:	30-015-20855		Inter Csg
County	standard and an international statements of the statement	²юр #:			9 (inter 0.5g
State	and the state of t	Zone:	Wolfcamp		Inter Csg
Date	8/11/2013				
GL	3241'			1	Liner
КВ	3258'	17 19 19 19 19 19 19 19 19 19 19 19 19 19			
) @ surface bg - ?? jts er @ 5392' #) @ 5600'	
			1st BS @ 6303' 2nd BS @ 6870 3rd BS @ 8552		
		C	ement plug 8700 - 89	900	
			CIBP @ 9900		
		9	954 - 61, 10004 - 10,	10018 -23	Wolfcamp
		C	IBP @ 10280' w/35' d	cement	
Table 1	i i i i i i i i i i i i i i i i i i i	1	0295 - 10306	Canyon	
		c	IBP @ 11000' w/35' (1090 - 11240		
	1) 13 (au		1463' - 11728'	Morrow	
2	Ϋ́D @ 12:090'	8	3/4" hole 7" (\$95 -26#) @ 12 TOC @ ???	:088' w/135i) sx

.

.

O:\Regulatory\Basin\Recompletions\Federal LL	1\Federal LL	1 proposed wellbore.xlsx

Description	0.D.	Grade	Weight	Depth	Cmt Sx	тос
Surface Csg	13 3/8	???	48	375	400	Surface
Inter Csg	9 5/8	S95	40	5,600	2850	Surface
Inter Csg						
Liner	7	S95	26	12,088	1600	???

Federal LL 1 30-015-20855 COG Operating LLC September 03, 2013 Conditions of Approval

Notify BLM at 575-361-2822 a minimum of 24 hours prior to commencing work.

Work to be completed by December 03, 2013.

- 1. Operator shall tag existing CIBP at approximately 10,245'.
- 2. Operator shall set CIBP at 9,900 and place 25 sx of Class H cement on top. Tag required.
- 3. Operator shall place a Class H cement plug from 8,800'-8,600' to seal the top of the Wolfcamp formation.
- 4. Submit a copy of CBL to BLM. If squeeze is needed, submit plan to BLM CFO Engineer for approval.
- 5. Must conduct a casing integrity test before perforating and fracturing. Submit results to BLM. The CIT is to be performed on the production casing to max treating pressure. Notify BLM if test fails.
- 6. Before casing or a liner is added or replaced, prior BLM approval of the design is required. Use notice of intent Form 3160-5.
- 7. Surface disturbance beyond the originally approved pad must have prior approval.
- 8. Closed loop system required.
- 9. All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of work over operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area. Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.

.

10. Operator to have H2S monitoring equipment on location.

- 11. A minimum of a 3000 (3M) BOP to be used. All blowout preventer (BOP) and related equipment (BOPE) shall comply with reasonable well control requirements. A two ram system with a blind ram and a pipe ram designed for the size of the work string shall be adequate. Tapered work strings will require an additional pipe ram. The manifold shall comply with Onshore Oil and Gas Order #2 Attachment I (3M Diagrams of Choke Manifold Equipment). The accumulator system shall have an immediately available power source to close the rams and retain 200 psi above pre-charge. The pre-charge test shall follow requirements in Onshore Order #2.
- 12. Subsequent sundry required detailing work done and completion report for the new formation. Operator to include new well plat and well bore schematic of current well condition when work is complete.
- 13. See attached for general requirements.

JAM 090313

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

General Requirements for Plug Backs

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from this approval.

If you are unable to plug back the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged back. Failure to do so will result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plug back operations. For wells in Eddy County, call 575-361-2822.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. **Before pumping cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either **Neat Class** "C", for up to 7,500 feet of depth or **Neat Class** "H", for deeper than 7,500 feet plugs.

6. <u>Subsequent Plug back Reporting</u>: Within 30 days after plug back work is completed, file one original and three copies of the Subsequent Report, Form 3160-5 to BLM. The report should give in detail the manner in which the plug back work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date work was completed</u>.

7. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.