DISTRICT I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720
DISTRICT II
811 S. First St., Artesia, NM 88210
Phone: (575) 748-1283 Fax: (575) 748-9720
DISTRICT III
1000 Rio Brazos Road, Aztec, NM 87410
Phone: (505) 334-6178 Fax: (505) 334-6170
DISTRICT IV

DISTRICT IV 1220 S. St. Francis Dr., Santa Fe, NM 87505 Phone (505) 476-3460 Fax (505) 476-3462

State of New Mexico Energy, Minerals & Natural Resources Department OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, New Mexico 87505

Form C-102 Revised August 1, 2011 Submit one copy to appropriate District Office

□AMENDED REPORT

WELL LOCATION AND ACREAGE DEDICATION PLAT

TANK.	DI Nimekov	i	<u> </u>	Pool Code	1.2.710103	AGE DEDICA		Pool Name	<u> </u>	
30-015	Pl Number — #10	58				Comment)		e Sprin	ا ح
Property C		JO	ا ا	238	Property Nan		ب مر	J. Wi		Vell Number
riopeny	.oue			CEDA	AR CANYO	N 17 III	······			1H
OGRID I					Operator Nan				Elevation	
1669	16	1		(C	XY U.S.A.	<u> </u>				2928'
[[0]12/5V	1 (0.2.12)	Toursell	Dana	1 54 1.4-	Surface Locat		E = N	From the	East NV 2	County
ÚL or lót No.	Section	Township	Range	Lot ldn	Feet from the	North/South line		from the	East/West line	4 1.35. 3
A	17	24-S	29-E	Dotto- II-1	1150	NORTH erent From Surface	. 3	150	EAST	EDDY
UL or lot No.	Section	Township	Range	Lot ldn	Feet from the	North/South line	Feet	from the	East/West line	County
E	17	24-S	29-E		1980	NORTH		350	WEST	EDDY
	L	<u> </u>	L		Penetration Point	_1		1		
UL or lot No.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet	from the	East/West line	County
H	17	24-S	29-E		1671	NORTH	g	980	EAST	EDDY
Dedicated Acres	Joint o	1	onsolidation C	ode Ord	er No.	<u></u>	L		<u> L</u>	<u></u>
160	N			:						
		NED TO THIS CO	MPLETION UN	ITIL ALL INTE	RESTS HAVE BEEN	CONSOLIDATED OR A	NON-STA	NDARD UNI	T HAS BEEN APPRO	VED BY THE DIVISION
A				Γ	В		ا آماد	* * * * * * * * * * * * * * * * * * *		
.	į				9,1	1 .			ATOR CERTII	
1].					tify that the information the best of my knowled	
	1			1	1		150		anization either owns a ineral interest in the land	2.00 + 5.00 + 5.00 + 6.00 + 6.00
	i				1	7/2	ĪH	proposed be	ottom hole location or h	as a right to drill this
.,086					238'00'24"	16.	4 #		location pursuant to a co eral or working interest,	
1 21	1			HORIZ. DI 	ST.=975.1'	S.I	-	pooling agn	eement or a compulsory entered by the division.	
Vizitorii.	. *********		· · · · · · · · · · · · · · · · · · ·	! ********	اغ. خرجر در	mani de la companya dela companya dela companya dela companya de la companya dela companya de la	150	neremore e		
H		530		PROJEC	CT AREA		Ď		7.//	21, 14
1	777777	15552777 61	777777	425555		PP	980	Signature	121	216 (14 Date
350'		COIN 47 = 2	65.51,17	+	NO ADEA	3	31		Class +	50 8
330' B.H.	;	GRID AZ.=2 HORIZ. DIST	.=3974.5	PRODUCI	NG AREA	1	330,	Printed No	Stewart '	JK, Keg-HELL
K Eur	222	1111111	1112111	1111111	unner b	ingunial)	41			texx1.ou
1 c	; 1	330,		1	1	· · · · · · · · · · · · · · · · · · ·	_ [1]	E-mail Ad		
THILLIA	(22222	11111111	1111111	111111	mini		4			
	 		_	1	1.				EYOR CERTIF	
		DINATES TABL N. X=59853		4	GEODETIC CO				tify that the well location from field notes of actu	
		N, $X = 60251$		1	NAD 27	IAMÉ		me or under	my supervision, and th	at the same is true
		N, X=60383		1	SURFACE L				to the best of my belief.	
		N, X=60384: N, X=60252		1	Y=44448 X=60369		H	<u> </u>	SEPTEMBER 2	0, 2013
G - Y=	443009.6	N, X=59855	7.6 E	1	7-0000s	,,0 E		Date of Su Signatures	rveXmining	al Surveyor
		N, X=59854 N, X=60385		1	LAT.=32.22	21569° N		10 D	rvex	Maj
11 ' - '-	:	ľ	4.U L	1.	LONG. = 103.9	990023 W		(A)	N MEY	D W
		ION POINT 7 NME		1.	BOTTOM HOLI		[1		\$ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\	
				1	Y=44368 X=59890			12641) S		
		171.0 N 167.2 E			V=53030	ν μ				
				l	LAT.=32.21			/2/V/	71100m	94/14 6-3-deep 12641
		20156° N		ł	LONG.=104,	01.3523° W		Certificate Number Cary Cartidson 12641		
	LUNG. = 1U4	000702° W		1				ACK REL	it "George 1.0.W	

Operator Name/Number: Lease Name/Number: Pool Name/Number:

 OXY USA Inc.
 16696

 Cedar Canyon 17 #1H
 Fee

 Corral Draw Bone Spring
 2nd Bone Spring
 96238

 1150 FNL 150 FEL A Sec 17 T24S R29E

Surface Location:
Penetration Point:
Bottom Hole Location:

1671 FNL 980 FEL H Sec 17 T24S R29E 1980 FNL 350 FWL E Sec 17 T24S R29E

C-102 Plats: 9/20/13 10/10/13 2/4/14 Elevation: 2928' GL Objective: 2nd Bone Spring

13188' TMD Proposed TD: Pilot Hole 8841' TVD Horizontal Lateral 8603' NAD - 1927 SL - Lat: 32.221569 Long: 103.998023 X=603694.0 Y=444487.5 PP - Lat: 32.220156 Long: 104.000702 X=602867.2 Y=443971.0 NAD - 1927 NAD - 1927 BH - Lat: 32.219399 Long: 104.013523 X=598902.9 Y=443683.6

Casing Program:

Hole Size	Interval	OD Csg	Weight	Collar	<u>Grade</u>	Condition	Collapse Design Factor	<u>Burst</u> <u>Design</u> <u>Factor</u>	Tension Design Factor
14-3/4"	0-350'	11-3/4"	47	BT&C	J55	New	13.03	1.43	6.5
				Hole filled w	/ith 8.5# M u	ıd	1510#	3070#	
10-5/8"	0-2900'	8-5/8"	32	LT&C	J-55	New	4.31	1.31	2.34
				Hole filled w	ith 10.2# N	lud	2530#	3930#	
7-7/8"	0-13188'	5-1/2"	17	BT&C.	L-80	New	1.47	1.22	1.77
				Hole filled w	/ith 9.2# Mu	ıd	6290#	7740#	

Collapse and burst loads calculated using Stress Check with anticipated loads

Cement Program:

a. 11-3/4" Surface

Circulate cement to surface w/ 280sx PPC cmt w/ 1% CaCl2, 14.8ppg 1.34 yield

1416# 24hr CS 125% Excess

b. 8-5/8" Intermediate

Intermediate Circulate cement to surface w/ 560sx HES Light PPC cmt w/ 5% salt + .25% HR-800, 12.9ppg 1.85 yield 771# 24hr CS 125% Excess followed by 230sx PPC cmt, 14.8ppg

1.33 yield 1779# 24hr CS 125% Excess

c. Pilot Hole Plug

Plug #1 cement w/ 290sx PPC cmt w/ .3 HR-601, 14.4ppg 1.23 yield 724# 24hr CS

50% excess from 8841' to +/-8141'.

Plug #2 cement w/ 390sx PPC cmt w/ .85% CFR-3 + .25% HR-601, 18.0ppg 0.90 yield

697# 24hr CS 50% Excess from 8141' to +/-7450'

d. 5-1/2" Production

Cement w/ 620sx PP cmt w/ 14.8#/sx Silicalite 50/50 Blend + 15#/sx Scotchlite HGS-6000 + 3#/sx Kol-Seal + .125#/sx Poly-E-Flake + .25#/sx HR-800, 10.2ppg 2.95 yield 947# 24hr

CS 100% Excess followed by 830sx Super H cmt w/ 3#/sx salt + .4% CFR-3 + .5% Halad-344 + .3% HR-800 + .125#/sx Poly-E-Flake, 13.2ppg 1.66 yield 615# 24hr CS

40% Excess. Calc TOC-1900'

Description of Cement Additives: Calcium Chloride, Salt (Accelerator); Silicalite (Additive Material);

CFR-3 (Dispersant); Bentonite, Schotchlite HGS-6000 (Light Weight Additive);

Kol-Seal, Poly-E-Flake (Lost Circulation Additive); Halad-344 (Low Fluid Loss Control); HR-601, HR-800 (Retarder)

The above cement volumes could be revised pending the caliper measurement.

Proposed Mud Circulation System:

<u>Depth</u>	Mud Wt.	<u>Visc</u>	<u>Fluid</u>	Type System
	ppg	<u>sec</u>	Loss	
0 - 350'	8.5	28-38	NC	Fresh Water/Spud Mud
350 - 2900'	10.2	28-32	NC	Fresh water/NaCl Brine
2900 - 8841' (Pilot Hole)	9.2	28-34	<10	Cut Brine/Sweeps
7648 - 13188' (Curve-Lateral)	9.2	32-50	<18	Duo Vis/Salt Gel/Starch/PAC

Pump high viscosity sweeps as needed for hole cleaning. The mud system will be monitored visually/manually as well as with an electronic PVT. The necessary mud products for additional weight and fluid loss control will be on location at all times.

BOP Program:

Surface None


Intermediate/Production 13-5/8" 10M three ram stack w/ 5M annular preventer, 5M Choke Manifold

Estimated Tops of Geological Markers & Depths of Anticipated Fresh Water, Oil or Gas:

Geological Marker	<u>Depth</u>	<u>Type</u>
a. Rustler	83'	Formation
b. Top Salt	569'	Formation
c. Bottom Salt	1293'	Formation
d. Delaware	2838'	Formation
e. Delaware-Bell Canyon	2880'	Oil/Gas
f. Delaware-Cherry Canyon	3631'	Oil/Gas
g. Delaware-Brushy Canyon	4991'	Oil/Gas
h. 1st Bone Spring	6571'	Oil/Gas
i. 2nd Bone Spring	7834'	Oil/Gas
i 3rd Bone Spring	8690'	Oil/Gas :

Fresh water may be present above the Rustler formation. Surface casing will be set below the top of the Rustler, which will cover potential fresh water sources.

A closed loop system will be utilized consisting of above ground steel tanks and haul-off bins. Disposal of liquids, drilling fluids and cuttings will be disposed of at an approved facility.

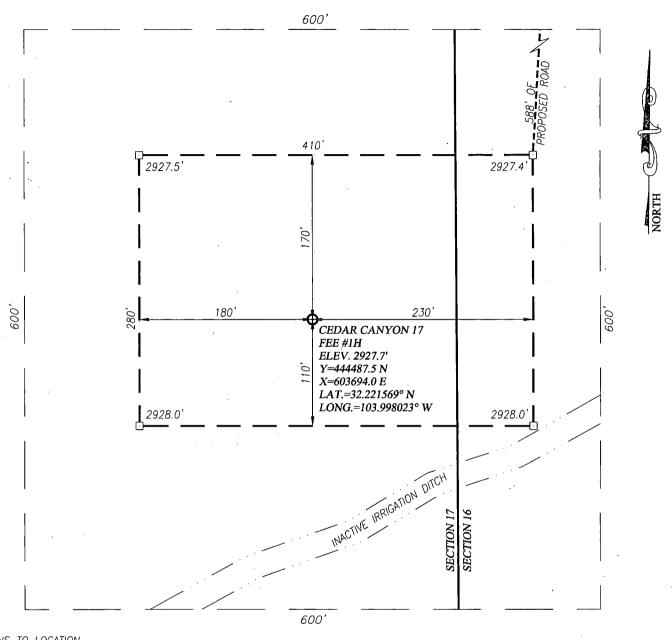

DIRECTIONS TO LOCATION

FROM THE INTERSECTION OF CO. RD. 720 (DUARTE RD.) AND CO. RD. 746 (McDONALD RD.) 1.3 MILES EAST OF U.S. HWY. 285 GO SOUTH ON CO. RD. 746 APPROX 0.8 MILES; VEER LEFT AND GO EAST APPROX. 6.8 MILES; TURN LEFT AND GO WEST 0.1 MILES; TURN RIGHT AND GO NORTH APPROX. 0.1 MILES; VEER RIGHT AND GO EAST APPROX. 0.1 MILES; TURN LEFT AND GO NORTH — NORTHEAST APPROX. 0.3 MILES; VEER RIGHT AND GO EAST — NORTHEAST APPROX. 0.5 MILES; VEER LEFT AND GO NORTH APPROX. 0.1 MILES; VEER LEFT AND GO NORTHWEST APPROX. 2.1 MILES; TURN LEFT AND GO SOUTH APPROX. 0.2 MILES; TURN RIGHT AND GO WEST APPROX. 0.7 MILES; TURN LEFT AND GO SOUTHEAST APPROX. 0.2 MILES TO THE EXISTING CEDAR CANYON 16 STATE #1. FOLLOW STAKED ROAD AND PAD WEST 428 FEET AND 588 FEET SOUTH TO THIS LOCATION.



PROVIDING SURVEYING SERVICES
SINCE 1946

SINCE 1946 **IOHN WEST SURVEYING COMPANY**

412 N. DAL PASO HOBBS, N.M. 88240 (575) 393-3117 www.jwsc.biz

OXY U.S.A. INC

CEDAR CANYON 17 FEE #1H WELL LOCATED 1150 FEET FROM THE NORTH LINE AND 150 FEET FROM THE EAST LINE OF SECTION 17, TOWNSHIP 24 SOUTH, RANGE 29 EAST, N.M.P.M., EDDY COUNTY, NEW MEXICO

Survey Date: 9/20/13

CAD Date: 10/7/13


Drawn By: BKL

W.O. No.: 13111060 F

Rel. W.O.:

Sheet 1 of

LOCATION VERIFICATION MAP

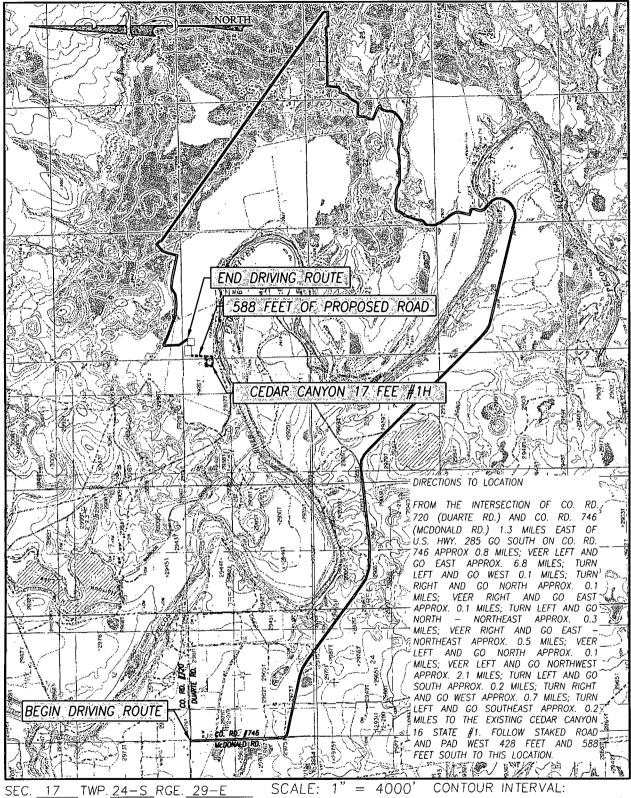


COUNTY EDDY STATE NEW MEXICO
DESCRIPTION 1150' FNL & 150' FEL
ELEVATION 2928'
OPERATOR OXY U.S.A. INC.
LEASE CEDAR CANYON 17 FEE
U.S.G.S. TOPOGRAPHIC MAP
PIERCE CANYON, N.M. SURVEY N.M.P.M.

CONTOUR INTERVAL: PIERCE CANYON, N.M. – 10' MALAGA, N.M. – 10'



VICINITY MAP

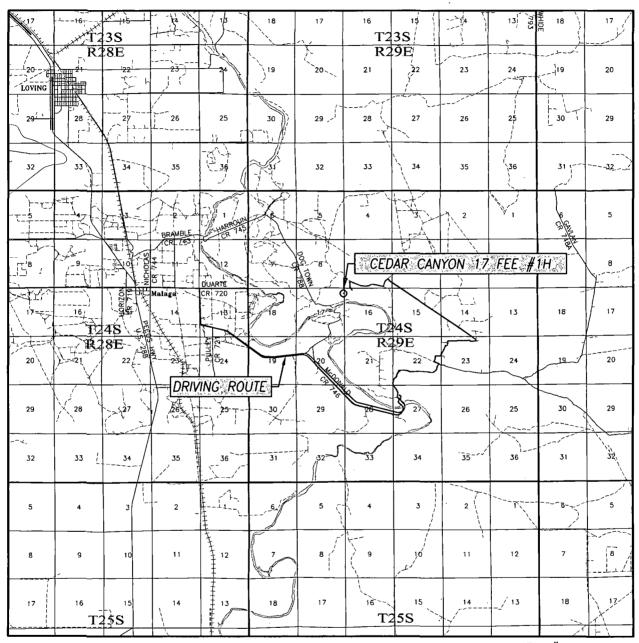

SCALE: 1" = 2 MILES

DRIVING ROUTE: SEE LOCATION MAP

SEC. __17__TWP. _24_S __RGE. __29_E

SURVEY ______ N.M.P.M.


COUNTY __EDDY __STATE __NEW __MEXICO

DESCRIPTION ______ 1150' FNL & 150' FEL


ELEVATION ______ 2928'


OPERATOR _____ OXY __U.S.A. __INC.

LEASE _____ CEDAR __CANYON __17 FEE





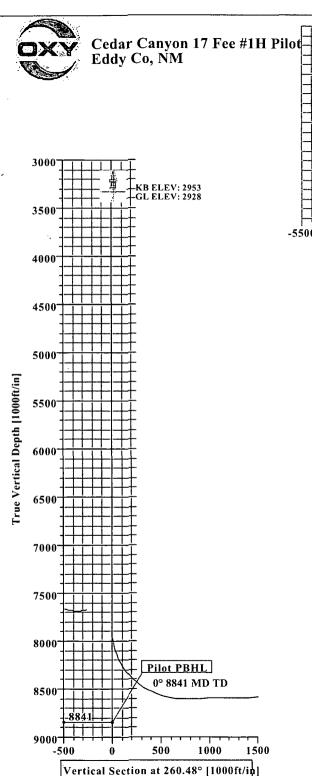

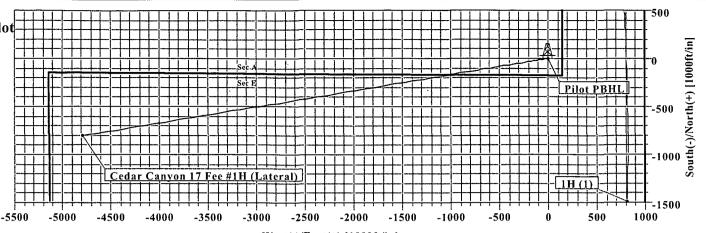

West(-)/East(+) [1000ft/in]

SECTION DETAILS											
Sec	MD	Inc	Azi	TVD	+N/-S	+E/-W	DLeg	TFace	VSec	Target	
1	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00		
2	8841.00	0.00	0.00	8841.00	0.00	0.00	0.00	0.00	0.00		

WELL DETAILS											
Name	+N/-S	+E/-W	Northing	Easting	Latitude	Longitude	Slot				
Cedar Canyon 17 Fee #1H	0.00	0.00	444487.50	603694.00	32°13'17.647N	103°59'52.882W	N/A				

		TAI	RGET DETAI	ILS		
Name	TVD	+N/-S	+E/-W	Northing	Easting	Shape
			None			

SITE DETAILS

Cedar Canyon 17 Fee #111

Site Centre Northing: 444487.50 Easting: 603694.00

Ground Level: 2928.00
Positional Uncertainty: 0.00
Convergence: 0.18



Weatherford^{*}


LEGEND



Plan: Plan #1 (Cedar Canyon 17 Fee #1H/Pilot)

Created By: Patrick Rudolph

Date: 12/6/2013

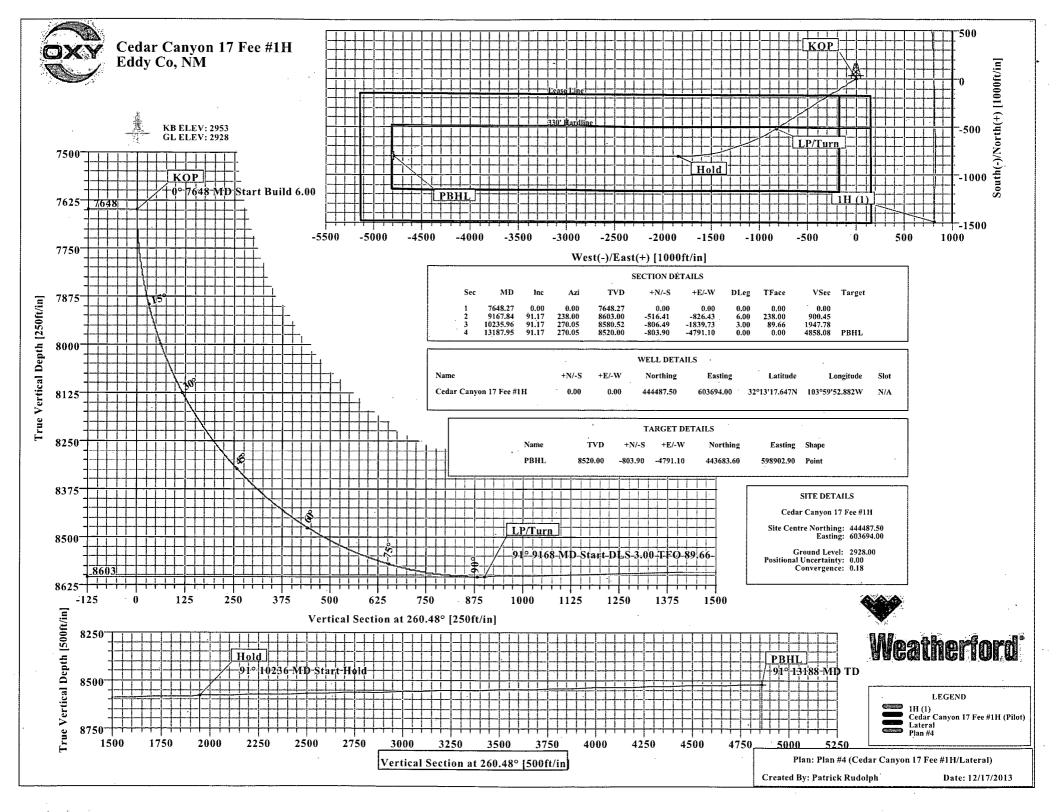





Company: Occidental Rermian Ltd:
Field: Eddy Co. NM (Nad 27)
Site: Cedar Canyon 17 Fee #1H
Well: Cedar Canyon 17 Fee #1H
Wellpath: Lateral

Co-ordinate(NE) Reference: Vertical (TVD) Reference: Section (VS) Reference:

Time:: 10:15:58 Page: I : Well: Cedar Canyon 17:Fee #1H, Grid Nort

Survey Calculation Method:

Date: 12/17/2013

SITE 2953 0 Well (0.00N;0.00E;260.48Azi) Minimum Curvature Db: Sybase

Plan #4 Date Composed:

Version:

Principal: Tied-to: From: Definitive Path

Cedar Canyon 17 Fee #1H Site:.

Site Position: From: Map Position Uncertainty: 2928.00 ft **Ground Level:**

444487.50 ft Northing: 603694.00 ft Easting:

Latitude: 32 13 17.647 N Longitude: 103 59 52.882 W

North Reference: Grid Grid Convergence:

Slot Name:

Longitude:

0.18 deg

Cedar Canyon 17 Fee #1H Well:

+N/-S Well Position: 0.00 ft Northing: +E/-W0.00 ft Easting: Position Uncertainty: 0.00 ft

0.00 ft

444487.50 ft Latitude: 603694.00 ft

32 13 17.647 N 103 59 52.882 W

Wellpath: Lateral **Drilled From:**

SITE **Current Datum:** Magnetic Data: 4/1/2014 Height 2953.00 ft

Tie-on Depth: 7648.27 ft **Above System Datum:** Mean Sea Level Declination: 7.44 deg

48314 nT Field Strength: Vertical Section: Depth From (TVD)

Mag Dip Angle: +N/-S +E/-W

60.04 deg Direction

ft ft ft deg 0.00 0.00 0.00 260.48

Plan Section Information

MD ft	Incl deg	Azim 4deg+	TVD :	+N/-S >, ft		DLS deg/100ft		Turn 4 t deg/100f	PRODUCE CONTRACTOR OF PROPERTY AND ADDRESS.	Target
7648.27	0.00	0.00	7648.27	0.00	0.00	0.00	0.00	0.00	0.00	
9167.84	91.17	238.00	8603.00	-516.41	-826.43	6.00	6.00	0.00	238.00	•
10235.96	91.17	270.05	8580.52	-806.49	-1839.73	3.00	0.00	3.00	89.66	
13187.95	91.17	270.05	8520.00	-803.90	-4791.10	0.00	0.00	0.00	0.00	PBHL

Survey

MD s. at					E/W	VS	DLS	MapN		Comment
ft.	deg	√ deg	it t	is ft	ft ,	ft	deg/100ft	ft	ft	
7648.27	0.00	0.00	7648.27	0.00	0.00	0.00	0.00	444487.50	603694.00	KOP
7650.00	0.10	238.00	7650.Ô0	0.00	0.00	0.00	6.00	444487.50	603694.00	
7700.00	3.10	238.00	7699.97	-0.74	-1 .19	1:29	6.00	444486.76	603692.81	
7750.00	6.10	238.00	7749.81	-2.87	-4.59	5.00	6.00	444484.63	603689.41	
7800.00	9.10	238.00	7799.36	-6.37	-10.20	11.11	6.00	444481.13	603683.80	
7850.00	12.10	238.00	7848.50	-11.25	-18.00	19.62	6.00	444476.25	603676.00	
7900.00	15.10	238.00	7897.09	-17:48	-27.98	30.48		444470.02	603666.02	
7950.00	18.10	238.00	7945.00	-25.05	-40.09	43.68	6.00	444462.45	603653.91	
8000.00	21.10	238.00	7992.10	-33.94	-54.32	59.18	6.00	444453.56	603639.68	
8050.00	24.10	238.00	8038.25	-44.12	-70.61	76.94	6.00	444443.38	603623.39	
8100.00	27.10	238.00	8083.34	-55.57	-88.93	96.90	6.00	444431.93	603605.07	
8150.00	30.10	238.00	8127.23	-68.26	-109.23	119.02	6.00	444419.24	603584.77	
8200.00	33.10	238.00	8169.81	-82.14	-131.45	143.22	6.00	444405.36	603562.55	
8250.00	36.10	238.00	8210.96	-97.18	-155.53	169.46	6.00	444390.32	603538.47	
8300.00	39.10	238.00	8250.57	-113.35	-181.40	197.65	6.00	444374.15	603512.60	
8350.00	42.10	238.00	8288.53	-130.59	-208.99	227,71	6.00	444356.91	603485.01	
8400.00	45.10	238.00	8324.73	-148.86	-238.23	259.57	6.00	444338.64	603455.77	
8450.00	48.10	238.00	8359.08	-168.11	-269.04	293.14	6.00	444319.39	603424.96	
8500.00	51.10	238.00	8391.48	-188.29	-301.33	328.32	6.00	444299.21	603392.67	
8550.00	54.10	238.00	8421.84	-209.34	-335.01	365.02	6.00	444278.16	603358.99	
				/						
8600.00	57.10	238.00	8450.08	-231.20	-369.99	403.14	6.00	444256.30	603324.01	
8650.00	60.10	238.00	8476.13	-253.81	-406.18	442.57	6.00	444233.69	603287.82	
8700.00	63.10	238.00	8499.90	-277.12	-443.48	483.21	6.00	444210.38	603250.52	





Company: Occidental Permian Ltd.

Date: 12/17/2013 Time: 10:15:58 Page: 2,
Field: Eddy Co, NM (Nad 27) Co-ordinate(NE) Reference: Well: Cedar Canyon 17 Fee #1H, Grid Nort.

Site: Cedar Canyon 17 Fee #1H
Well: Cedar Canyon 17 Fee #1H
Section (VS) Reference: Well (0:00N,0:00E:260.48Azi)
Wellpath: Lateral Survey Calculation Method: Minimum Curvature Db: Sybase

-Wellpath: 1	ateral,	700				Survey Calcu	lation Method	I: Minimum	Curvature 🦠 🖫	Db: Sybase,
Survey					*					
MD V	Incl	Azim	TVD	N/S	E/W	VS'	DLS	MapN	MapE	Comment
ft 🛂	2. 2. 2. 2. 2. 2. 2. 2. 2. 2. 2. 2. 2. 2		的 ft ,小孩	ft 🖖 🗸	of the state of th	ft -	deg/100ft	s ft 🖈 🐪	MapE ft	
8750.00	2,000,000	238.00	8521.34	-301.05	-481.78	524.94	6.00	444186.45	603212.22	
8800.00		238.00	8540.39	-325.54	-520.98	567.65	6.00	444161.96	603173.02	
8850.00	72.10	238.00	8557.00	-350.53	-560.97	611.22	6.00	444136.97	603133.03	
8900.00		238.00	8571.11	-375.95	-601.65	655.54	6.00	444111.55	603092.35	
8950.00		238.00 238.00	8582.69	-401.72	-642.89	700.48	6.00	444085.78 444059.72	603051.11 603009.41	
9000.00		238.00	8591.71 8598.15	-427.78 -454.05	-684.59 -726.64	745.91 791.72	6.00 6.00	444033.45	602967.36	
9030.00	04.10	230.00	0030.10	-434.03	-720.04	731.72	0.00	777033.73	002507.50	
9100.00	87.10	238.00	8601.98	-480.47	-768.91	837.78	6.00	444007.03	602925.09	
9150.00	90.10	238.00	8603.20	-506.95	-811.29	883.97	6.00	443980.55	602882.71	
9167.84		238.00	8603.00	-516.41	-826.43	900.45	6.00	443971.09	602867.57	LP/Turn
9200.00		238.96	8602.34	-533.21	-853.83	930.26	3.00	443954.29	602840.17	
9300.00	91.20	241.97	8600.27	-582.49	-940.81	1024.19	3.00	443905.01	602753.19	
0400 00	91.21	244.97	8598.17	-627.15	-1030.24	1119.78	3.00	443860.35	602663.76	
9400.00 9500.00		244.97 247.97	8596.06	-627.13 -667.07	-1030.24	1216.77	3.00	443820.43	602572.10	
9600.00		250.97	8593.93	-702.13	-1215.51	1314.90	3.00	443785.37	602478.49	
9700.00		253.97	8591.80	-732.24	-1310.83	1413.89	3.00	443755.26	602383.17	
9800.00		256.97	8589.67	-757.33	-1407.60	1513.47	3.00	443730.17	602286.40	,
9900.00		259.97	8587.54	-777.31	-1505.55	1613.38	3.00	443710.19	602188.45	
10000.00		262.97	8585.43	-792.14	-1604.41	1713.33	3.00	443695.36	602089.59	
10100.00 10200.00		265.97 268.97	8583.33 8581.25	-801.77 -806.18	-1703.91 -1803.78	1813.05 1912.28	3.00 3.00	443685.73 443681.32	601990.09 601890.22	
10200.00		270.05	8580.52	-806.49	-1839.73	1912.28	3.00	443681.01	601854.27	Hold
10235.96	91.17	270.05	0300.32	-000.49	-1035.73	1941.10	3.00	443001.01	001054.27	Tiold
10300.00	91.17	270.05	8579.20	-806.43	-1903.76	2010.92	0.00	443681.07	601790.24	
10400.00		270.05	8577.15	-806.34	-2003.74	2109.50	0.00	443681.16	601690.26	
10500.00		270.05	8575.10	-806.26	-2103.72	2208.09	0.00	443681.24	601590.28	
10600.00		270.05	8573.05	-806.17	-2203.70	2306.68	0.00	443681.33	601490.30	
10700.00	91.17	270.05	8571.00	-806.08	-2303.67	2405.27	0.00	443681.42	601390.33	
10800.00	91.17	270.05	8568.95	-805.99	-2403.65	2503.85	0.00	443681.51	601290.35	
10900.00		270.05	8566.90	-805.91	-2503.63	2602.44	0.00	443681.59	601190.37	
11000.00		270.05	8564.85	-805.82	-2603.61	2701.03	0.00	443681.68	601090.39	
11100.00		270.05	8562.80	-805.73	-2703.59	2799.62	0.00	443681.77	600990.41	
11200.00		270.05	8560.75	-805.64	-2803.57	2898.20	0.00	443681.86	600890.43	
11300.00		270.05	8558.70	-805.55	-2903.55	2996.79	0.00	443681.95	600790.45	
11400.00		270.05	8556.65	-805.47	-3003.53	3095.38	0.00	443682.03	600690.47	
11500.00 11600.00		270.05 270.05	8554.60 8552.55	-805.38 -805.29	-3103.51 -3203.49	3193.97 3292.56	0.00 0.00	443682.12 443682.21	600590.49 600490.51	
11700.00			8550.50	-805.20	-3303.46	3391.14	0.00	443682.30	600390.54	
11700.00	J 1.17	270.00	0000.00	000.20	0000.40	0001.17	0.00	110002.00	000000.01	
11800.00	91.17	270.05	8548.45	-805.12	-3403.44	3489.73	0.00	443682.38	600290.56	
11900.00	91.17	270.05	8546.40	-805.03	-3503.42	3588.32	0.00	443682.47	600190.58	
12000.00		270.05	8544.35	-804.94	-3603.40	3686.91	0.00	443682.56	600090.60	
12100.00		270.05	8542.30	-804.85	-3703.38	3785.49	0.00	443682.65	599990.62	
12200.00	91.17	270.05	8540.25	-804.77	-3803.36	3884.08	0.00	443682.73	599890.64	
12300.00	91.17	270.05	8538.20	-804.68	-3903.34	3982.67	0.00	443682.82	599790.66	
12400.00		270.05	8536.15	-804.59	-4003.32	4081.26	0.00	443682.91	599690.68	
12500.00		270.05	8534.10	-804.50	-4103.30	4179.84	0.00	443683.00	599590.70	
12600.00	91.17	270.05	8532.05	-804.42	-4203.27	4278.43	0.00	443683.08	599490.73	
12700.00	91.17	270.05	8530.00	-804.33	-4303.25	4377.02	0.00	443683.17	599390.75	
12800.00		270.05	8527.95	-804.24	-4403.23	4475.61	0.00	443683.26	599290.77	
12900.00 13000.00		270.05 270.05	8525.90 8523.85	-804.15 -804.06	-4503.21 -4603.19	4574.19 4672.78	0.00 0.00	443683.35 443683.44	599190.79 599090.81	
13100.00		270.05	8521.80	-803.98	-4703.19 -4703.17	4771.37	0.00	443683.52	598990.83	
13187.95		270.05	8520.00	-803.90	-4791.10	4858.08	0.00	443683.60	598902.90	PBHL





Company: Occidental Permian Ltd.
Field: Eddy Co. NM (Nad 27)
Site: Cedar Canyon 17 Fee #1H
Well: ACedar Canyon 17 Fee #1H
Wellpath: Lateral

Date: 12/17/2013 Time: 10:15:58 Page: 3
Co-ordinate(NE) Reference: Well: Cedar Canyon: 17 Fee #1H. Grid Nort
Vertical (TVD) Reference: SITE: 2953.0
Section (VS) Reference: Well (0:00N,0:00E; 260.48Azi)
Survey Calculation Method: Minimum Curvature Db: Sybase

Targets

Name De	scription TVD	+N/-S ft	+E/ _z w.	Map Northing I	Map Easting - ft	< Lat Deg Min	itude ==> Sec	<, I Deg I	ongitude Min Sec	
PBHL	8520.00	-803.90	-4791.10	443683.60 59	8902.90	32 ~13	9.835 N	104	0 48.683	3 W

Casing Points

MD TVD Diameter Hole Size Name	
TOTAL CONTRACT OF THE PROPERTY	

Annotation

MD." ft.	TVD ft		
7648.27	7648.27	KOP .	
9167.84	8603.00	LP/Turn	
10235.96	8580.52	Hold	
13187.94	8520.00	PBHL	

Formations

MD TVD Formations Lithology Dip Angle Dip Direction	





Company: Occidental Permian Ltd.
Field: Eddy, Co.: NM (Nad 27)
Site: Cedar Canyon 17 Fee #1H
Well: Cedar Canyon 17 Fee #1H
Wellpath: Pilot

Date: 12/6/2013 Time: 14:20:28 Page: 1
Go-ordinate(NE) Reference: Well: Cedar Canyon 17 Fee #1H; Grid Nort:
Vertical (TVD) Reference: SITE 2953.0
Section (VS) Reference: Well (0.00N,0.00E;260.48Azi):

Plan #1

Cedar Canyon 17 Fee #1H

Survey Calculation Method: Minimum Curvature: Db: Sybase

Date Composed: Version: Tied-to:

12/6/2013

From Surface

Principal: Yes

Site Position: From: Man

Ground Level:

Position Uncertainty:

Northing: Easting:

Easting:

444487.50 ft Latitude: 603694.00 ft Longitude:

32 13 17.647 N 103 52.882 W 59

0.00 ft 2928.00 ft North Reference: **Grid Convergence:**

Grid 0.18 deg

Well:

Site:

Cedar Canyon 17 Fee #1H

0.00 ft Northing:

444487.50 ft Latitude: 32 13 17.647 N

Well Position: Position Uncertainty:

0.00 ft

603694.00 ft

Longitude:

Slot Name:

52.882 W 59

0.00 ft

103

Wellpath: Pilot

0.00

Drilled From: Tie-on Depth:

Surface

Current Datum;

SITE

+N/-S

+E/-W

Height 2953.00 ft

Above System Datum:

0.00 ft Mean Sea Level

Magnetic Data: Field Strength:

4/1/2014 48314 nT **Declination:** Mag Dip Angle:

7.44 deg 60.04 dea

Vertical Section: Depth From (TVD)

+N/-S ft

+E/-W ft

Direction deg

260.48

0.00 0.00

Plan Section Information

MD ift	Incl deg 🗚	Azim ⊯deg	TVD	+N/-S ft	+E/-W ft 4)	DLS deg/100ft	Build deg/100ff	Turn (deg/100f	* TFO T t deg	arget
0.00 8841.00	0.00	0.00 0.00	0.00 8841.00	0.00	0.00 0.00	0.00 0.00	0.00 0.00	0.00 0.00	0.00 0.00	

Survey

MD	lncl	Azim	TVD	N/S			DLS	MapN &	MapE;	Comment
ft.	deg	≥ deg	Jr ∙ ft v v sa	+ tt	ft	* π (deg/100ft	tt.	ft v Sympo	109
0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
100.00	0.00	0.00	100.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
200.00	0.00	0.00	200.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
300.00 .	0.00	0.00	300.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
400.00	0.00	0.00	400.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
500.00	0.00	0.00	500.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
600.00	0.00	0.00	600.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
700.00	0.00	0.00	700.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
800.00	0.00	0.00	800.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
900.00	0.00	0.00	900.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
1000.00	0.00	0.00	1000.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
1100.00	0.00	0.00	1100.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
1200.00	0.00	0.00	1200.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
1300.00	0.00	0.00	1300.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
1400.00	0.00	0.00	1400.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
1500.00	0.00	0.00	1500.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
1600.00	0.00	0.00	1600.00	0.00	0.00	0.00	0.00	444487.50	603694.00	Ì
1700.00	0.00	0.00	1700.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
1800.00	0.00	0.00	1800.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
1900.00	0.00	0.00	1900.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
							•			
2000.00	0.00	0.00	2000.00	0.00	0.00	0.00	0.00	444487.50	603694.00	ļ
2100.00	0.00	0.00	2100.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
2200.00	0.00	0.00	2200.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
2300.00	0.00	0.00	2300.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
2400.00	0.00	0.00	2400.00	0.00	0.00	0.00	0.00	444487.50	603694.00	





Company: Occidental Permian Ltd.

Page: 2
Field: Eddy Co, NM (Nad 27)
Site: Cedar Canyon 17 Fee #1H
Well: Cedar Canyon 17 Fee #1H
Section (VS) Reference: Well: Cedar Canyon 17 Fee #1H
Section (VS) Reference: Well: (0.00N, 0.00E;260.48Azi)
Wellpath: Pilot: Survey Calculation Method: Minimum Curvature; Db: Sybase

Si	ır	v	ev

Survey										
MD T	lncl .	Azim	TVD *	N/S	E/W	VS V	DLS	MapN.	_MapE	Comment
A. In	deg	√deg ∵	K.Cft	ft 🐫 📜	ft 44	ft. d	eg/100ft 🐇	ft 🚧 🧸	aft 💮 🔻	
R. A4 a30 6072 1 7 7	HANN' MARKETAKUP 2110	- 214 ABRES T 3, FROMES	5.2 (30) A WHIE FLEX COSE (A) (80)	SECTION OF THE SECTIO	4 7 Table A. S. 19 . 19 . 440 SET	V 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	MILE E SERVE CALL THE ME, TO	E P WINDSHEET COMETON D. COMPUNED	A 14 . SERVICE CONTRACTOR OF WALES	and the second second second
2500.00	0.00	0.00	2500.00	0.00	0.00	0.00	0.00	444487.50	603694.00)
2600.00	0.00	0.00	2600.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
2700.00	0.00	0.00	2700.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
2800.00	0.00	0.00	2800.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
2900.00	0.00	0.00	2900.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
	•									-
3000.00	0.00	0.00	3000.00	0.00	0.00	0.00	0.00	444487.50	603694.00	1
3100.00	0.00	0.00	3100.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
3200.00	0.00	0.00	3200.00	0.00	0.00	0.00	0.00	444487.50 ′	603694.00	
3300.00	0.00	0.00	3300.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
3400.00	0.00	0.00	3400.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
0500.00		0.00	0500.00	0.00		0.00	0.00	444407.50	000004.00	
3500.00	0.00	0.00	3500.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
3600.00	0.00	0.00	3600.00	0.00	0.00	0.00	0.00	444487.50	603694.00	1
3700.00	0.00	0.00	3700.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
3800.00	0.00	0.00	3800.00	0.00	0.00	0.00	0.00	444487.50	603694.00	1
.3900.00	0.00	0.00	3900.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
4000.00	0.00	0.00	4000.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
4100.00	0.00	0.00	4100.00	0.00	0.00	0.00	0.00	444487.50	603694.00	ł
4200.00	0.00	0.00	4200.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
4300.00	0.00	0.00	4300.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
4400.00	0.00	0.00	4400.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
4500.00	0.00	0.00	4500.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
4600.00	0.00	0.00	4600.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
4700.00	0.00	0.00	4700.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
4800.00	0.00	0.00	4800.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
4900.00	0.00	0.00	4900.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
5000.00	0.00	0.00	5000.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
5100.00	0.00	0.00	5100.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
5200.00	0.00	0.00	5200.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
5300.00	0.00	0.00	5300.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
5400.00	0.00	0.00	5400.00	0.00	0.00	0.00	0.00	444487.50	603694.00	1
5500.00	0.00	0.00	5500.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
5600.00	0.00	0.00	5600.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
5700.00	0.00	0.00	5700.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
5800.00	0.00	0.00	5800.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
5900.00	0.00	0.00	5900.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
1										
6000.00	0.00	0.00	6000.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
6100.00	0.00	0.00	6100.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
6200.00	0.00	0.00	6200.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
6300.00	0.00	0.00	6300.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
6400.00	0.00	0.00	6400.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
6500.00	0.00	0.00	6500.00	0.00	0.00	0.00	0.00	444487.50	603694.00	,
6600.00	0.00	0.00	6600.00	0.00	0.00	0.00	0.00	444487.50 444487.50	603694.00	
6700.00	0.00	0.00	6700.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
6800.00	0.00	0.00	6800.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
6900.00	0.00	0.00	6900.00	0.00	0.00	0.00	0.00	444487.50	603694.00	į
				- -						
7000.00	0.00	0.00	7000.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
7100.00	0.00	0.00	7100.00	0.00	0.00	0.00	0.00	444487.50	603694.00	ļ
7200.00	0.00	0.00	7200.00	0.00	0.00	0.00	0.00	444487.50	603694.00	}
7300.00	0.00	0.00	7300.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
7400.00	0.00	0.00	7400.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
7522.25										
7500.00	0.00	0.00	7500.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
7600.00	0.00	0.00	7600.00	0.00	0.00	0.00	0.00	444487.50	603694.00	





Company: Occidental Permian Ltd:
Page: 3
Field: Eddy Co NM (Nad 27)
Site: Cedar Canyon 17 Fee #1H
Vertical (TVD) Reference: Well: Cedar Canyon 17 Fee #1H
Well: Cedar Canyon 17 Fee #1H
Section (VS) Reference: Well (0.00N, 0.00E;260 48Azi)
Wellpath: Pilot
Survey Calculation Method: Minimum Curvature Db: Sybase

~					
·	11	*	17	α	
L)	u		•	c	·v

MD ft	Incl deg	Azim A deg	TVD ft	N/S	E/ W	VS ft ناط	DLS eg/100ft	MapN ft %	MapE ft	Comment
7700.00		0.00	7700.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
7800.00	0.00	0.00	7800.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
7900.00	0.00	0.00	7900.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
8000.00	0.00	0.00	8000.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
8100.00	0.00	0.00	8100.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
8200.00	0.00	0.00	8200.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
8300.00	0.00	0.00	8300.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
8400.00	0.00	0.00	8400.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
8500.00	0.00	0.00	8500.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
8600.00	0.00	0.00	8600.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
8700.00	0.00	0.00	8700.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
8800.00	0.00	0.00	8800.00	0.00	0.00	0.00	0.00	444487.50	603694.00	
8841.00	0.00	0.00	8841.00	0.00	0.00	0.00	0.00	444487.50	603694.00	

Targets

٠,	1.5	1.38	マーシュ 教育を表する	[1] 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		建筑的	。1.10数数数数数 1.40	· · · · · · · · · · · · · · · · · · ·	と は 人 温泉 二 巻	A -	机转换产品流程数2.50%	AND CALLES	(後の表) とい "世界を	中国的特别的 对法院的	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	10 BORNESS 10
5 %	7 80 1	W 385 4	32.3	Minister."			The state of the s	100	100	» Man	Caraca Ma	n *****	atitur	e~=> : !<-	- Longiti	ude *-**->`
-20	196° 193		1000	300000000000000000000000000000000000000	A CONTRACTOR OF THE	A STATE OF THE STA	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	The state of the	1999322	Carren Section 2	CANADAD WITH HARD	100 Page 2 344	STATES CONTRACTOR CONTRACTOR	le> . <-	The world was been	THE STATE OF THE PARTY OF THE P
.,40	Nome	B 70 975	Transaction To	CONTRACTOR CONTRACTOR	THE RESERVE T	CVID MARKET	CALLINIC !	Tustodoit L L	IN TAKE S	Northi	E Oct		NA:	ec 😿 De	NA STATE	CAN MEETING
٠,	· Maine	5 72	- DE	scription 3	10.00	A 100 100 100 100 100 100 100 100 100 10	WW.14/-0	Co. Car	1 St. 1	April A OF CHILL	ig wast Last	HILE TO BE SEED IN	CE AMILIA CO	CC XXXID	S TIAITH SE	OCC MANAGEMENT
	2 20 3 2	N 40 5000	A CONTRACTOR).		934 344 M			N. Becker	£ 2. "L. 25 25 25 25 25 25 25 25 25 25 25 25 25		STATE OF THE STATE OF THE STATE OF				
100	· 346. 34 43 41	at	774 L 11 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1). 238 A	Ur. was well			200 200 2 10	The state of the s	4 4 4 4 4 4 A 4 A 4 A 4 A 4 A 4 A 4 A 4		n i		The state of the s		
12.	Shart are I'm	C THE STATE OF THE	25.500	100000000000000000000000000000000000000	A64	2 90 90 90 90 20			1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	* * * * * * * * * * * * * * * * * * *	I BAG STEEL SHOT THE BELL	100	-6.6555 (10.00)	SCALE DO N. P. WINSTERN STREET	Public Control of the	A CONTRACT OF THE

Casing Points


MD TVD Diameter Hole Size Name


Annotation

		STORY OF THE ALL LANGEST AND THE COURSE A LONG A TRANSPORT OF	Party State (September 1997) And
TVD	To the time that the training of the second		ACCURATE NAME OF THE PARTY OF T
			"" " " " " " " " " " " " " " " " " " "
	and the state of t	Market State of the Control of the C	
			A STATE OF A SECOND STATE OF THE SECOND STATE
The second section of the sect	SEE AND ADDRESS OF THE PROPERTY OF THE PROPERT	TARABLE DATA CONT. CONT. CO. CO. C.	Z and an about on the 1 and 1 about 1 about 10 to the nation and


Formations

MD TVD Formations Lithology Dip Angle Dip Direction.

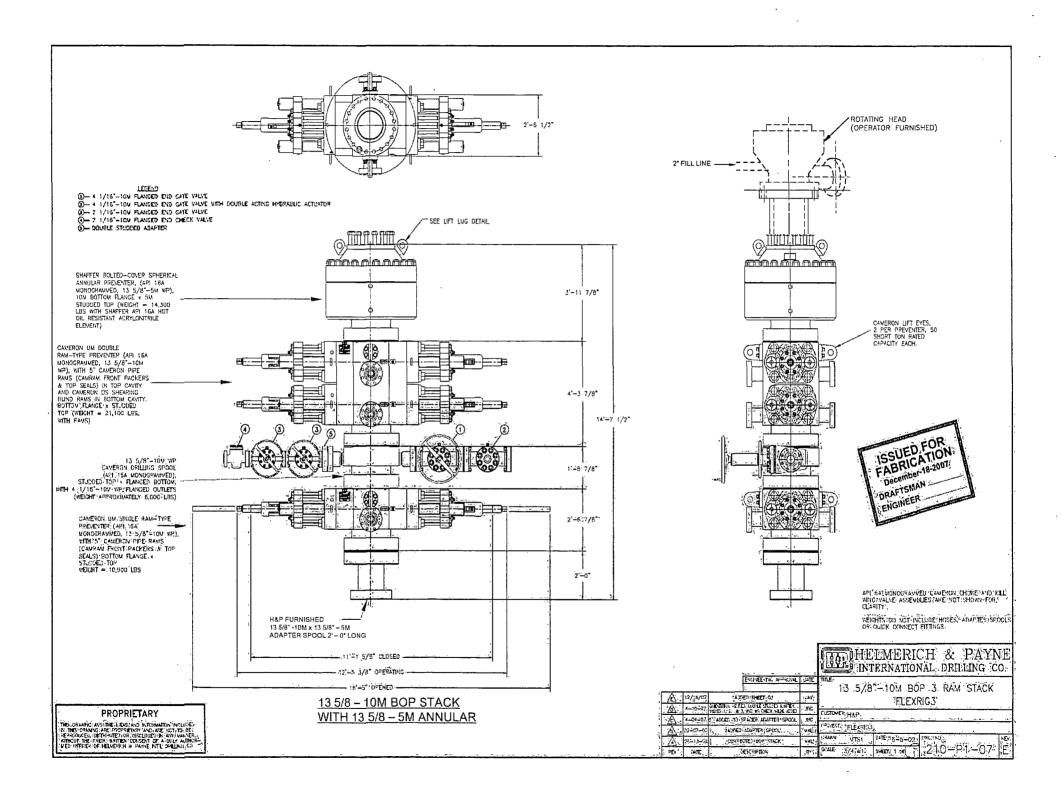


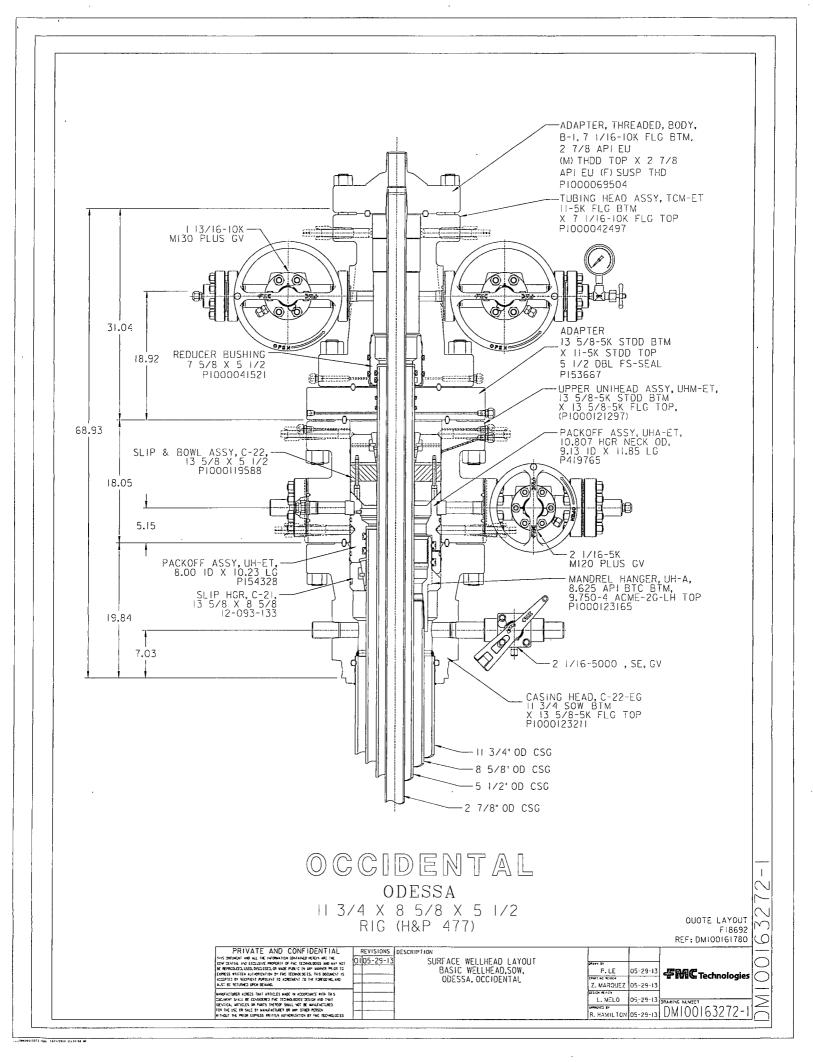



FLEX3 STD CHOKE MANIFOLD (COMPREHENSIVE)

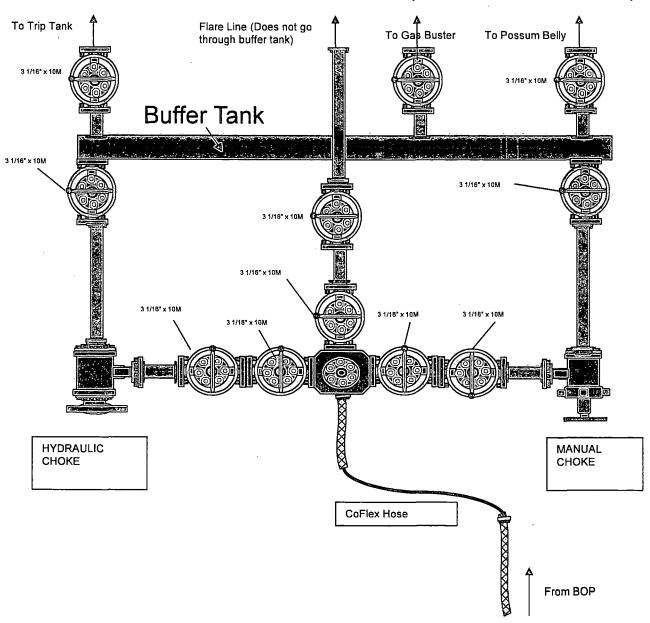


10M REMOTE KILL LINE SCHEMATIC

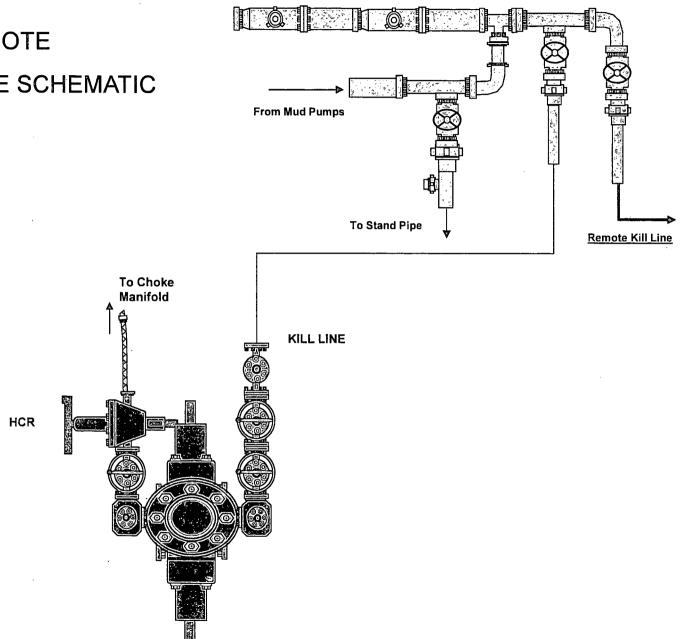

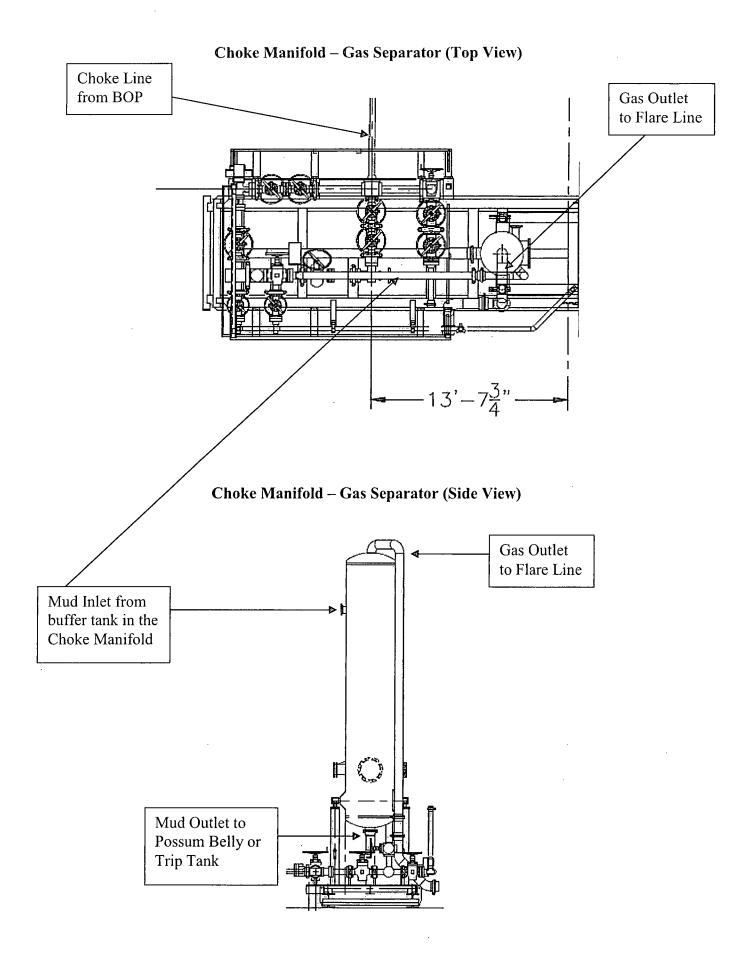


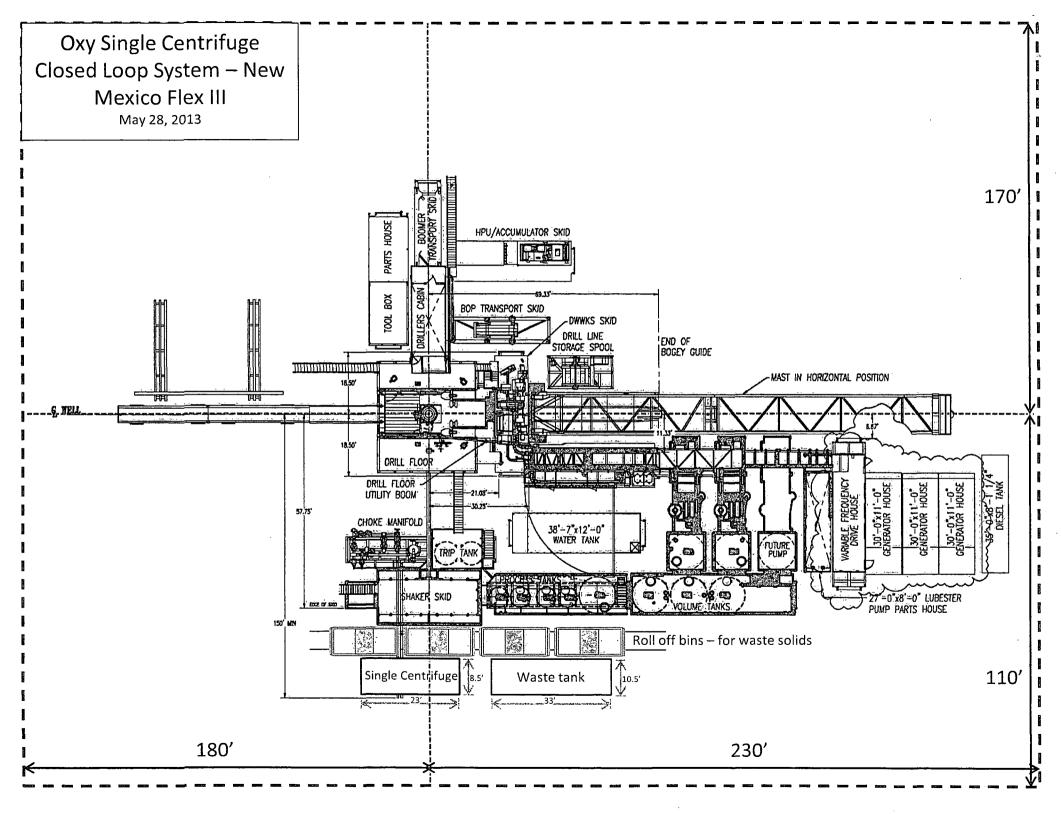

Oxy

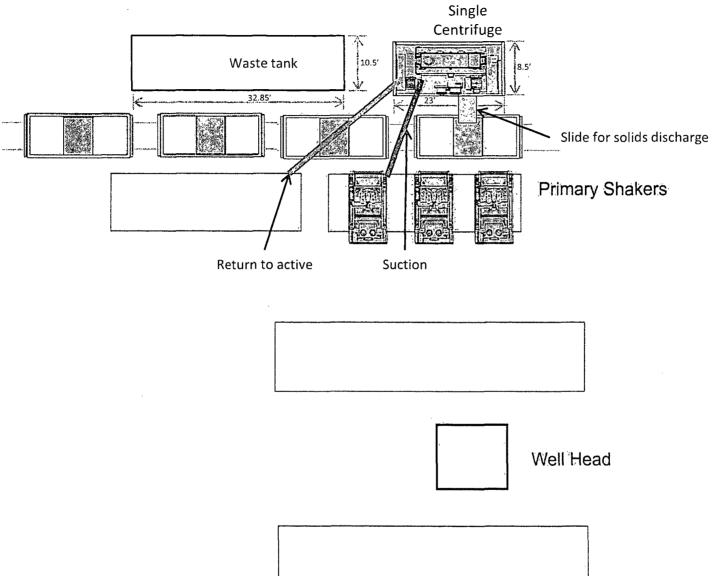

Oxy Single Centrifuge Closed Loop System – New Mexico Flex III May 28, 2013

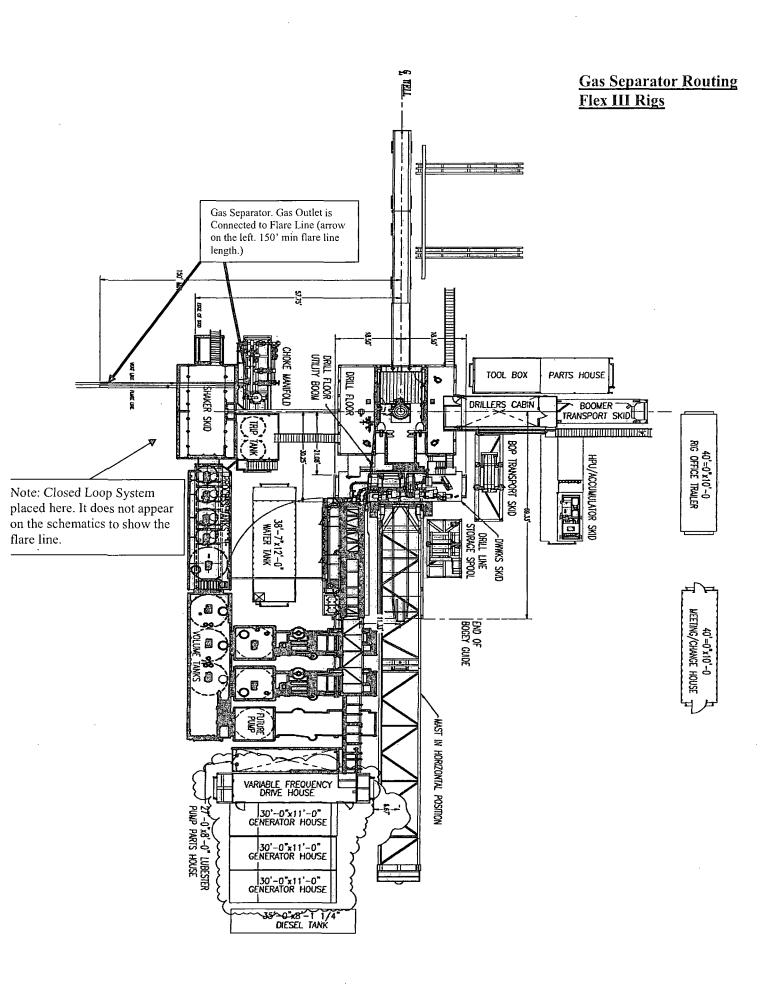



Permian Drilling Hydrogen Sulfide Drilling Operations Plan New Mexico

Scope

This contingency plan establishes guidelines for the public, all company employees, and contract employees who's work activities may involve exposure to hydrogen sulfide (H2S) gas.

While drilling this well, it is possible to encounter H2S bearing formations. At all times, the first barrier to control H2S emissions will be the drilling fluid, which will have a density high enough to control influx.

Objective

- 1. Provide an immediate and predetermined response plan to any condition when H2S is detected. All H2S detections in excess of 10 parts per million (ppm) concentration are considered an Emergency.
- 2. Prevent any and all accidents, and prevent the uncontrolled release of hydrogen sulfide into the atmosphere.
- 3. Provide proper evacuation procedures to cope with emergencies.
- 4. Provide immediate and adequate medical attention should an injury occur.

Discussion

Implementation: This plan with all details is to be fully implemented

before drilling to commence.

Emergency response

Procedure:

This section outlines the conditions and denotes steps

to be taken in the event of an emergency.

Emergency equipment

Procedure:

This section outlines the safety and emergency

equipment that will be required for the drilling of this

well.

Training provisions: This section outlines the training provisions that must

be adhered to prior to drilling.

Drilling emergency call lists: Included are the telephone numbers of all persons to

be contacted should an emergency exist.

Briefing: This section deals with the briefing of all people

involved in the drilling operation.

Public safety: Public safety personnel will be made aware of any

potential evacuation and any additional support

needed.

Check lists: Status check lists and procedural check lists have been

included to insure adherence to the plan.

General information: A general information section has been included to

supply support information.

Hydrogen Sulfide Training

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on the well:

- 1. The hazards and characteristics of H2S.
- 2. Proper use and maintenance of personal protective equipment and life support systems.
- 3. H2S detection.
- 4. Proper use of H2S detectors, alarms, warning systems, briefing areas, evacuation procedures and prevailing winds.
- 5. Proper techniques for first aid and rescue procedures.
- 6. Physical effects of hydrogen sulfide on the human body.
- 7. Toxicity of hydrogen sulfide and sulfur dioxide.
- 8. Use of SCBA and supplied air equipment.
- 9. First aid and artificial respiration.
- 10. Emergency rescue.

In addition, supervisory personnel will be trained in the following areas:

- 1. The effects of H2S on metal components. If high tensile strength tubular is to be used, personnel will be trained in their special maintenance requirements.
- 2. Corrective action and shut-in procedures when drilling a well, blowout prevention and well control procedures.
- 3. The contents and requirements of the H2S Drilling Operations Plan.

H2S training refresher must have been taken within one year prior to drilling the well. Specifics on the well to be drilled will be discussed during the pre-spud meeting. H2S and well control (choke) drills will be performed while drilling the well, at least on a weekly basis. This plan shall be available in the well site. All personnel will be required to carry the documentation proving that the H2S training has been taken.

Service company and visiting personnel

- A. Each service company that will be on this well will be notified if the zone contains H2S.
- B. Each service company must provide for the training and equipment of their employees before they arrive at the well site.
- C. Each service company will be expected to attend a well site briefing

Emergency Equipment Requirements

1. Well control equipment

The well shall have hydraulic BOP equipment for the anticipated pressures. Equipment is to be tested on installation and follow Oxy Well Control standard, as well as BLM Onshore Order #2.

Special control equipment:

- A. Hydraulic BOP equipment with remote control on ground. Remotely operated choke.
- B. Rotating head
- C. Gas buster equipment shall be installed before drilling out of surface pipe.

2. Protective equipment for personnel

- A. Four (4) 30-minute positive pressure air packs (2 at each briefing area) on location.
- B. Adequate fire extinguishers shall be located at strategic locations.
- C. Radio / cell telephone communication will be available at the rig.
 - Rig floor and trailers.
 - Vehicle.

3. Hydrogen sulfide sensors and alarms

- A. H2S sensor with alarms will be located on the rig floor, at the bell nipple, and at the flow line. These monitors will be set to alarm at 10 ppm with strobe light, and audible alarm.
- B. Hand operated detectors with tubes.
- C. H2S monitor tester (to be provided by contract Safety Company.)
- D. There shall be one combustible gas detector on location at all times.

4. Visual Warning Systems

A. One sign located at each location entrance with the following language:

Caution – potential poison gas Hydrogen sulfide No admittance without authorization

Wind sock – wind streamers:

- A. One 36" (in length) wind sock located at protection center, at height visible from rig floor.
- B. One 36" (in length) wind sock located at height visible from pit areas.

Condition flags

A. One each condition flag to be displayed to denote conditions.

```
green – normal conditions
yellow – potential danger
red – danger, H2S present
```

B. Condition flag shall be posted at each location sign entrance.

5. <u>Mud Program</u>

The mud program is designed to minimize the risk of having H2S and other formation fluids at surface. Proper mud weight and safe drilling practices will be applied. H2S scavengers will be used to minimize the hazards while drilling. Below is a summary of the drilling program.

Mud inspection devices:

Garrett gas train or hatch tester for inspection of sulfide concentration in mud system.

6. <u>Metallurgy</u>

- A. Drill string, casing, tubing, wellhead, blowout preventers, drilling spools or adapters, kill lines, choke manifold, lines and valves shall be suitable for the H2S service.
- B. All the elastomers, packing, seals and ring gaskets shall be suitable for H2S service.

7. Well Testing

No drill stem test will be performed on this well.

8. Evacuation plan

Evacuation routes should be established prior to well spud for each well and discussed with all rig personnel.

9. Designated area

- A. Parking and visitor area: all vehicles are to be parked at a predetermined safe distance from the wellhead.
- B. There will be a designated smoking area.
- C. Two briefing areas on either side of the location at the maximum allowable distance from the well bore so they offset prevailing winds perpendicularly, or at a 45-degree angle if wind direction tends to shift in the area.

Emergency procedures

- A. In the event of any evidence of H2S level above 10 ppm, take the following steps:
 - 1. The Driller will pick up off bottom, shut down the pumps, slow down the pipe rotation.
 - 2. Secure and don escape breathing equipment, report to the upwind designated safe briefing / muster area.
 - 3. All personnel on location will be accounted for and emergency search should begin for any missing, the Buddy System will be implemented.
 - 4. Order non-essential personnel to leave the well site, order all essential personnel out of the danger zone and upwind to the nearest designated safe briefing / muster area.
 - 5. Entrance to the location will be secured to a higher level than our usual "Meet and Greet" requirement, and the proper condition flag will be displayed at the entrance to the location.
 - 6. Take steps to determine if the H2S level can be corrected or suppressed and, if so, proceed as required.
- B. If uncontrollable conditions occur:
 - 1. Take steps to protect and/or remove any public in the down-wind area from the rig partial evacuation and isolation. Notify necessary public safety personnel and appropriate regulatory entities (i.e. BLM) of the situation.

- 2. Remove all personnel to the nearest upwind designated safe briefing / muster area or off location.
- 3. Notify public safety personnel of safe briefing / muster area.
- 4. An assigned crew member will blockade the entrance to the location. No unauthorized personnel will be allowed entry to the location.
- 5. Proceed with best plan (at the time) to regain control of the well. Maintain tight security and safety procedures.

C. Responsibility:

- 1. Designated personnel.
 - a. Shall be responsible for the total implementation of this plan.
 - b. Shall be in complete command during any emergency.
 - c. Shall designate a back-up.

All personnel:

- 1. On alarm, don escape unit and report to the nearest upwind designated safe briefing / muster area upw
- 2. Check status of personnel (buddy system).
- 3. Secure breathing equipment.
- 4. Await orders from supervisor.

Drill site manager:

- 1. Don escape unit if necessary and report to nearest upwind designated safe briefing / muster area.
- 2. Coordinate preparations of individuals to return to point of release with tool pusher and driller (using the buddy system).
- 3. Determine H2S concentrations.
- 4. Assess situation and take control measures.

Tool pusher:

- 1. Don escape unit Report to up nearest upwind designated safe briefing / muster area.
- 2. Coordinate preparation of individuals to return to point of release with tool pusher drill site manager (using the buddy system).
- 3. Determine H2S concentration.
- 4. Assess situation and take control measures.

Driller:

1. Don escape unit, shut down pumps, continue

- rotating DP.
- 2. Check monitor for point of release.
- 3. Report to nearest upwind designated safe briefing / muster area.
- 4. Check status of personnel (in an attempt to rescue, use the buddy system).
- 5. Assigns least essential person to notify Drill Site Manager and tool pusher by quickest means in case of their absence.
- 6. Assumes the responsibilities of the Drill Site Manager and tool pusher until they arrive should they be absent.

Derrick man Floor man #1 Floor man #2 1. Will remain in briefing / muster area until instructed by supervisor.

Mud engineer:

- 1. Report to nearest upwind designated safe briefing / muster area.
- 2. When instructed, begin check of mud for ph and H2S level. (Garett gas train.)

Safety personnel:

1. Mask up and check status of all personnel and secure operations as instructed by drill site manager.

Taking a kick

When taking a kick during an H2S emergency, all personnel will follow standard Well control procedures after reporting to briefing area and masking up.

Open-hole logging

All unnecessary personnel off floor. Drill Site Manager and safety personnel should monitor condition, advise status and determine need for use of air equipment.

Running casing or plugging

Following the same "tripping" procedure as above. Drill Site Manager and safety personnel should determine if all personnel have access to protective equipment.

Ignition procedures

The decision to ignite the well is the responsibility of the operator (Oxy Drilling Management). The decision should be made only as a last resort and in a situation where it is clear that:

- 1. Human life and property are endangered.
- 2. There is no hope controlling the blowout under the prevailing conditions at the well.

Instructions for igniting the well

- 1. Two people are required for the actual igniting operation. They must wear self-contained breathing units and have a safety rope attached. One man (tool pusher or safety engineer) will check the atmosphere for explosive gases with the gas monitor. The other man is responsible for igniting the well.
- 2. Primary method to ignite: 25 mm flare gun with range of approximately 500 feet.
- 3. Ignite upwind and do not approach any closer than is warranted.
- 4. Select the ignition site best for protection, and which offers an easy escape route.
- 5. Before firing, check for presence of combustible gas.
- 6. After lighting, continue emergency action and procedure as before.
- 7. All unassigned personnel will remain in briefing area until instructed by supervisor or directed by the Drill Site Manager.

<u>Remember</u>: After well is ignited, burning hydrogen sulfide will convert to sulfur dioxide, which is also highly toxic. <u>Do not assume the area is safe after the well is ignited.</u>

Status check list

Note:	All items	on this 1	ist must	be comi	oleted	before	drilling to	production	casing	point.
11010.		OII IIIIO I	IDC LILADE	oc com	orotou.	CCICIC	C1111111111111111111111111111111111111	production	Cubing	POILIE.

- 1. H2S sign at location entrance.
- 2. Two (2) wind socks located as required.
- 3. Four (4) 30-minute positive pressure air packs (2 at each Briefing area) on location for all rig personnel and mud loggers.
- 4. Air packs inspected and ready for use.
- 5. Cascade system and hose line hook-up as needed.
- 6. Cascade system for refilling air bottles as needed.
- 7. Condition flag on location and ready for use.
- 8. H2S detection system hooked up and tested.
- 9. H2S alarm system hooked up and tested.
- 10. Hand operated H2S detector with tubes on location.
- 11. 1-100' length of nylon rope on location.
- 12. All rig crew and supervisors trained as required.
- 13. All outside service contractors advised of potential H2S hazard on well.
- 14. No smoking sign posted and a designated smoking area identified.
- 15. Calibration of all H2S equipment shall be noted on the IADC report.

Checked by:	Date:

Procedural check list during H2S events

Perform each tour:

- 1. Check fire extinguishers to see that they have the proper charge.
- 2. Check breathing equipment to ensure that it in proper working order.
- 3. Make sure all the H2S detection system is operative.

Perform each week:

- 1. Check each piece of breathing equipment to make sure that demand or forced air regulator is working. This requires that the bottle be opened and the mask assembly be put on tight enough so that when you inhale, you receive air or feel air flow.
- 2. BOP skills (well control drills).
- 3. Check supply pressure on BOP accumulator stand by source.
- 4. Check breathing equipment mask assembly to see that straps are loosened and turned back, ready to put on.
- 5. Check pressure on breathing equipment air bottles to make sure they are charged to full volume. (Air quality checked for proper air grade "D" before bringing to location)
- 6. Confirm pressure on all supply air bottles.
- 7. Perform breathing equipment drills with on-site personnel.
- 8. Check the following supplies for availability.
 - A. Emergency telephone list.
 - B. Hand operated H2S detectors and tubes.

General evacuation plan

- 1. When the company approved supervisor (Drill Site Manager, consultant, rig pusher, or driller) determines the H2S gas cannot be limited to the well location and the public will be involved, he will activate the evacuation plan.
- 2. Drill Site Manager or designee will notify local government agency that a hazardous condition exists and evacuation needs to be implemented.
- 3. Company or contractor safety personnel that have been trained in the use of H2S detection equipment and self-contained breathing equipment will monitor H2S concentrations, wind directions, and area of exposure. They will delineate the outer perimeter of the hazardous gas area. Extension to the evacuation area will be determined from information gathered.
- 4. Law enforcement personnel (state police, police dept., fire dept., and sheriff's dept.) Will be called to aid in setting up and maintaining road blocks. Also, they will aid in evacuation of the public if necessary.
- 5. After the discharge of gas has been controlled, company safety personnel will determine when the area is safe for re-entry.

<u>Important:</u> Law enforcement personnel will not be asked to come into a contaminated area. Their assistance will be limited to uncontaminated areas. Constant radio contact will be maintained with them.

Emergency actions

Well blowout – if emergency

- 1. Evacuate all personnel to "Safe Briefing / Muster Areas" or off location if needed.
- 2. If sour gas evacuate rig personnel.
- 3. If sour gas evacuate public within 3000 ft radius of exposure.
- 4. Don SCBA and shut well in if possible using the buddy system.
- 5. Notify Drilling Superintendent and call 911 for emergency help (fire dept and ambulance) if needed.
- 6. Implement the Blowout Contingency Plan, and Drilling Emergency Action Plan.
- 6. Give first aid as needed.

Person down location/facility

- 1. If immediately possible, contact 911. Give location and wait for confirmation.
- 2. Don SCBA and perform rescue operation using buddy system.

Toxic effects of hydrogen sulfide

Hydrogen sulfide is extremely toxic. The acceptable ceiling concentration for eight-hour exposure is 10 ppm, which is .001% by volume. Hydrogen sulfide is heavier than air (specific gravity – 1.192) and colorless. It forms an explosive mixture with air between 4.3 and 46.0 percent by volume. Hydrogen sulfide is almost as toxic as hydrogen cyanide and is between five and six times more toxic than carbon monoxide. Toxicity data for hydrogen sulfide and various other gases are compared in table i. Physical effects at various hydrogen sulfide exposure levels are shown in table ii.

Table i Toxicity of various gases

Common name	Chemical formula	Specific gravity (sc=1)	Threshold limit (1)	Hazardous limit (2)	Lethal concentration (3)
Hydrogen Cyanide	Hen	0.94	10 ppm	150 ppm/hr	300 ppm
Hydrogen Sulfide	H2S	1.18	10 ppm	250 ppm/hr	600 ppm
Sulfur Dioxide	So2	2.21	5 ppm	-	1000 ppm
Chlorine	C12	2.45	1 ppm	4 ppm/hr	1000 ppm
Carbon Monoxide	Co	0.97	50 ppm	400 ppm/hr	1000 ppm
Carbon Dioxide	Co2	1.52	5000 ppm	5%	10%
Methane	Ch4	0.55	90,000 ppm	Combustibl	e above 5% in air

- 1) threshold limit concentration at which it is believed that all workers may be repeatedly exposed day after day without adverse effects.
- 2) hazardous limit concentration that will cause death with short-term exposure.
- 3) lethal concentration concentration that will cause death with short-term exposure.

Toxic effects of hydrogen sulfide

Table ii
Physical effects of hydrogen sulfide

		Concentration	Physical effects
Percent (%)	<u>Ppm</u>	Grains	
		100 std. Ft3*	
0.001	<10	00.65	Obvious and unpleasant odor.

Use of self-contained breathing equipment (SCBA)

- 1. Written procedures shall be prepared covering safe use of SCBA's in dangerous atmosphere, which might be encountered in normal operations or in emergencies. Personnel shall be familiar with these procedures and the available SCBA.
- 2 SCBA's shall be inspected frequently at random to insure that they are properly used, cleaned, and maintained.
- 3. Anyone who may use the SCBA's shall be trained in how to insure proper face-piece to face seal. They shall wear SCBA's in normal air and then wear them in a test atmosphere. (note: such items as facial hair {beard or sideburns} and eyeglasses will not allow proper seal.) Anyone that may be reasonably expected to wear SCBA's should have these items removed before entering a toxic atmosphere. A special mask must be obtained for anyone who must wear eyeglasses or contact lenses.
- 4. Maintenance and care of SCBA's:
 - a. A program for maintenance and care of SCBA's shall include the following:
 - 1. Inspection for defects, including leak checks.
 - 2. Cleaning and disinfecting.
 - 3. Repair.
 - 4. Storage.
 - b. Inspection, self-contained breathing apparatus for emergency use shall be inspected monthly.
 - 1. Fully charged cylinders.
 - 2. Regulator and warning device operation.
 - 3. Condition of face piece and connections.
 - 4. Rubber parts shall be maintained to keep them pliable and prevent deterioration.
 - c. Routinely used SCBA's shall be collected, cleaned and disinfected as frequently as necessary to insure proper protection is provided.
- 5. Persons assigned tasks that requires use of self-contained breathing equipment shall be certified physically fit (medically cleared) for breathing equipment usage at least annually.
- 6. SCBA's should be worn when:
 - A. Any employee works near the top or on top of any tank unless test reveals less than 10 ppm of H2S.

- B. When breaking out any line where H2S can reasonably be expected.
- C. When sampling air in areas to determine if toxic concentrations of H2S exists.
- D. When working in areas where over 10 ppm H2S has been detected.
- E. At any time there is a doubt as to the H2S level in the area to be entered.

Rescue First aid for H2S poisoning

Do not panic!

Remain calm - think!

- 1. Don SCBA breathing equipment.
- 2. Remove victim(s) utilizing buddy system to fresh air as quickly as possible. (go up-wind from source or at right angle to the wind. Not down wind.)
- 3. Briefly apply chest pressure arm lift method of artificial respiration to clean the victim's lungs and to avoid inhaling any toxic gas directly from the victim's lungs.
- 4. Provide for prompt transportation to the hospital, and continue giving artificial respiration if needed.
- 5. Hospital(s) or medical facilities need to be informed, before-hand, of the possibility of H2S gas poisoning no matter how remote the possibility is.
- 6. Notify emergency room personnel that the victim(s) has been exposed to H2S gas.

Besides basic first aid, everyone on location should have a good working knowledge of artificial respiration.

Revised CM 6/27/2012