Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

NM OIL CONSERVATION					
NM OIL CONSE	1.				
260 Ares 2 2015					

FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

SUNDRY NOTICES AND REPORTS ON WELLS

	O HOLS AND TILL O				i initialitation of and the	
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals. RECEIVED					6. If Indian, Allottee or	Tribe Name
SUBMIT IN TRI	PLICAȚE - Other instruc	tions on reve	erse side.		7. If Unit or CA/Agreen	ment, Name and/or No.
Type of Well Gas Well Other Other					8. Well Name and No. TODD 22P FED 16	3
Name of Operator Contact: REBECCA DEAL DEVON ENERGY PRODUCTION CO EMail: REBECCA.DEAL@DVN.COM					9. API Well No. 30-015-32735-00	D-S1
3a. Address 333 WEST SHERIDAN AVE OKLAHOMA CITY, OK 73102	2	3b. Phone No. Ph: 405-228	(include area coc 3-8429	le)	10. Field and Pool, or I INGLE WELLS-[
4. Location of Well (Footage, Sec., T	., R., M., or Survey Description) .			11. County or Parish, a	nd State
Sec 22 T23S R31E SESE 660FSL 610FEL				EDDY COUNTY, NM		
					1.	
12. CHECK APPI	ROPRIATE BOX(ES) TO	DINDICATE	NATURE OF	NOTICE, F	REPORT, OR OTHER	RDATA
TYPE OF SUBMISSION	TYPE OF ACTION					
Notice of Intent	☐ Acidize	☐ Deep	oen .	☐ Produc	ction (Start/Resume)	☐ Water Shut-Off
	Alter Casing	☐ Frac	ture Treat	□ Reclar	mation	■ Well Integrity
☐ Subsequent Report	☐ Casing Repair	☐ New	Construction	☐ Recon	nplete	Other
☐ Final Abandonment Notice	☐ Change Plans	🗖 Plug	and Abandon	n ⊠ Temporarily Abandon		
	☐ Convert to Injection	Plug	Back	☐ Water	Disposal	
If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involved testing has been completed. Final Aldetermined that the site is ready for following procedures: -Test Anchors -MIRU WSU -ND WH, NU BOPE and test -Unset TAC and TOH w/ 2-7/8 -MIRU WL unit & make gauge -RIH and WL set CIBP @ 8,11	rk will be performed or provide operations. If the operation repandonment Notices shall be fil inal inspection.) mpany, LP respectfully re 3? tubing 2 run to 8,171? KBM 652 KBM	the Bond No. on sults in a multiple led only after all requests to run	file with BLM/Be completion or recompletion or recompletion or recompletion or recompletion of the an MIT on the	A. Required secompletion in a uding reclamati referenced value CONDI	ubsequent reports shall be a new interval, a Form 3160 on, have been completed, a well with TACHED FOTIONS OF A	ifiled within 30 days 3-4 shall be filed once and the operator has R PPROVAL I for record OCD A
-Dump bail 35? cement on top -RIH and WL set CIBP @ 6.4 -Dump bail 38? cement on top		PBTD at 6,39	99? KBM 99? KBM	st Pert)	813/15
. 14. Thereby certify that the foregoing is	strue and correct: Electronic Submission # For DEVON ENER nitted to AFMSS for proces	GY PRODUCT	ON CO LP, sei	nt to the Carls	sbad // /	/
Name (Printed/Typed) REBECC	A DEAL	. '	Title REG	JLATOŖÝ Ç	OMPLIANCE PROF	
Signature (Electronic	Submission)	,	Date 07/09	/201 6 AF	PROVED	
	THIS SPACE F	OR FEDERA	L OR STAT	E OFFICE I	USE/ /	/
Approved By			Title	J.M.	2 9 2015	Date_
Conditions of approval, if any, are attached certify that the applicant holds legal or equich would entitle the applicant to conditions.	uitable title to those rights in th		Office	BUREAU OI CARLSI	LAND MANAGEMENT BAD FIELD OFFICE	
Title 18 U.S.C. Section 1001 and Title 43	U.S.C. Section 1212, make it a	crime for any pe	erson knowingly	and willfully to	make to any department or	agency of the United

Additional data for EC transaction #308661 that would not fit on the form

32. Additional remarks, continued

-RD WL
-TIH with SN and 2-7/8? tubing to 6,375? KBM.
-Load and circulate hole with 2% KCL and corrosion inhibitor
-Test 5-1/2? casing and CIBP w/ cement plug to 500 psi at surface for 30 minutes, chart test and have BLM witness test
-Bleed off pressure, ND BOPE, NU WH
-RDMO WSU
Shut in well


-Shut-in well

TA?ing well to bring well into OCD compliance, until well can be evaluated.

Sel (04)

Devon respectfully requests a 2 year TA status for the captioned well.

Attached: Current and Proposed Wellbore Schematics.

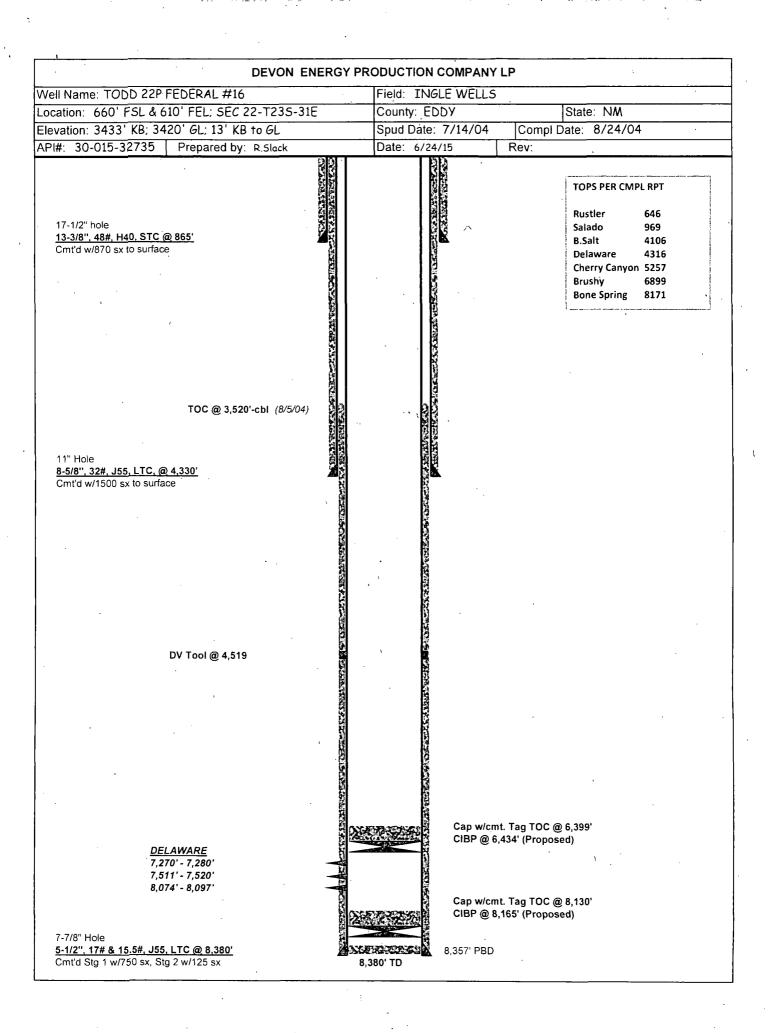

	•			
DEVON ENERGY	PRODUCTION COMPAN	Y LP		
Vell Name: TODD 22P FEDERAL #16	Field: INGLE WELL:	5.	ᅱ	
ocation: 660' FSL & 610' FEL; SEC 22-T235-31E	County: EDDY	State: NM	ᅱ	
levation: 3433' KB; 3420' GL; 13' KB to GL	Spud Date: 7/14/04	Compl Date: 8/24/04		
PI#: 30-015-32735 Prepared by: R.Slack	Date: 6/24/15	Rev:	\neg	
221	1 22	,	\neg	
		TOPS PER CMPL RPT		
17-1/2" hole		Rustler 646		
13-3/8", 48#, H40, STC @ 865'		Salado 969 B.Salt 4106	İ	
Cmt'd w/870 sx to surface		Delaware 4316		
		Cherry Canyon 5257		
8		Brushy 6899 Bone Spring 8171	l	
		Bone Spring 0171		
		•		
		Υ	- 1	
i i i i i i i i i i i i i i i i i i i		·		
			1	
TOC @ 3,520'-cbl (8/5/04)		1		
11" Hole 8-5/8", 32#, J55, LTC, @ 4,330'		•		
Cmt'd w/1500 sx to surface		•	l	
		1	ĺ	
20				
8				
		·	İ	
			İ	
S. Carlotte and the second second second second second second second second second second second second second			ĺ	
DV Tool @ 4,519				
			,	
		·		
	2_7/9" 4	5.5#, J55, production tubing <i>(11/6/</i> 09)		
	[] [] [] []	, coo, production tubing (1/1/0/09)		
<u>DELAWARE</u> 7.370' - 7.380'				
7,270' - 7,280' 7,511' - 7,520'				
8,074' - 8,097'	Rod Pu			
	Slotted	,112' (11/6/09) Mud Jt, EOT @ 8,143' (11/6/09)		
	Siotted			
7-7/8" Hole 5-1/2", 17# & 15.5#, J55, LTC @ 8,380'	8.357' PBI			
Cmt'd Stg 1 w/750 sx, Stg 2 w/125 sx	8,357' PBI 8,380' TD			

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Work to be completed by 01/29/2016.

1. Operator shall set a CIBP at 7,220' (50' above top most perf) and place 173' Class C cement on top.

TA status approved for a period of 12 months ending 01/29/2017 subject to conditions of approval.

Temporary Abandonment of Wells on Federal Lands Conditions of Approval

A temporarily abandoned well is defined as a completion that is not capable of production in paying quantities but which may have value as a service well. Pursuant to 43 CFR 3162.3-4 (c), no well may be temporarily abandoned for more than 30 days without the prior approval of the authorized officer.

Temporary Abandonment (TA) status approval requires a successful mechanical or casing integrity test as follows:

- 1. A Notice of Intent (NOI) Sundry Notice (Form 3160-5) requesting approval to run a mechanical integrity test (MIT) or casing integrity test (CIT).
- 2. A description of the temporary abandonment procedure.
 - a. A bridge plug or packer must be installed as close to 50 feet above any open perforations or open hole as possible. If a cement plug is used, the top of the cement must be verified by tagging. CIBP must be capped with minimum 25 sacks cement, placed with tubing, or 35 feet of cement if placed with bailer.
 - b. The wellbore must be filled with corrosion inhibited fluid and pressure tested to 500 psi. The casing shall be capable of holding this pressure for at least 30 minutes. Any leak-off will be evaluated.
 - c. All downhole production/injection equipment (tubing, rods, etc.) shall be removed from the casing if they are not isolated by a packer.
 - d. A bradenhead test must be conducted. If the test indicates a problem exists, a remedial plan and time frame for remediation shall be submitted within ninety (90) days of the test.
 - e. Contact the appropriate BLM office at least 24 hours prior to the scheduled Casing Integrity Test. For wells in Eddy County, 575-361-2822; Lea County 575-393-3612.
- 3. Provides justification why the well should be temporarily abandoned rather than permanently plugged and abandoned and an estimated date that the well will be returned to beneficial use or plugged and abandoned. 43 CFR 3162.3-4 (a) The operator shall promptly plug and abandon...wells in which oil or gas is not encountered in paying quantities...

Wells that successfully pass the casing integrity test **may** be approved for Temporary Abandonment (TA) status provided that the operator:

- 1. **Submits a subsequent Sundry Notice** (Form 3160-5) requesting TA approval <u>with well bore diagram</u> with all perforations and CIBP's and tops of cement on CIBP's.
- 2. Describes the temporary abandonment procedure.
- Attaches a clear copy or the original of the pressure test chart.
- 4. Give justification to allow well to be place in TA status and plan for future use of well with time frame that well will be place back on line or plans to P&A well will be submitted.

If the well does not pass the casing integrity test, then the operator shall within 30 days submit to BLM for approval one of the following:

- 1. A procedure to repair the casing so that a TA approval can be granted.
- 2. A procedure to plug and abandon the well.

Todd 22P Fed 16

- 1. Well is approved to be TA/SI for a period of 12 months or until 01/29/2017
- 2. This will be the last TA approval for this well.
- 3. Must submit NOI to recomplete or NOI to P&A. Must be submitted by 01/29/2017
- 4. COA's met at this time.