

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENTNMOCD
ArtesiaFORM APPROVED
OMB NO. 1004-0135
Expires: July 31, 2010**SUNDRY NOTICES AND REPORTS ON WELLS**
*Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.***SUBMIT IN TRIPLICATE - Other instructions on reverse side.**

1. Type of Well <input type="checkbox"/> Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other		5. Lease Serial No. NMNM0540701
2. Name of Operator MEWBOURNE OIL COMPANY Contact: JACKIE LATHAN E-Mail: jlathan@mewbourne.com		6. If Indian, Allottee or Tribe Name
3a. Address P O BOX 5270 HOBBS, NM 88241	3b. Phone No. (include area code) Ph: 575-393-5905	7. If Unit or CA/Agreement, Name and/or No.
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) Sec 19 T23S R27E NENE 185FNL 710FEL 32.296940 N Lat, 104.222478 W Lon		8. Well Name and No. JESTER 19 30 WOAHH FED COM 1H
		9. API Well No. 30-015-42830-00-X1
		10. Field and Pool, or Exploratory FOREHAND RANCH
		11. County or Parish, and State EDDY COUNTY, NM

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other Drilling Operations
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

06/05/15 Spud 17 1/2" hole. TD hole @ 460'. Ran 460' of 13 3/8" 54.5# J55 ST&C csg. Cemented with 500 sks Class C w/CaCl2. Mixed @ 14.8 #/g w/1.34 yd. Plug down @ 1:00 AM 06/06/15. Circ 147 sks of cmt to the pit. Tested BOPE to 3000# & Annular to 1500#. At 4:00 A.M. 06/07/15, tested csg to 1250# for 30 mins, held OK. WOC. Drilled out with 12 1/4" bit.

Chart & Schematic Attached.

Bond on file: NM1693 nationwide & NMB000919

NM OIL CONSERVATION

ARTESIA DISTRICT

OCT 30 2015

LSD 11/4/15
Accepted for record
NMOCD

RECEIVED

14. I hereby certify that the foregoing is true and correct. Electronic Submission #304681 verified by the BLM Well Information System For MEWBOURNE OIL COMPANY, sent to the Carlsbad Committed to AFMSS for processing by JENNIFER SANCHEZ on 10/20/2015 (15JAS0365SE)	
Name (Printed/Typed) JACKIE LATHAN	Title AUTHORIZED REPRESENTATIVE
Signature (Electronic Submission)	Date 06/11/2015
THIS SPACE FOR FEDERAL OR STATE OFFICE USE OCT 2 2015	
Approved By _____	Title _____
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.	Office _____
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.	

**** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED ****

MAN WELDING SERVICES, INC

Company Newbourne Date 6-6-15

Lease Jester 19/30 WDAH Fe. 1/2" 4/4 County Fold, Co. N.H.

Drilling Contractor Peterson 4243 Plug & Drill Pipe Size 12" O.D. 9' L.F.

Accumulator Pressure: 2850 Manifold Pressure: 1500 Annular Pressure: 850

Accumulator Function Test - OO&GO#2

To Check - **USABLE FLUID IN THE NITROGEN BOTTLES** (III.A.2.c.i. or ii or iii)

- Make sure all rams and annular are open and if applicable HCR is closed.
- Ensure accumulator is pumped up to working pressure! (Shut off all pumps)
- 1. Open HCR Valve. (If applicable)
- 2. Close annular.
- 3. Close all pipe rams.
- 4. Open one set of the pipe rams to simulate closing the blind ram.
- 5. For 3' ram stacks, open the annular to achieve the 50+ % safety factor. (5M and greater systems).
- 6. Record remaining pressure 1900 psi. Test fails if pressure is lower than required.
- a. {950 psi for a 1500 psi system} b. {1200 psi for a 2000 & 3000 psi system}
- 7. If annular is closed, open it at this time and close HCR.

~~To Check - PRECHARGE ON BOTTLES OR SPHERICAL (III.A.2.d)~~

- Start with manifold pressure at, or above, maximum acceptable pre-charge pressure:
 - a. {800 psi for a 1500 psi system} b. {1100 psi for 2000 and 3000 psi system}
- 1. Open bleed line to the tank, slowly. (gauge needle will drop at the lowest bottle pressure)
- 2. Close bleed line. Barely bump electric pump and see what pressure the needle jumps up to.
- 3. Record pressure drop 1000 psi. Test fails if pressure drops below minimum.
- Minimum: a. {700 psi for a 1500 psi system} b. {900 psi for a 2000 & 3000 psi system}

To Check - **THE CAPACITY OF THE ACCUMULATOR PUMPS** (III.A.2.f.)

- Isolate the accumulator bottles or spherical from the pumps & manifold:
- Open the bleed off valve to the tank, {manifold psi should go to 0 psi} close bleed valve.
- 1. Open the HCR valve, (if applicable)
- 2. Close annular
- 3. With pumps only, time how long it takes to regain the required manifold pressure.
- 4. Record elapsed time 53 sec. Test fails if it takes over 2 minutes.
- a. {950 psi for a 1500 psi system} b. {1200 psi for a 2000 & 3000 psi system}



MAN
WELDING SERVICES

WELDING • BOP TESTING
NIPPLE UP SERVICE • BOP LIFTS • TANDEM
MUD AND GAS SEPARATORS
Lovington, NM • 575-396-4540

Pg. 1 of

Company: Albuquerque Date: 6-6-15 Invoice # B70787

Lease: Jester R/O WOH Fed Gun #14 Drilling Contractor: Pattern Rig # 247




Plug Size & Type: 12" C22 Drill Pipe Size: 4 1/2" Tester: Matthew Davis

Required BOP: _____ Installed BOP: _____

*Appropriate Casing Valve Must Be Open During BOP Test *

* Check Valve Must Be Open/Disabled To Test Kill Line Valves *

4-3000
L-250
10 min

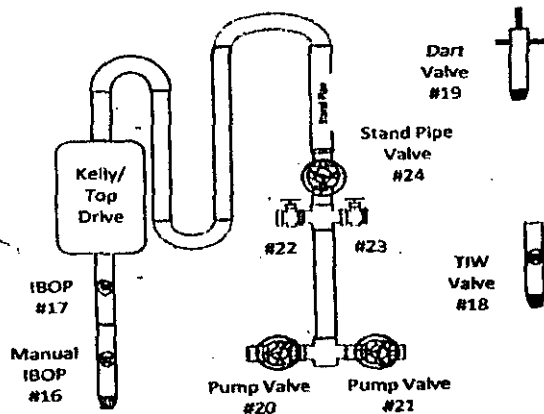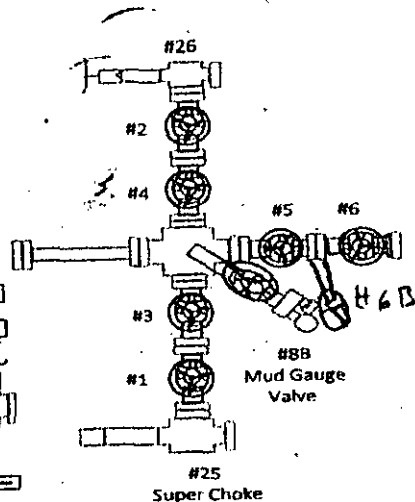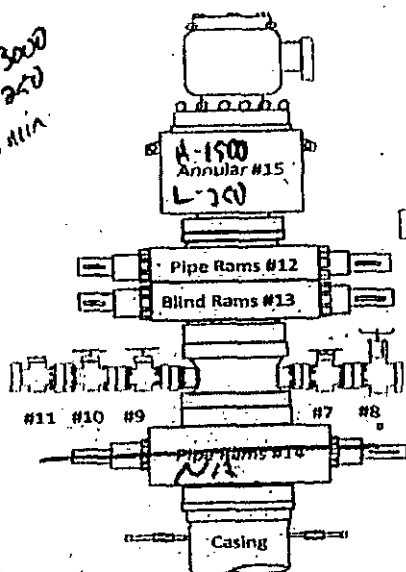



TEST #	ITEMS TESTED	TEST LENGTH	LOW PSI	HIGH PSI	REMARKS
1	15, 9, 7	10 min	250	1500	Good Test
2	12, 9, 7	10 min	250	3000	Good Test
3	12, 10, 8	10 min	250	3000	Good Test
4A	12, 10, AB, 5, 4, 3	10 min	250	3000	Low Good, Leak on High at Valve
4B	12, 10, AB, 5, 4, 3	10 min	—	3000	AB, Block off pressure to work valve. Pressure build up to High. High Good. Good Test
5	13, 11, 6, 2, 1, 6B	10 min	250	3000	Small bleed off on low, pressure build up, Low Good, bleed off on High. No bleed off, pressure build up, High Good. Good Test
6	13, 11, 6, 6B, 25, 26	Bump	—	3000	Bump Test Good
7	19	10 min	250	3000	Good Test
8	18	10 min	250	3000	Good Test
9	16	10 min	250	3000	Small bleed off on low, pressure build up, Low Good, High Good, Good Test
10	17	10 min	250	3000	Good Test
11A	20, 21, 22, 23	10 min	250	3000	Low Good, Leak on High at


Shut Valve Packing, Shut Valve Packing Tight


24 HR CHART 96 MIN CIRC
MIDNIGHT

CHART 1 OF 5

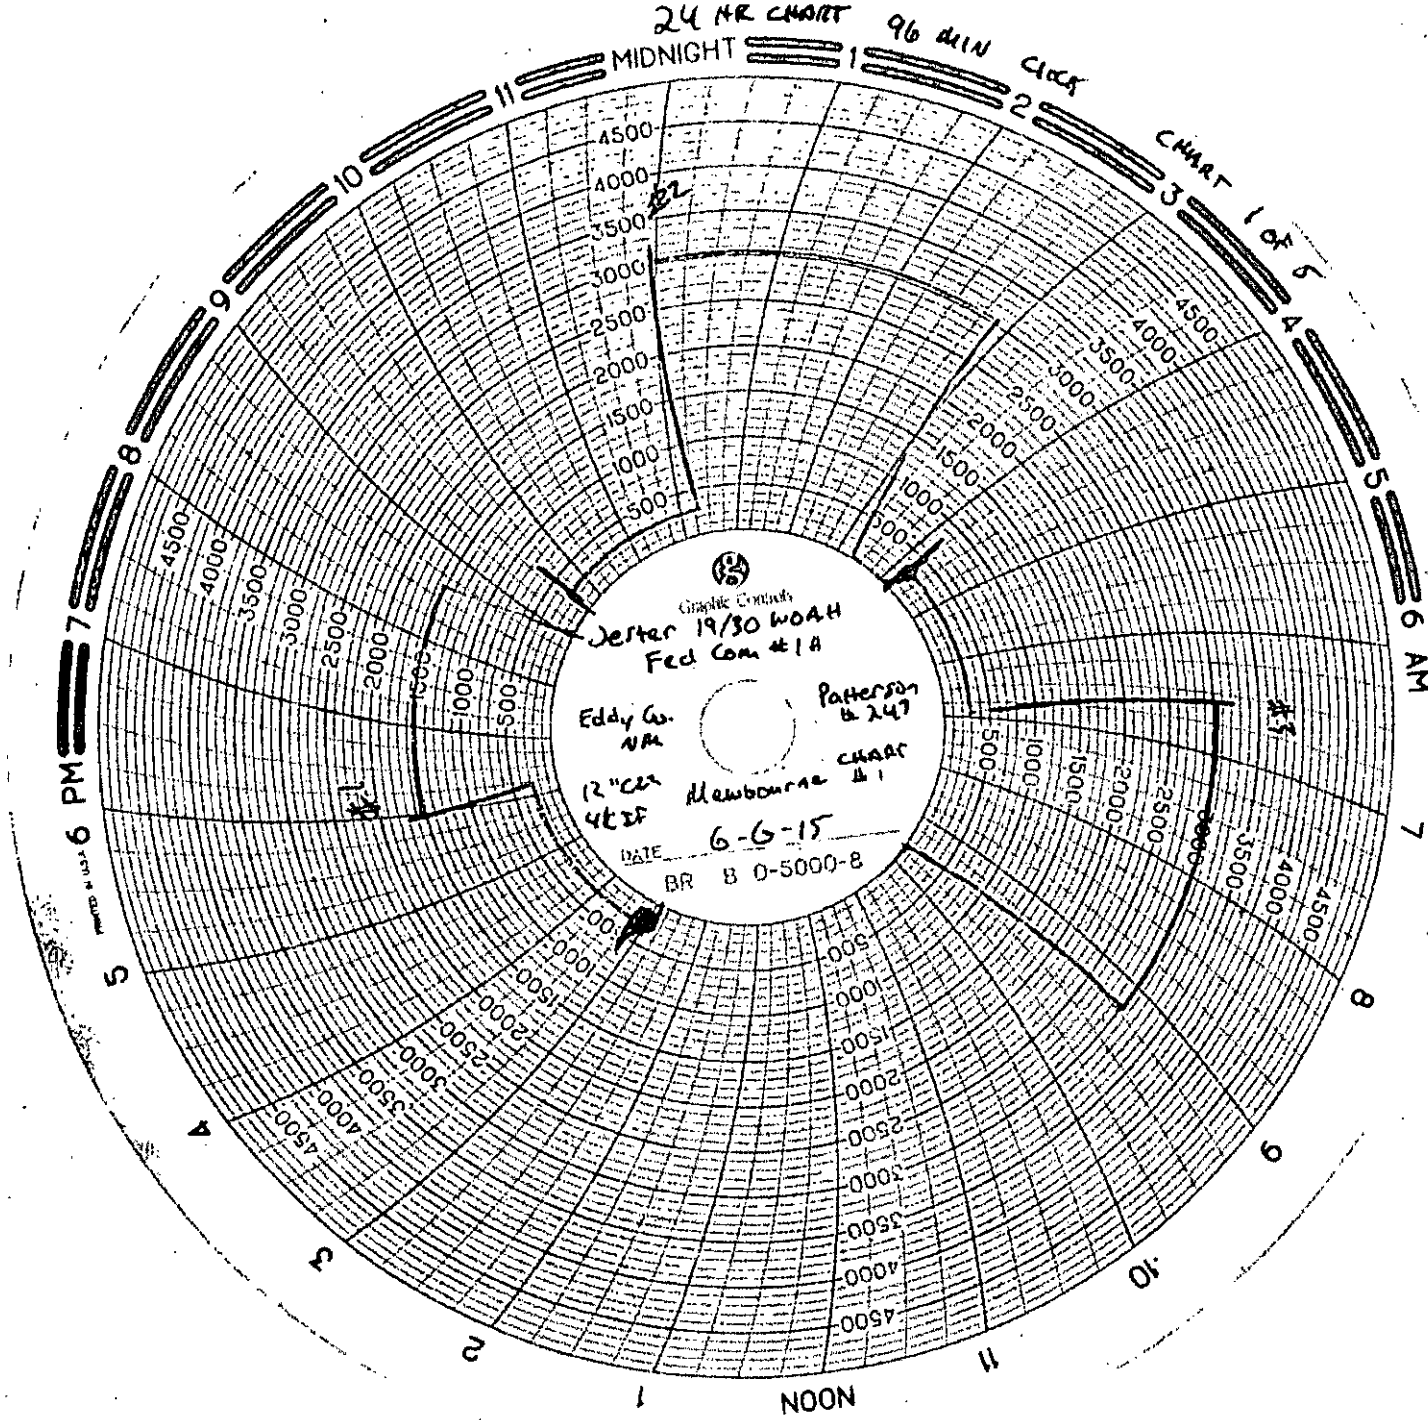

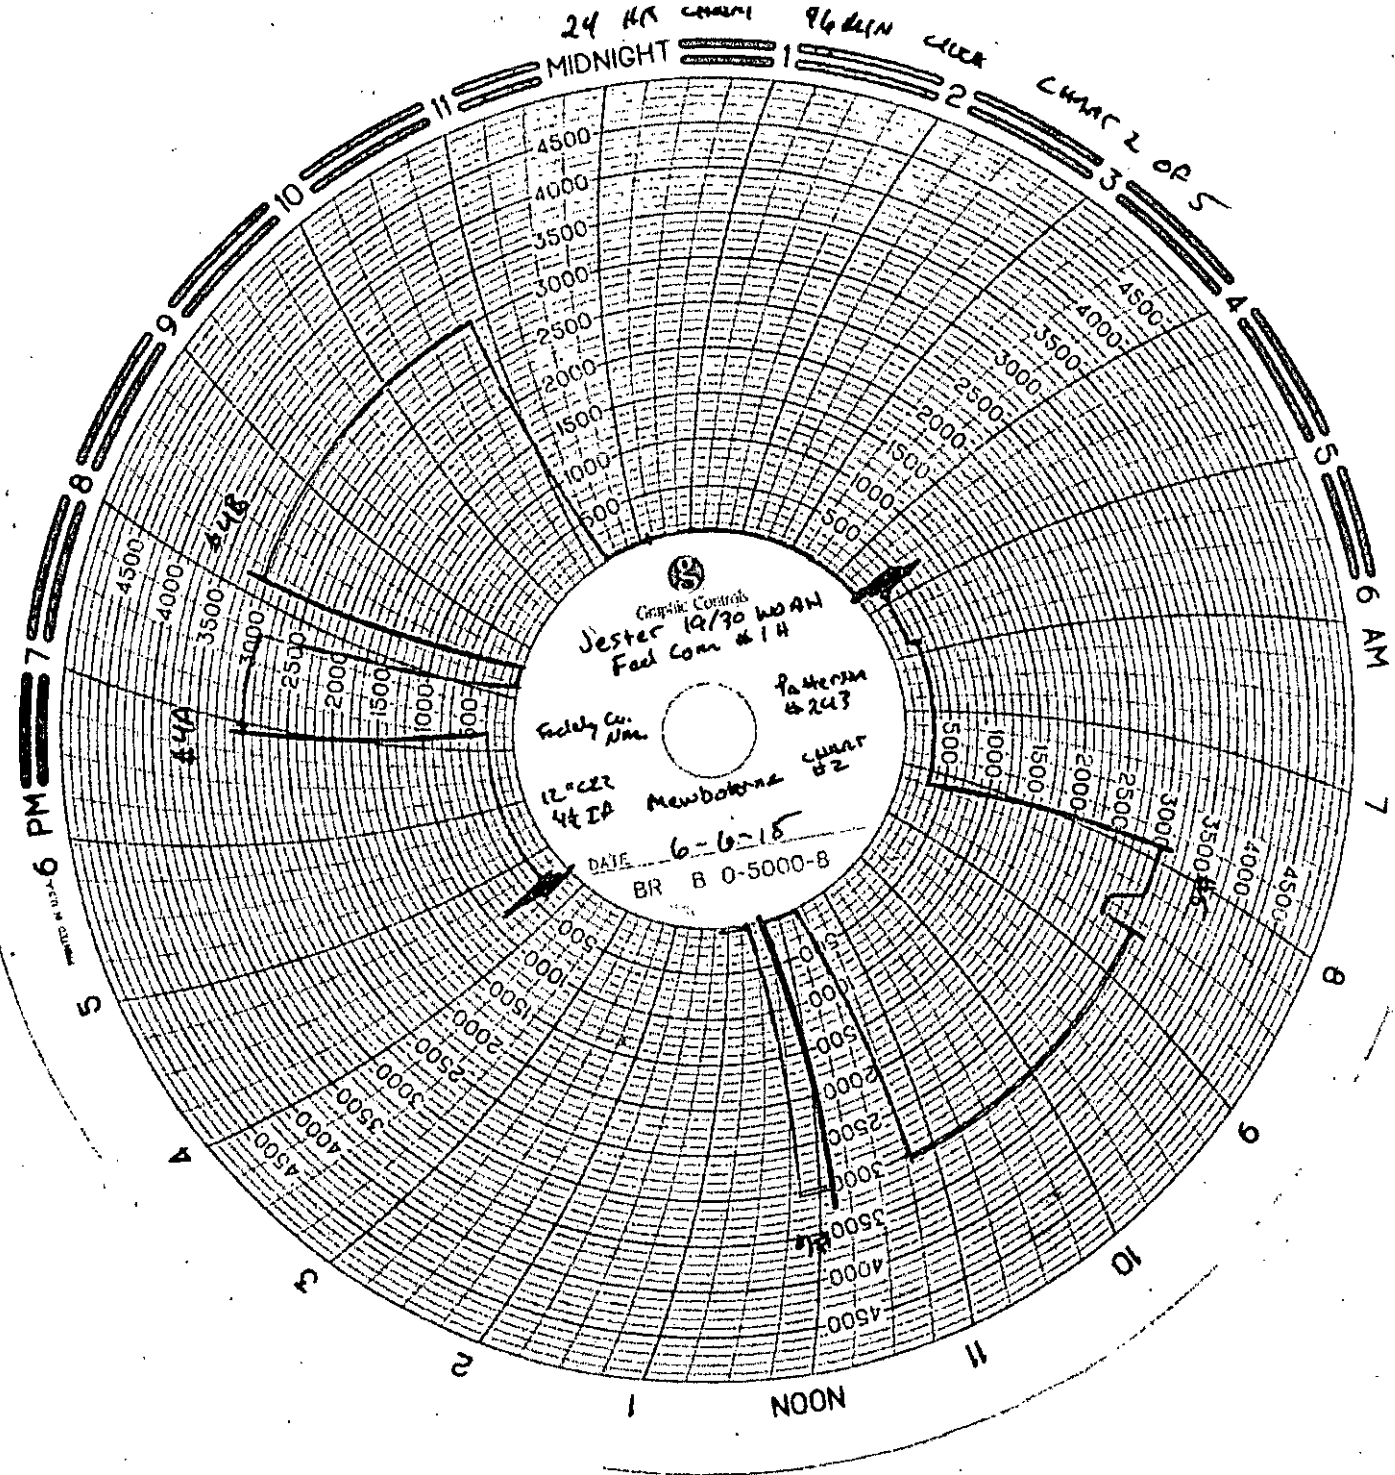

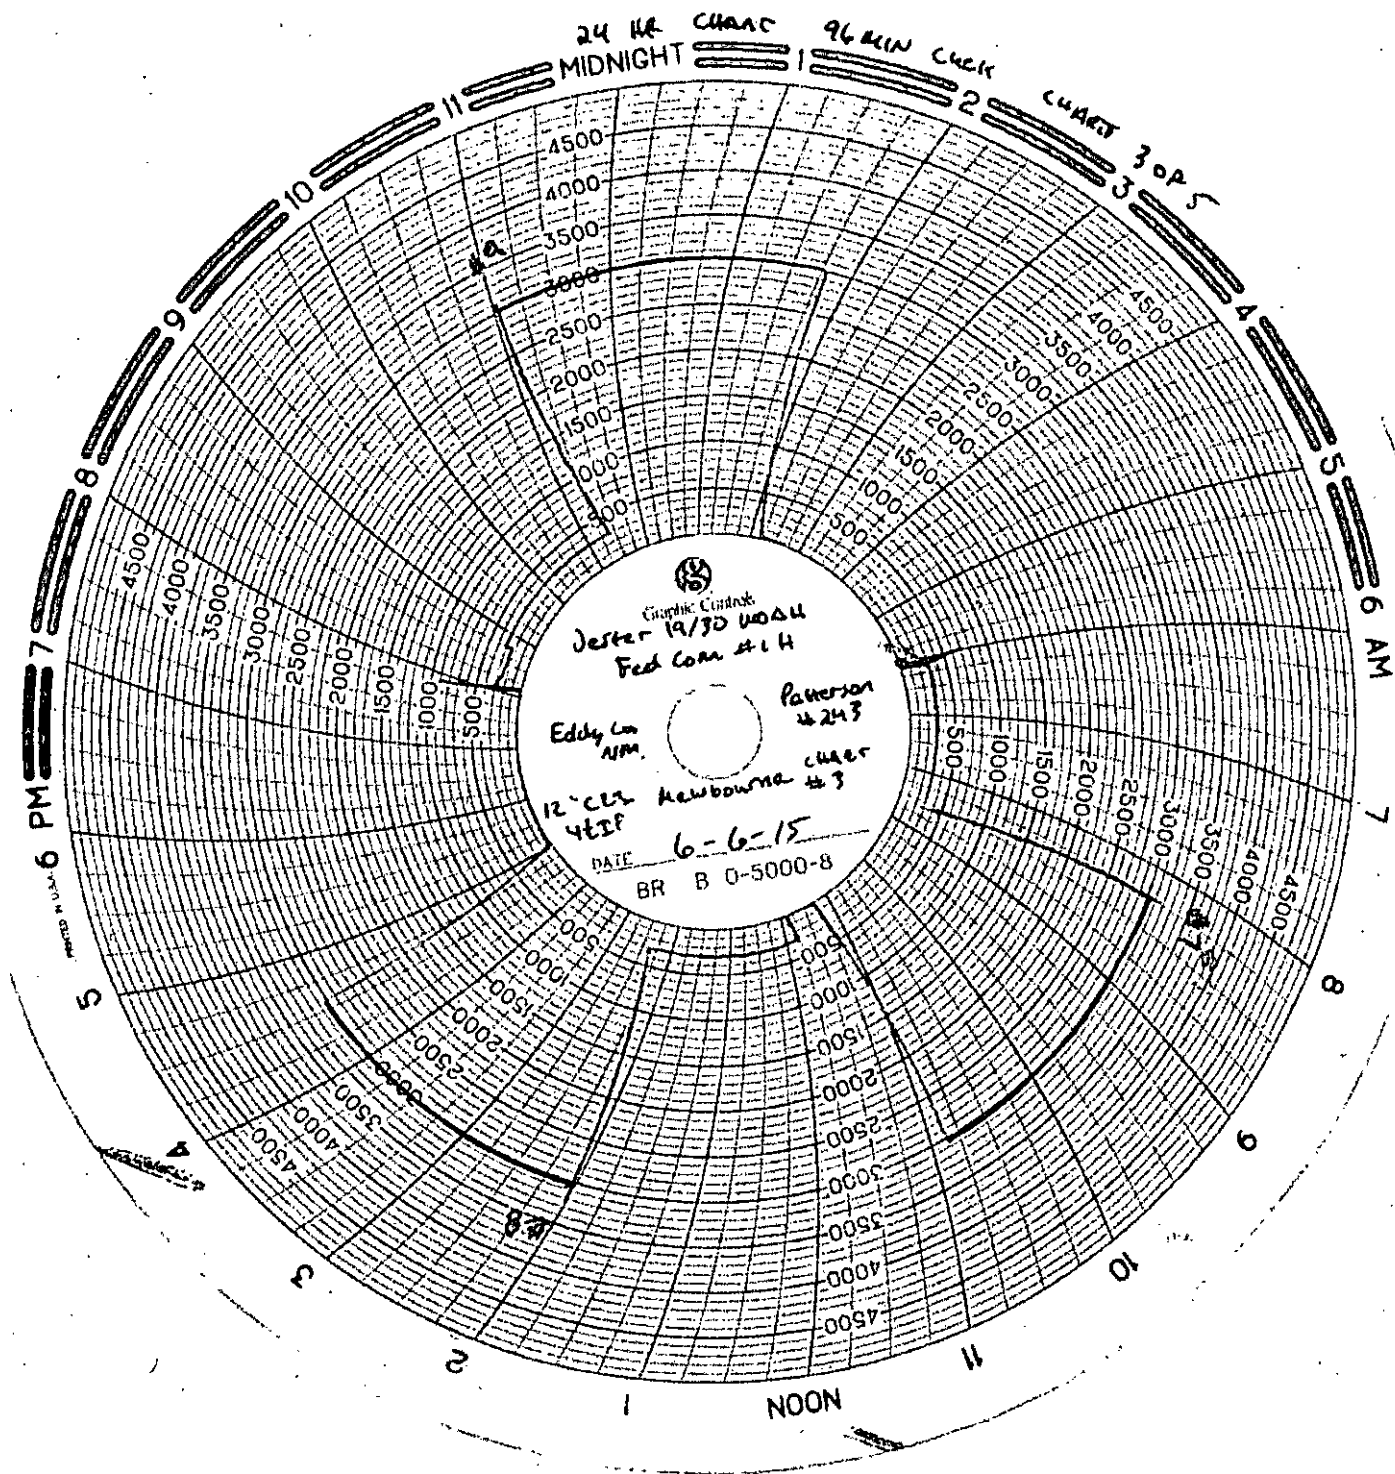

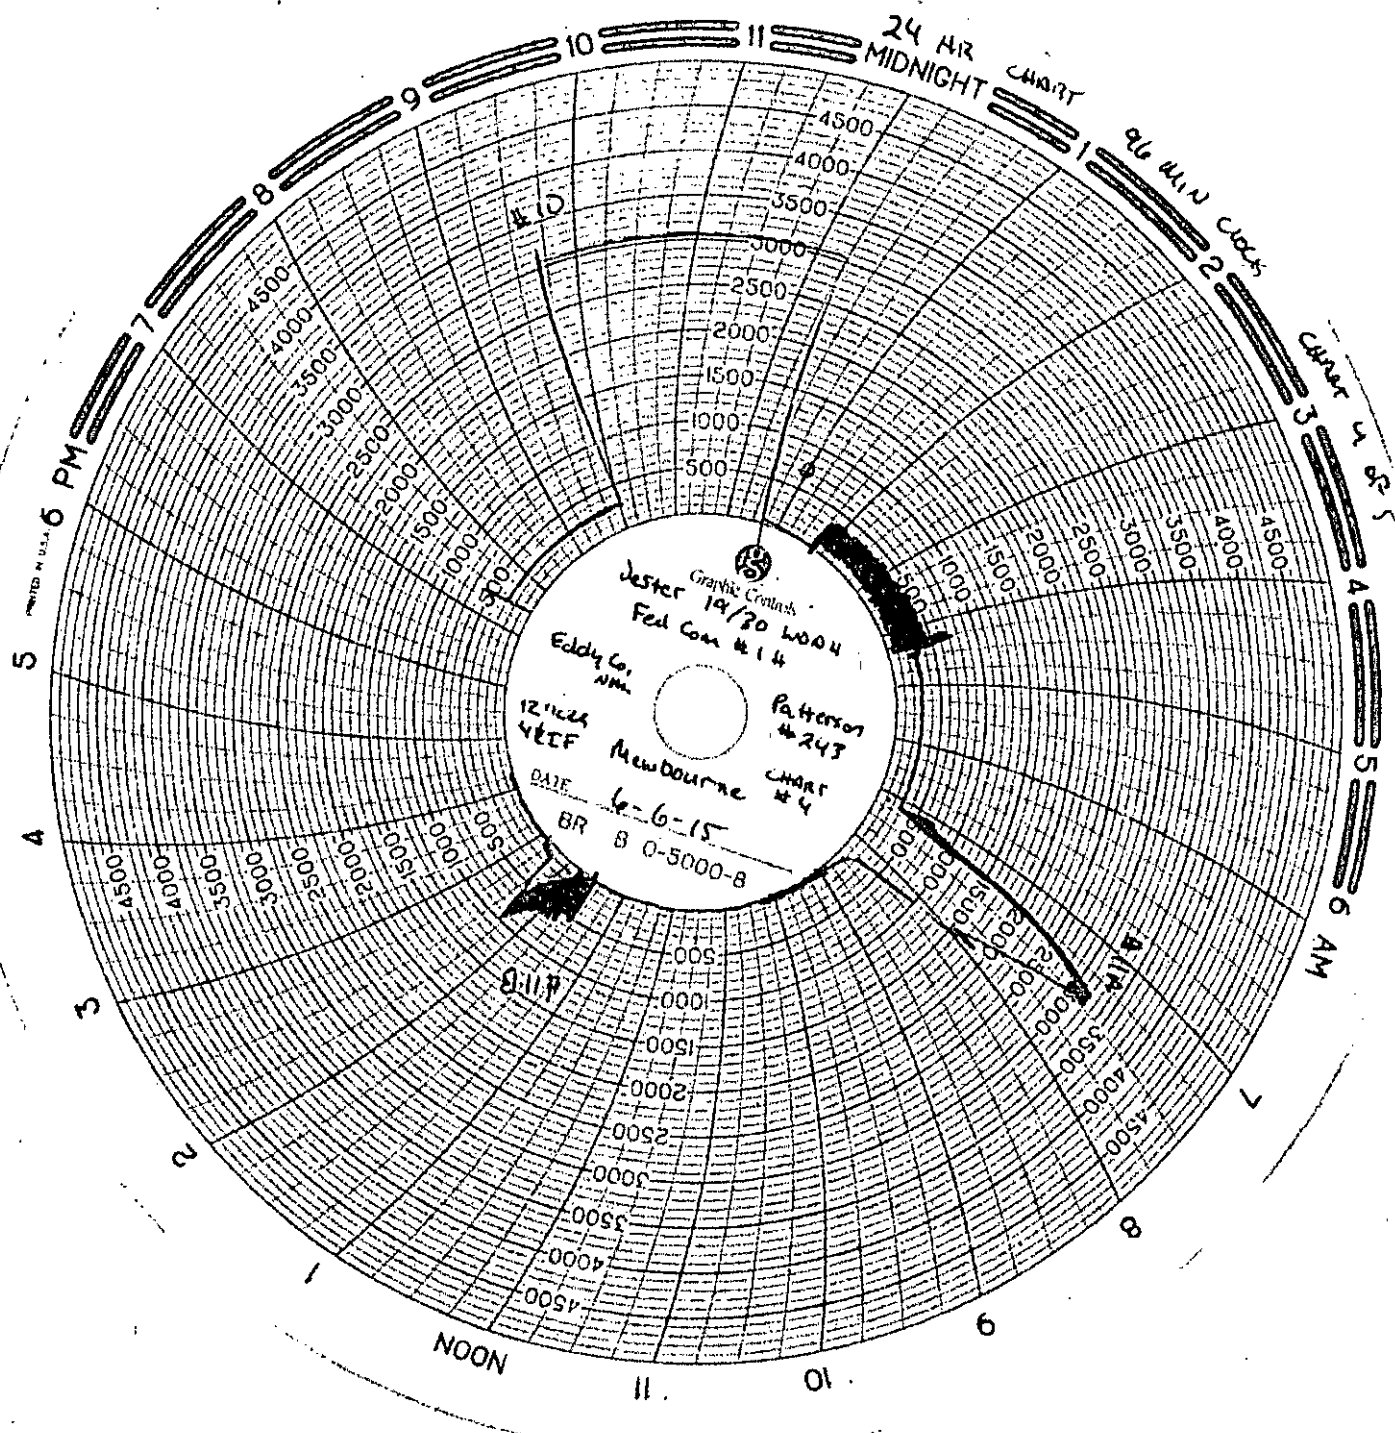

Graphic Controls
Jester 19/30 W004
Fed Com #14
Eddy Co, NM
Patterson #243
Newbourne
DATE 6-6-15
BR 8 0-5000-8

