	UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT			ARCEDIARDISTRICT DEC 3 0 2015		OMB N	APPROVED O. 1004-0135 July 31, 2010
	Do not use thi abandoned wei	s form for proposals to I. Use form 3160-3 (API	for proposals to drill or to re-enter an form 3160-3 (APD) for such proposals			6. If Indian, Allottee or Tribe Name	
SUBMIT IN TRIPLICATE - Other instructions on reverse side.						7. If Unit or CA/Agre NMNM84613	ement, Name and/or No.
1. Type of Well	ner			8. Well Name and No. CHARLOTTE MCKAY FEDERAL 2			
2. Name of Opera YATES PET	Contact: ORATIONE-Mail: tinah@yate	A n		9. API Well No. 30-015-26884-00-S1			
3a. Address 105 SOUTH ARTESIA, N		3b. Phone No. (include area code) Ph: 575-748-4168 Fx: 575-748-4585			10. Field and Pool, or Exploratory DAGGER DRAW		
		. R., M. or Survey Description,				11. County or Parish, and State	
	6 R24E NWNW 66		EDDY COUNTY, NM				
1	2. CHECK APPF	ROPRIATE BOX(ES) TO) INDICATE	NATURE OF I	NOTICE, R	LEPORT, OR OTHE	R DATA
TYPE OF S	SUBMISSION TYPE OF ACTION						
🛛 Notice of I	ntent	🗋 Acidize	🗖 Deep	en	Product	tion (Start/Resume)	U Water Shut-Off
		Alter Casing	🗖 Fract	ture Treat	🗖 Reclam	ation .	U Well Integrity
🗋 Subsequent	t Report	🗖 Casing Repair	🗖 New	Construction	. 🗖 Recom	plete	□ Other
🔲 Final Aband	donment Notice	Change Plans	🛛 Plug	and Abandon	🔲 Tempo:	rarily Abandon	
		Convert to Injection 🔲 Plug		g Back 🛛 🗖 Water I		Disposal	
current dowr	nturn in economic	no longer wishes to plugb conditions. We now wish as needed. NU BOP. No I to the surface.	n to plug and a	ibandon this we ery will be atten	ell as follows	, ATTAU	PROCEDURE HED
production c 2. Set a CIBI Canyon perfi 3. Spot a 35 4. Spot a 35 5. Spot a 35 6. Spot a 35 tag, reset plu	P at 7554 ft and ci s. sx Class C cemer sx Class C cemer sx Class C cemer sx Class C cemer ug if necessary. y that the foregoing is Comm	nt plug from 5791 ft - 6000 nt plug from 3031 ft - 3 240 nt plug from 1941 ft - 2150 nt plug from 908 ft - 1117 true and correct. Electronic Submission #3 For YATES PETRO hitted to AFMSS for proces	0 ft across Wo 0 ft across Bo 0 ft across Glo ft across the SEE CUIN 321740 verified DLEUM CORPC	Difcamp top and ne Spring top. Surface casing s ATTACHE UTITUNS I by the BLM We DRATION, sent t FER SANCHEZ	stage tool. 30% - 3 shoe. WOC DFOR UFALP If Information the Carlsbir on 11/13/2015	Tos Plug 290 and cept (2) N N N N N N N N N N N N N N N N N	ed for record MOCD <u>ا (د ح</u> C
production c 2. Set a CIBI Canyon perf 3. Spot a 35 4. Spot a 35 5. Spot a 35 6. Spot a 35 tag, reset plu 14. Thereby certif Name (Printed/	P at 7554 ft and ca s. sx Class C cemer sx Class C cemer sx Class C cemer sx Class C cemer ug if necessary. y that the foregoing is Comm <i>Typed)</i> TINA HUE	nt plug from 5791 ft - 6000 nt plug from 3031 ft - 3241 nt plug from 1941 ft - 2150 nt plug from 908 ft - 1117 true and correct. Electronic Submission #3 For YATES PETRO itted to AFMSS for process RTA	0 ft across Wo 0 ft across Bo 0 ft across Glo ft across the SEE CUIN 321740 verified DLEUM CORPC	Difcamp top and ne Spring top. Surface casing s ATTACHE DITIVINS I by the BLM We DRATION, sent FER SANCHEZ C Title REG R	stage tool. 3080-3 shoe. WOC D FOR OF A P The formation to the Carisbi on 11/13/2015 EPORTING	Tog P/49 290' and .w:Ceptu (R) N StemL ad 5 (16JAS1157SE)	
production c 2. Set a CIBI Canyon perf 3. Spot a 35 4. Spot a 35 5. Spot a 35 6. Spot a 35 tag, reset plu	P at 7554 ft and ci s. sx Class C cemer sx Class C cemer sx Class C cemer sx Class C cemer ug if necessary. y that the foregoing is Comm	nt plug from 5791 ft - 6000 nt plug from 3031 ft - 3246 nt plug from 1941 ft - 2150 nt plug from 908 ft - 1117 true and correct. Electronic Submission #3 For YATES PETRO itted to AFMSS for proces RTA	0 ft across Wo 0 ft across Bo 0 ft across Glo ft across the SEE CUII 321740 verified DLEUM CORPO sing by JENNI	Difcamp top and ne Spring top, orieta top, surface casing s ATTACHE DITIUNS I by the BLM We DRATION, sent to FER SANCHEZ C Title REG R Date 10/27/2	stage tool. 30% - 3 shoe. WOC D FOR I formation D F Al 'P I formation D F OR I formation EPORTING	Tos Plug 290 and Cept (PD N System ad 5 (16JAS1157SE) SUPERVISOR	
production c 2. Set a CIBI Canyon perf 3. Spot a 35 4. Spot a 35 5. Spot a 35 6. Spot a 35 tag, reset plu 14. Thereby certif Name (Printed/	P at 7554 ft and ca s. sx Class C cemer sx Class C cemer sx Class C cemer sx Class C cemer ug if necessary. y that the foregoing is Comm <i>Typed)</i> TINA HUE	nt plug from 5791 ft - 6000 nt plug from 3031 ft - 3241 nt plug from 1941 ft - 2150 nt plug from 908 ft - 1117 true and correct. Electronic Submission #3 For YATES PETRO itted to AFMSS for process RTA	0 ft across Wo 0 ft across Bo 0 ft across Glo ft across the SEE CUII 321740 verified DLEUM CORPO sing by JENNI	Difcamp top and ne Spring top, orieta top, surface casing s ATTACHE DITIUNS I by the BLM We DRATION, sent to FER SANCHEZ C Title REG R Date 10/27/2	stage tool. 30% - 3 shoe. WOC D FOR I formation D F Al 'P I formation D F OR I formation EPORTING	Tos Plug 290 and Cept (PD N System ad 5 (16JAS1157SE) SUPERVISOR	
production c. 2. Set a CIB Canyon perf. 3. Spot a 35 4. Spot a 35 5. Spot a 35 6. Spot a 35 tag, reset plu 14. Thereby certif Name (Printed/ Signature	P at 7554 ft and ca s. sx Class C cemer sx Class C cemer sx Class C cemer sx Class C cemer ug if necessary. (y that the foregoing is Comm <i>Typed</i>) TINA HUE (Electronic S	nt plug from 5791 ft - 6000 nt plug from 3031 ft - 3241 nt plug from 1941 ft - 2150 nt plug from 908 ft - 1117 true and correct. Electronic Submission #3 For YATES PETRO itted to AFMSS for process RTA submission) THIS SPACE FO	0 ft across Wo 0 ft across Bo 0 ft across Glo ft across the SEE CUIN 321740 verified DIEUM CORPC sing by JENNI DR FEDERA	Difcamp top and ne Spring top, orieta top, surface casing s ATTACHE DITIUNS I by the BLM We DRATION, sent to FER SANCHEZ C Title REG R Date 10/27/2	stage tool. 30% - 3 shoe. WOC D FOR I formation D F Al 'P I formation D F OR I formation EPORTING	Tos Plug 290 and Cept (PD N System ad 5 (16JAS1157SE) SUPERVISOR	
production c. 2. Set a CIBI Canyon perf: 3. Spot a 35 4. Spot a 35 5. Spot a 35 6. Spot a 35 tag, reset plu 14. Thereby certif Name (Printed/ Signature 	P at 7554 ft and ca s. sx Class C cemer sx Class C cemer sx Class C cemer sx Class C cemer ug if necessary. y that the foregoing is Comm <i>Typed</i>) TINA HUE (Electronic S	nt plug from 5791 ft - 6000 nt plug from 3031 ft - 3241 nt plug from 1941 ft - 2150 nt plug from 908 ft - 1117 true and correct. Electronic Submission #3 For YATES PETRO hitted to AFMSS for process RTA Submission) THIS SPACE FO A Approval of this notice does hitable title to those rights in the	0 ft across Wo 0 ft across Bo 0 ft across Glo ft across the s SEE CUII 321740 verified DLEUM CORPO sing by JENNI DR FEDERA	Difcamp top and ne Spring top, orieta top, surface casing s ATTACHE DITIUNS I by the BLM We DRATION, sent to FER SANCHEZ O Title REG R Date 10/27/2 L OR STATE	stage tool. 30% - 3 shoe. WOC D FOR I formation D F Al 'P I formation D F OR I formation EPORTING	Tos Plug 290 and Cept (PD N System ad 5 (16JAS1157SE) SUPERVISOR	
production c. 2. Set a CIBI Canyon perf. 3. Spot a 35 4. Spot a 35 5. Spot a 35 6. Spot a 35 tag, reset plu 14. Thereby certif Name (Printed/ Signature Approved By Conditions of approvertify that the applic which would entitle Fitte 18 U.S.C. Secti	P at 7554 ft and ca s. sx Class C cemer sx Class C cemer sx Class C cemer sx Class C cemer ug if necessary. (y that the foregoing is Comm <i>Typed</i>) TINA HUE (Electronic S (Electronic S (Electronic S) (Electronic S) (U) (U) (U) (U) (U) (U) (U) (U) (U) (U)	nt plug from 5791 ft - 6000 nt plug from 3031 ft - 3241 nt plug from 1941 ft - 2150 nt plug from 908 ft - 1117 true and correct. Electronic Submission #3 For YATES PETRO hitted to AFMSS for process RTA Submission) THIS SPACE FO A Approval of this notice does hitable title to those rights in the	0 ft across Wo 0 ft across Bo 0 ft across Glo ft across the s SEE CUII 321740 verified DLEUM CORPO sing by JENNI DR FEDERA not warrant or subject lease crime for any per	Difcamp top and ne Spring top, orieta top, surface casing s ATTACHE UTTACHE UTTACHE Diffice CAS Office CAS and Constants Date 10/27/2 LOR STATE	stage tool. 3080 - 3 shoe. WOC D FOR UF A 7 P If Information to the Carlsb on 11/13/2015 EPORTING 015 OFFICE U	Top Plug 290 and Cept (20 N SUPERVISOR SUPERVISOR SE	Date /2/22/

*


.'


.

Additional data for EC transaction #321740 that would not fit on the form

32. Additional remarks, continued 400 (Care depth - 350')
7. Spot a 35 sx Class C cement plug from 0 - 209 ft forming the surface plug. WOC and tag, reset plug if necessary.
9. Remove all surface equipment and weld dry hole marker per regulations.

Wellbore schematics attached

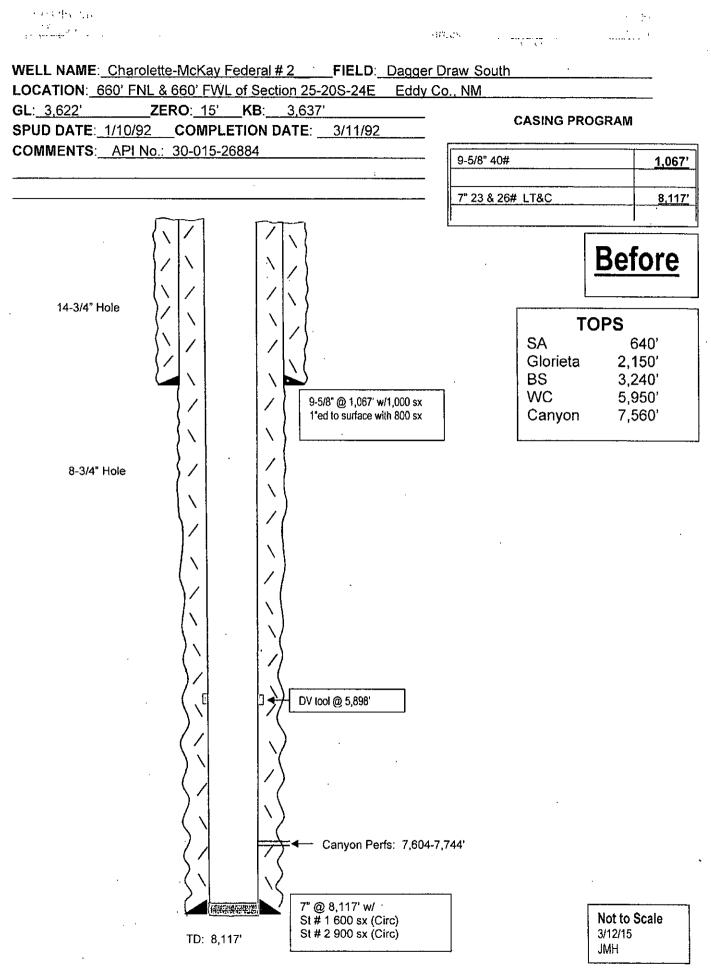

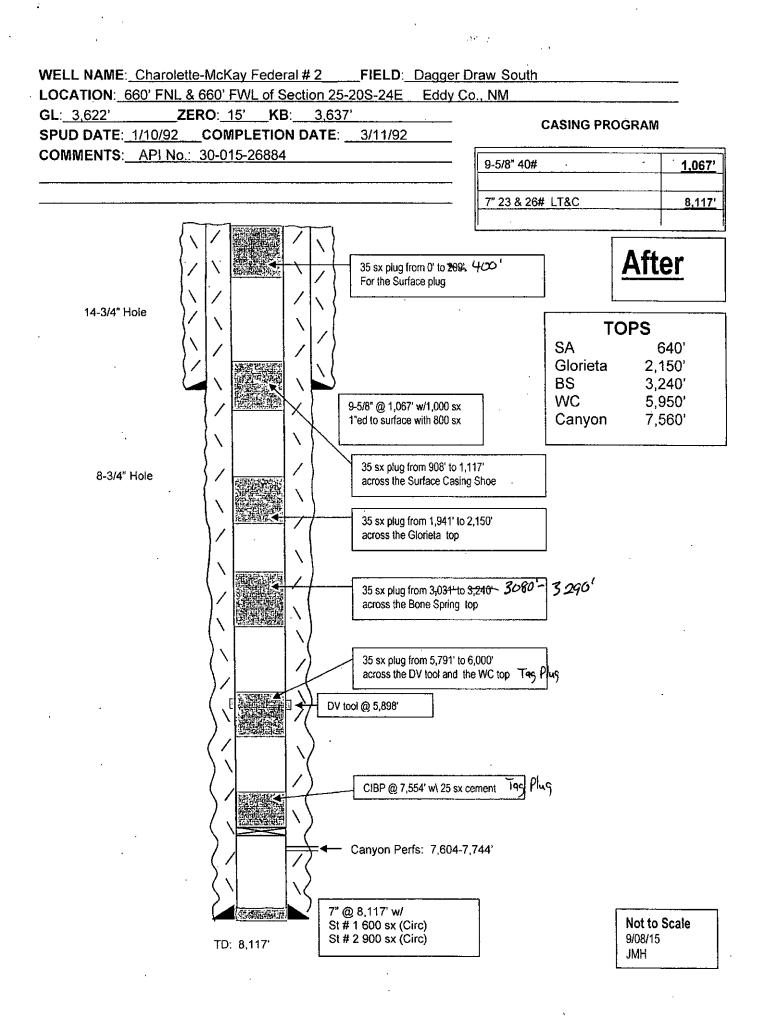

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT Carlsbad Field Office .620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most - cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.

- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.
- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Linda Denniston Environmental Protection Specialist 575-234-5974

Henryetta Price Environmental Protection Specialist 575-234-5951

Dara Glass Environmental Protection Specialist 575-234-5924

Shelly Tucker Environmental Protection Specialist 575-234-5979