

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
October 13, 2009

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-25787	✓
5. Indicate Type of Lease STATE ☒ FEE ☐	✓
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name Petrus D	✓
8. Well Number 1	✓
9. OGRID Number 229137	✓
10. Pool name or Wildcat Maljamar Grayburg-San Andres	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐ **HOBBS OCD**

2. Name of Operator
COG Operating LLC

3. Address of Operator
600 W. Illinois, Midland, TX 79701

4. Well Location
Unit Letter **O** : **1980** feet from the **E** line and **660** feet from the **S** line
Section **11** Township **17S** Range **33E** NMPM County **Lea**

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
4154.8' GR

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK	INT TO PA PA-X P&A NR _____ P&A R _____
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS.	
PULL OR ALTER CASING ☐	MULTIPLE COMPL ☐	CASING/CEMENT JOB	
DOWNHOLE COMMINGLE ☐			
OTHER: ☐		OTHER: _____	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Set 5 1/2 CIBP @ 4400'. Circulate hole w/ mud laden fluid. Pressure test csg. Spot 25 sx cmt 4400-4300'.
2. Spot 25 sx cmt @ 2850-2750'. WOC & Tag
3. Spot 25 sx cmt @ 1525-1425'.
4. Spot 25 sx cmt @ 465-365'. WOC & Tag **TO SURFACE**
5. Spot 25 sx cmt @ 100' Surface.
6. Cut off well head, weld on dry Hole Marker.
Verify cmt to surface

Spud Date:

NOTIFY OCD 24 HOURS PRIOR TO
BEGINNING PLUGGING OPERATIONS

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Ben Montgomery TITLE Agent DATE 2-15-17
Type or print name Ben Montgomery E-mail address: benm@bcmmandassociates.com PHONE: 432-580-7161
For State Use Only
APPROVED BY: Mark Pitman TITLE Petroleum Engr. Specialist DATE 02/16/2017
Conditions of Approval (if any):

AM

COG Operating LLC


Lease & Well # Petrus D #1

30-025-25787

Spud - 2/25/78

Elevation - ' GR

KB -

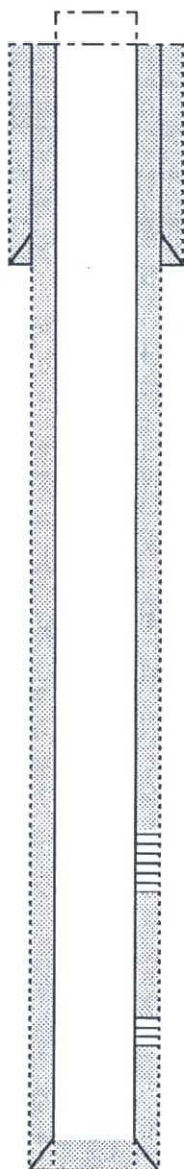

8 5/8" 24# K-55@ 415', 340 sx cmt circ cmt.

Grayburg

4446-4586, 10 holes

Acidized w/3000 gal 15% NEFE

Fraced w/22,500 gal lg, 27,000 # sd

San Andres

4630-4658

Acidized w/1,950 gal 15% NEFE + 4,000 gal 15% NEFE

PBTD-4685'

5 1/2" 14 # K-55 csg @ 4709', cmt w/1000 sx Lite, 350 sx CL C.
Circulated cmt.

Lat 32.8438377

Long -103.6318207

444

COG Operating LLC

Lease & Well #


Petrus D #1

30-025-25787

Spud - 2/25/78

Elevation - ' GR

8 5/8" 24# K-55 @ 415', 340 sx cmt circ cmt.

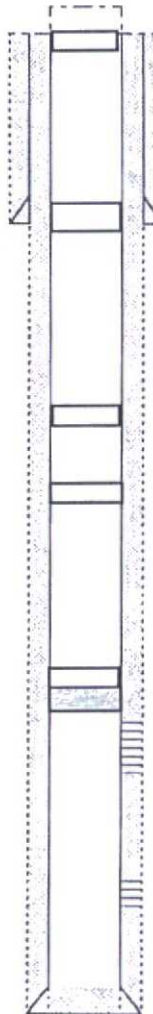

5. Spot 25 sx cmt @ 100'-Surface.

4. Spot 25 sx cmt @ 465-365'. WOC & Tag

3. Spot 25 sx cmt @ 1525-1425'.

2. Spot 25 sx cmt @ 2850-2750'. WOC & Tag

1. Set 5 1/2 CIBP @ 4400'. Circulate hole w/ mud laden fluid. Pressure test csg.
Spot 25 sx cmt 4400-4300'.

Grayburg

4446-4586, 10 holes

Acidized w/3000 gal 15% NEFE

Fraced w/22,500 gal lg. 27,000 # sd

San Andres

4630-4658

Acidized w/1,950 gal 15% NEFE + 4,000 gal 15% NEFE

PBTD-4685'

5 1/2" 14 # K-55 csg @ 4709', cmt w/1000 sx Lite, 350 sx CL C.
Circulated cmt.

Lat 32.8438377

Long -103.6318207